

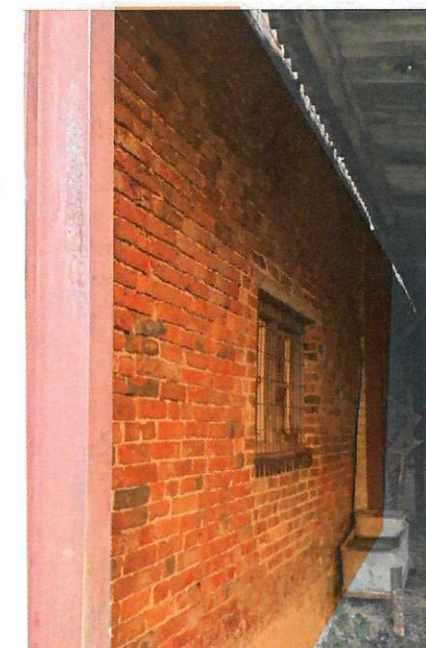
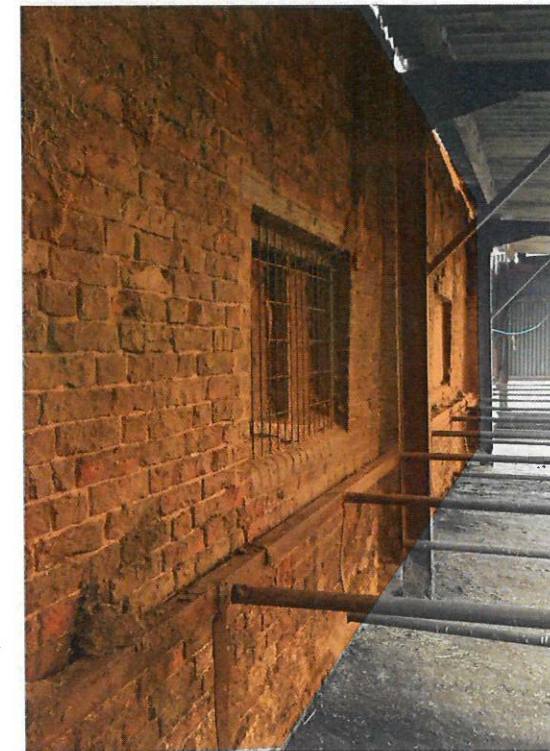
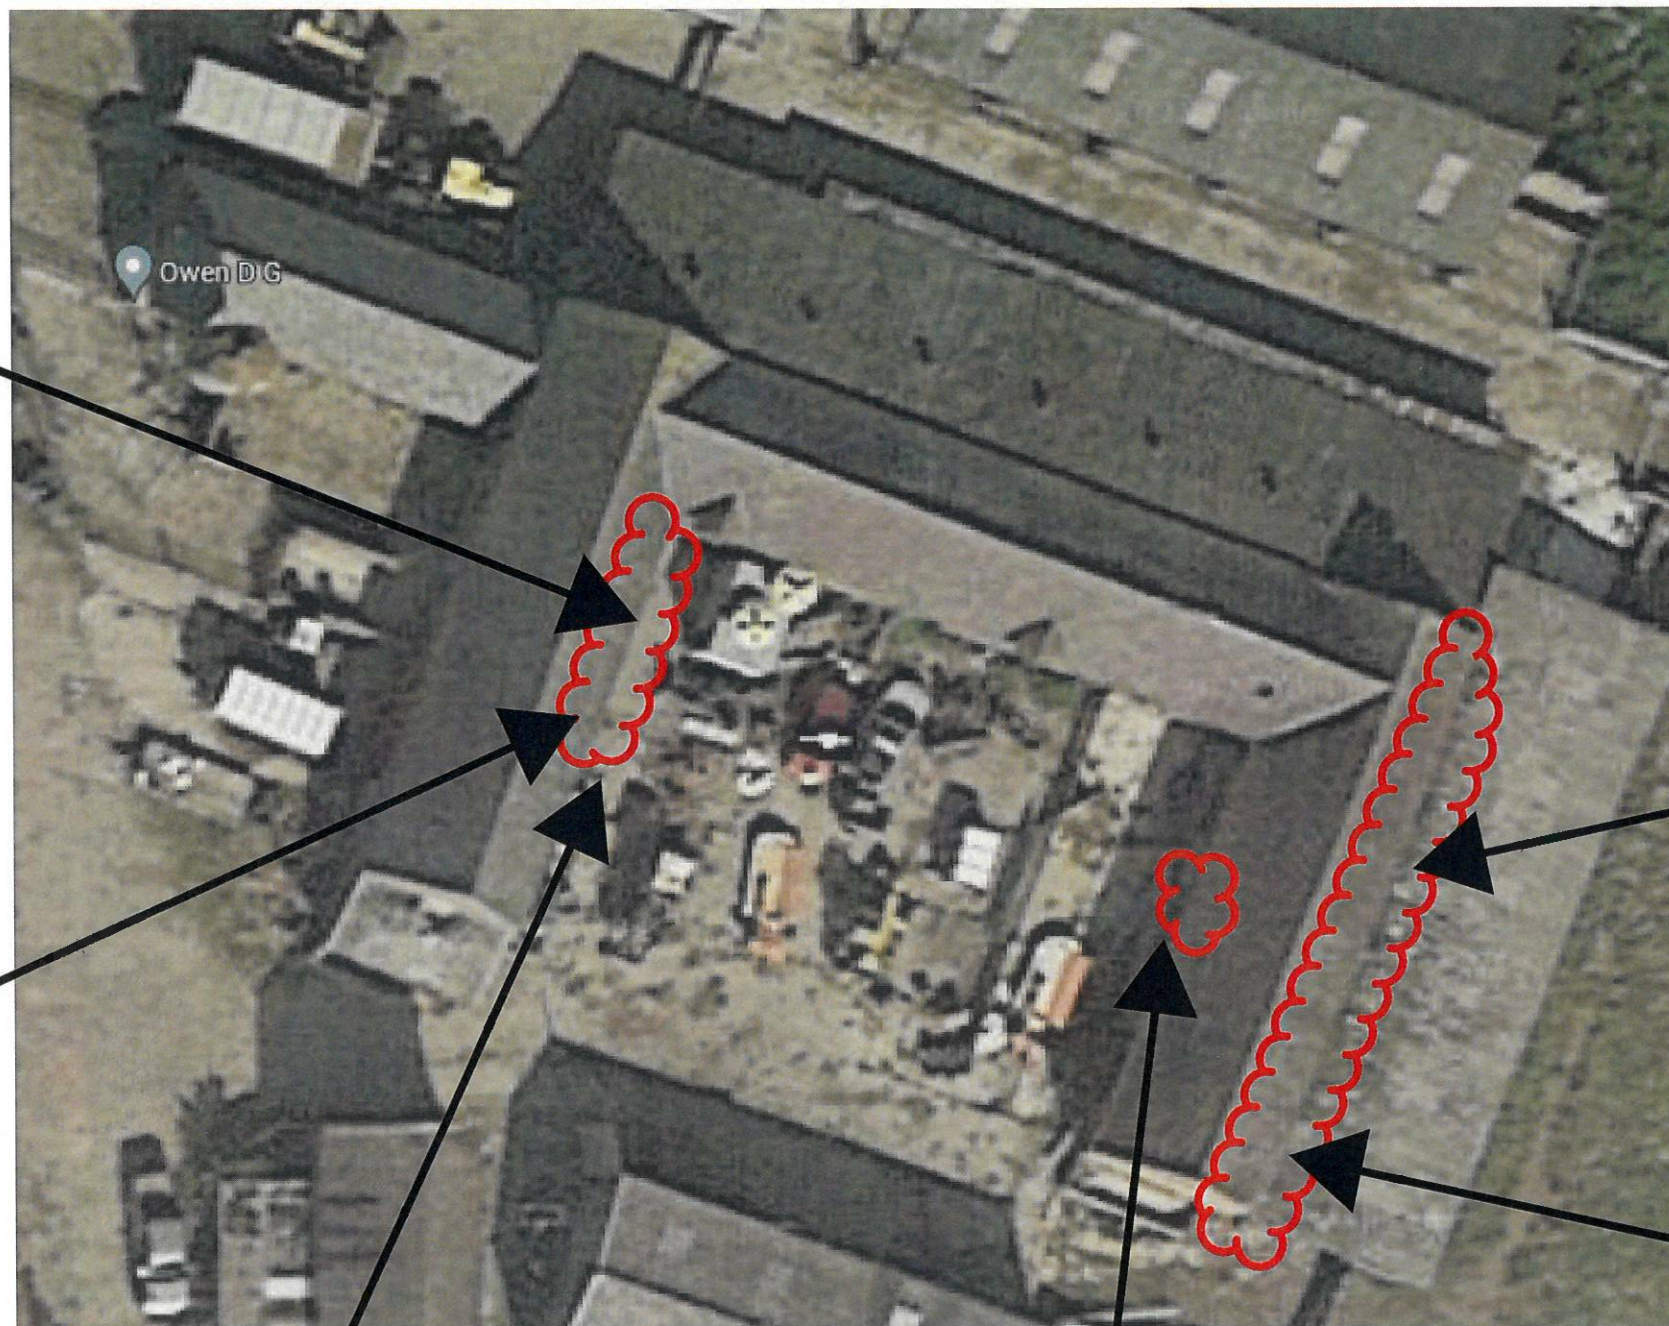
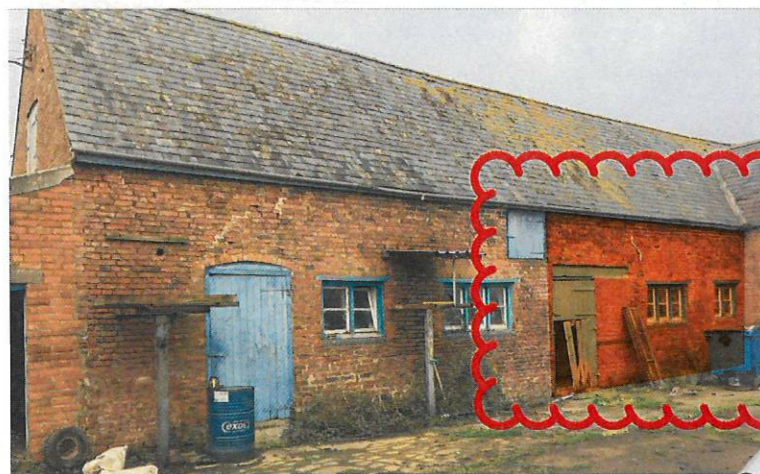


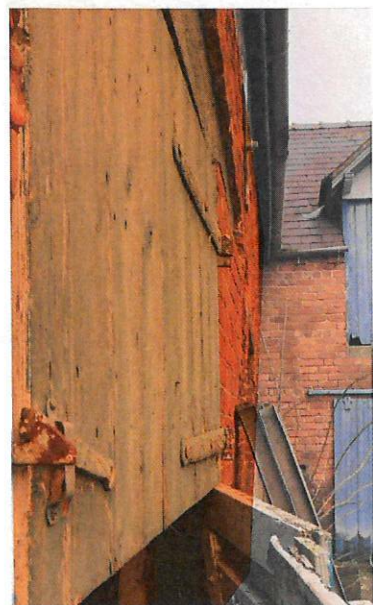

Approximate percentage of building area needing to be demolished and replaced = 0%

Approximate percentage of total external wall area needing to be demolished and replaced = 17%

THIS WALL IS LEANING SIGNIFICANTLY AND THE CONCERN IS THAT THE WALL WILL BE UNSTABLE DURING THE REPLACEMENT OF THE ROOF AND ALLOWANCE SHOULD BE MADE FOR ITS DEMOLITION AND REBUILDING

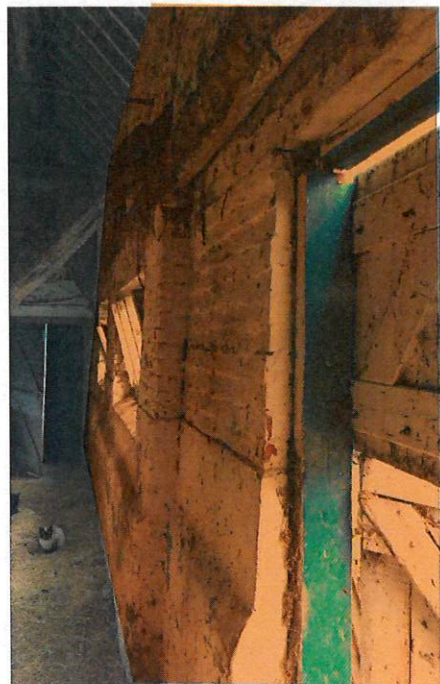

PIER HAS SEPERATED AND NEEDS TO BE REBUILT LOCALLY

THIS WALL IS LEANING SIGNIFICANTLY AND THE CONCERN IS THAT THE NEWER BARN STRUCTURE IS GIVING IT SUPPORT. WHEN THIS IS REMOVED, THE WALL MAY BE UNSTABLE SO ALLOW FOR DEMOLITION AND REBUILDING

TITLE

Building 2 Demolition Extents

PROJECT

Bryn Farm, Hanmer

DATRY'S



MODEL DYLUNIO PETRIANNEG
MODEL DESIGN ENGINEERING

Job No.	23012	DATE	16.03.23	SCALE	NTS
ACAD Ref.	-	CHECKED	-	PASSED	-
DRAWN	WL	DRG No.	23012 SK03	REV	

This drawing is Copyright ©