




5.2021

BS5837 2012 Tree Information Lady Margaret's Park, Chirk

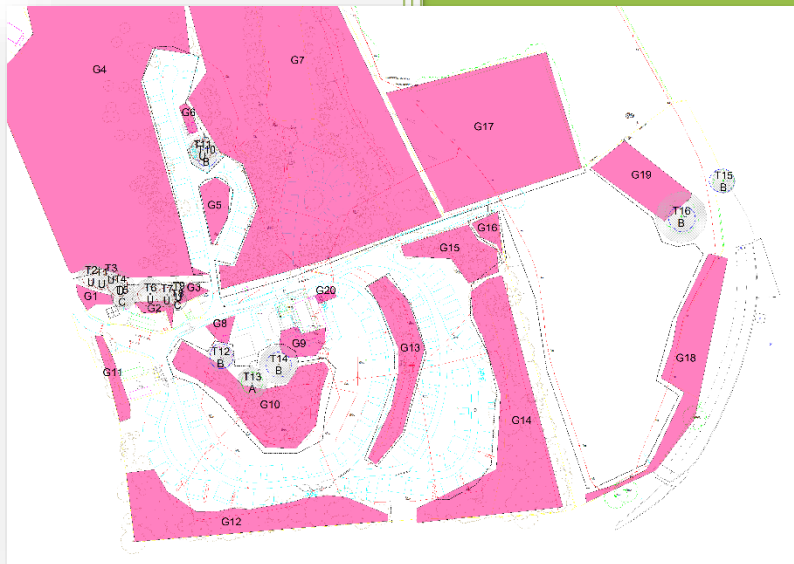

Client:

Caravan and Motorhome Club, East
Grinstead House, East Grinstead, West
Sussex, RH19 1UA

Contents

Page

3.	Instruction
4.	Site location & description
5.	Limitations
6.	Definitions
7.	Avoiding damage to trees during construction
9.	Root protection areas (RPA's) and fencing
10.	Soils
11.	Ground protection
12.	Cellular confinement systems
14.	Do's and don'ts
15.	Arboricultural Watching Brief
16.	Tree Data explanation
17.	Tree category flow chart
18.	Minimum Arboricultural Method Statement
19.	Arboricultural Implications Assessment
20.	Tree Work List (expected minimum before design conflict discussion)
21.	Tree Schedules from site survey shown as tree schedules as per BS5837 2012
	Rear page/s. Site plan key followed by site plan as screen shot

Instruction

Following an instruction from the client, I have been commissioned to provide a tree information document suitable to display tree data such as locations, rooting areas and crown spreads for the site. The information gained during a site survey is displayed within this document.

I hold the ABC Awards Technical Certification in Arboriculture (AA Tech Cert) and am familiar and experienced with the British Standard 5837 2012 and working with its recommendations on development sites. I have three years practical experience surrounding the planning process during my work as a local planning authority Tree Officer. I have over 20 year's arboricultural experience working with trees from root plate to foliage tip. I also provide expert witness statements and my notable clients include the BBC factual programmes where I advise on tree related matters. My aim is to bring my knowledge and experiences into the report which then aims to help the planning process.


By using the recommendations of BS 5837 2012, data is taken of tree features such as species, height, stem diameter measured at 1.5m above ground level (or at an even sized stem taper) for single stemmed trees or an average stem diameter for multi stemmed trees to allow a root protection area to be calculated. Further data is collected to assess the trees suitability for the location/landscape which uses physiological and structural assessments to give a final opinion of the trees overall condition and grading. Further considerations are given to the trees recorded such as rooting area and any required arboricultural management work prior to development.

Understanding a trees is required when providing information in relation to a BS5837 Report. Such people are called an arboriculturist. BS5837 2012 recommends the use of an arboriculturalist in order to understand the trees needs in relation to the site and the trees future environment. In this case the arboriculturalist is Treecare Consulting.

The arboriculturalist needs to be able work out the extent of root mass occupying the area and how placing the footprint of a building near it may change the dynamics of the trees surroundings. Once a building is placed next to trees it is also important to understand the long term effect of aerodynamic changes to retained trees and also how any rain shadow created by the new structure may adjust water availability to trees. Should the development be seen to have a detrimental or significant effect to the trees health, changes in design may be required to the intended design architecture to ensure minimal impact on a retained tree. In certain cases the tree or trees may need to be removed if low value.

By using the data gathered to compile the tree schedules and assessing the tree's needs, an opinion can then be made on how best to protect the trees from the development process. Root protection areas are calculated and these need to be adhered to when installing a protection fence at the extremity of the RPA. Under no circumstances should an RPA be lessened unless a specific method and reason is being used. All guidance contained within this report should be followed to ensure that the whole or part of the proposed development is not jeopardised.

Site Location/descriptions

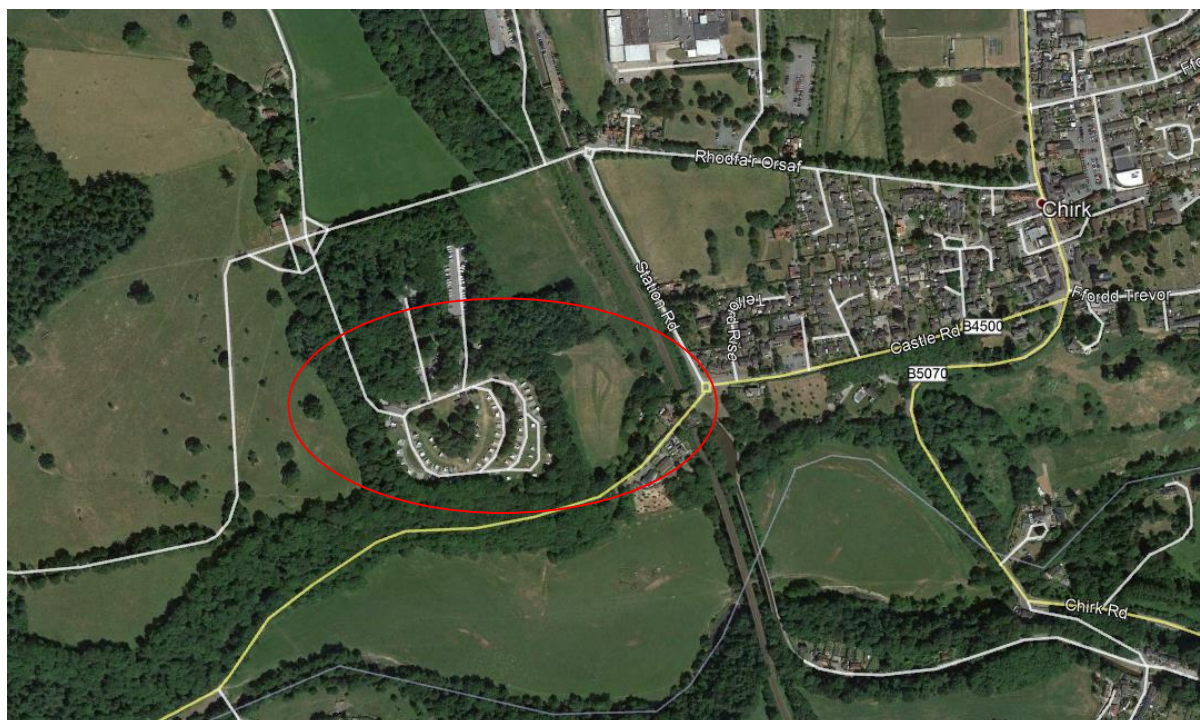

- I accessed the site from Rhodfa'r Orsaf.
- The site is owned by my client.
- There are trees on site and the adjacent land which could be affected by development activity.
- Some management recommendations have been made regarding trees due to age, form and long term management/landscape. Some trees are in decline due to pest and disease.
- The grounds are laid out as camping and caravan site.
- Further planting is to take place to replace lost trees due to disease or design/layout clashes.

Report Limitations

- Visual inspections from ground level unless otherwise indicated.
- No invasive inspection techniques used unless indicated.
- No underground excavations will have been performed unless otherwise indicated.
- No climbing or inspection at height will have been involved unless indicated.
- Report information expires after twelve calendar months from report issue date.
- Reports and information relating to them are the property of Treecare until paid for in full. Information within reports is retained at Treecare's discretion until paid for in full. Treecare will retract reports and comments from any due process if not paid for in full.
- Treecare will not create access to trees unless directed yet will undertake the accessing work if contracted to do so.
- Where access to a tree is not possible, best judgement/estimation will be used. Accurate information will therefore be minimal and will be checked at the earliest opportunity.
- Treecare only use suitably trained and knowledgeable persons for inspections holding the relevant qualifications for their purpose.
- Treecare has the right to remove employees from danger as they see fit.
- Verbal comments on buildings structural integrity are an opinion not fact (a structural engineer will be required for a detailed analysis).
- The diagrams and drawings provided by Treecare are not exact and should not be used for design purposes unless directed otherwise. They are however indicative of site features.
- Treecare will try their very best for the client. However, conflict of interest or professional judgement and character clashes must be accepted and resolved.
- Treecare's information and advice will only last as long as current legislation and current knowledge is up to date. Should new information supersede previous comments a new report must be issued.
- This is a preliminary report and further more detailed aspects may be required by the LPA or client at a later stage to define exact processes.

Definitions

BS 5837 2012 (Trees in relation to construction) was revised in 2012 and now supersedes the previous 1991 & 2005 editions.

Within the newer BS many definitions are given so the professional arboriculturists are able to give an indication to planners and architects so that a common understanding of trees and how building new structures may affect the health and support of trees can be given.

Arboriculturist

A person who through relevant training, qualifications and experience in the arboricultural world is able to form an opinion on how trees may be affected through development processes.

Competent person

A person, who has had training and experience relevant to the matter in hand and is able to recognize whether it is safe to proceed with a specific site process.

Structure

Man-made object, such as a building, carriageway, path, wall, services and built or excavated earthworks.

Root protection area (RPA)

A site layout design tool that enables a pictorial representation of trees required rooting area. This area must be protected to ensure the survival of trees.

Tree constraints plan (TCP)

A clear plan diagram showing tree locations, crown spreads and rooting areas. This allows the arboriculturist to demonstrate areas where trees will affect a proposal by tree volume, height or shade.

Construction exclusion zone (CEZ)

An area clearly marked both on site and on a site plan. This area must have no construction operations carried out within.

Tree protection plan (TPP)

A scale drawing that shows tree locations, rooting areas and fencing locations on site.

Arboricultural implications assessment (AIA)

An assessment made by the arborist to identify, evaluate and possibly mitigate effects of construction process on trees.

Arboricultural method statement (AMS)

A written or toolbox talk applied method of ensuring the contractor (construction) can implement the design adjacent to existing trees.

Services

Above or below ground pipe work, wire or ducting construction that could affect trees crowns or their roots or rooting areas.


Special engineering

Designing of a structure with the physiological requirements of trees as the primary concern.

Avoiding damage to trees during construction

The flow diagram below shows the process that should be followed to help prevent any risk of damaging trees during the design and construction process and due consideration to retained trees and roots is given. Where any confusion lies or something noted is not understood it is important that the query is resolved before proceeding.

The arboriculturist should be consulted and, as a minimum a verbal discussion must take place in order to clarify any detail that is misunderstood.

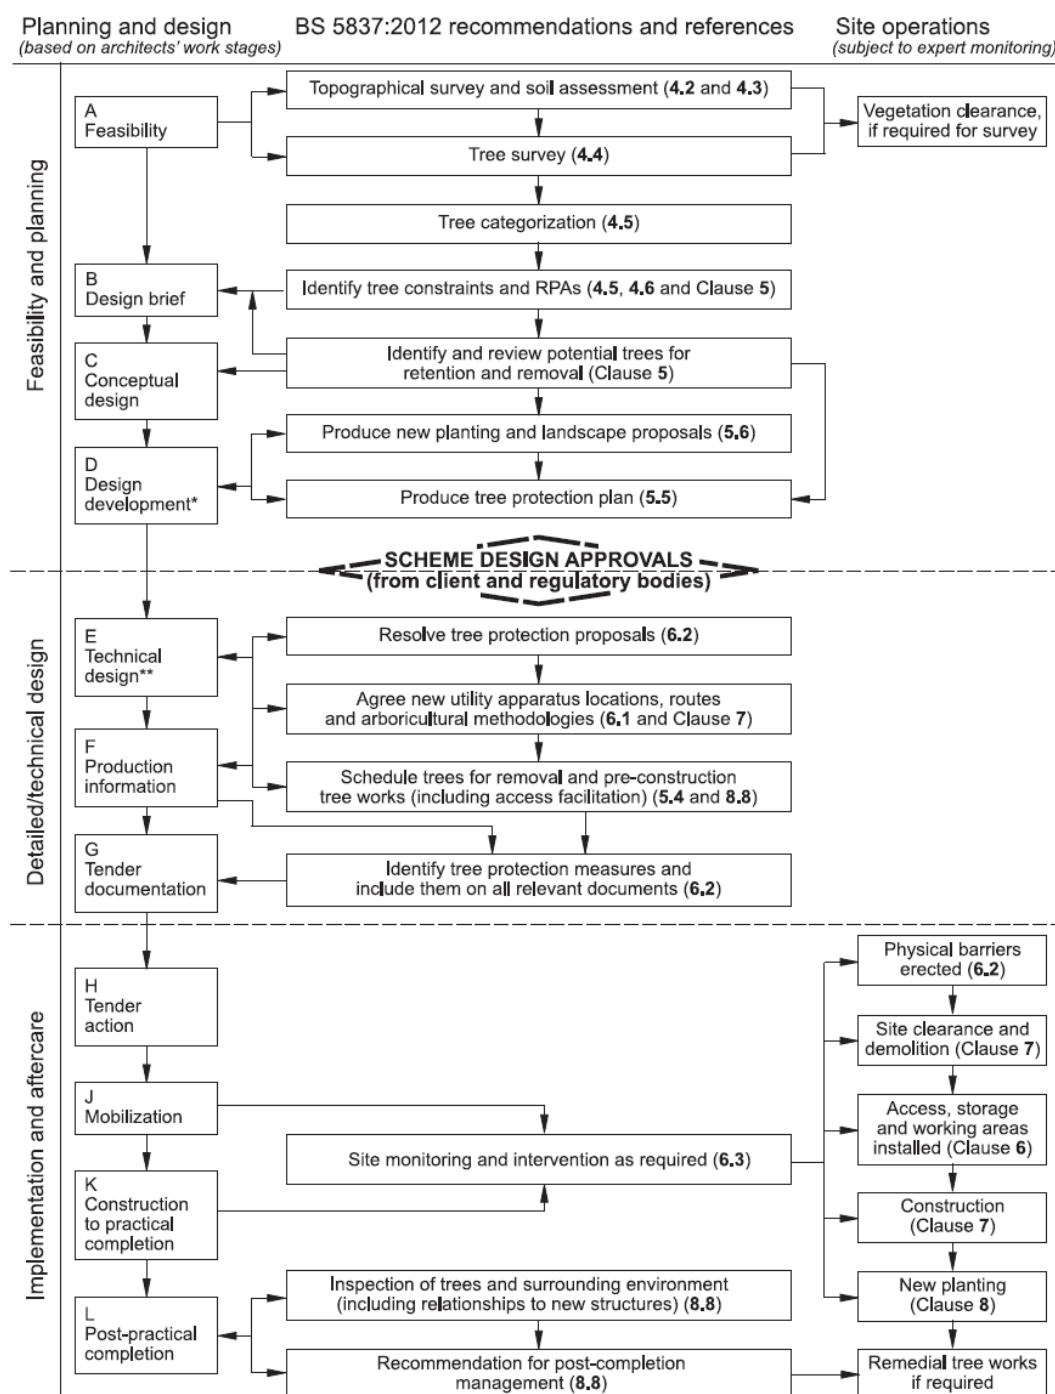

Trees on development sites are commonly destroyed by plant equipment operators feeling that their own experience of trees outweighs the knowledge and experience of the arboriculturist. In my opinion this would be a very rare occurrence.

Damage occurs by many differing ways. There is indirect and direct damage. The first takes time to have an effect on long term tree health unless toxic substances are involved, the latter can be instant but can lead to a drop in tree value or create a wound a tree finds difficult to defend.

Compaction of soils can cause many problems for trees and must be avoided at all costs. The compaction of a soil will remove the pore spaces between soil particles and thus remove oxygen from the soil that the tree would use for respiration. This then means that the tree will slowly but surely decline as it is suffocated.



This photo shows a combination of damage. The roots have been severed or damaged in such a way that stability has been lost and this tree was felled. If the same damage had not led to an immediate tree failure the tree would have been sent into an irreversible spiral of decline.

The loss of roots will have caused a lack of structural support, loss of moisture take up, loss of oxygen take up and a means of the tree storing energy as starch within root structures. This type of root damage causes a slow decline in tree foliage known as crown die back.

The picture to the right shows the years after the completion of a development site. Operators will often mention how they have driven over them. This is what happens once they leave.



die back of foliage several years after the completion of a development site. Machine operators have dug roots or driven over them.

Trees have to have roots in order to perform their most basic tasks. To the tree the root system is more important than the crown. However the crown is more important to us as it is the part we can see.

to perform their most basic tasks the root system is more important. However the crown is more important to us as it is the part we can see.

The only way to avoid needless destruction is to give them the space they require and provide adequate protection from the construction process.


If adequate protection is not given the disaster below is not far behind!




How to protect trees from preventable damage – Tree Protection Fences

The BS document provides various diagrams on how to protect tree rooting areas. The fence needs to be erected prior to construction traffic site occupation and often with the arboriculturist present to ensure correct placing. Types for hard and soft ground surfaces are shown below.

Soft ground

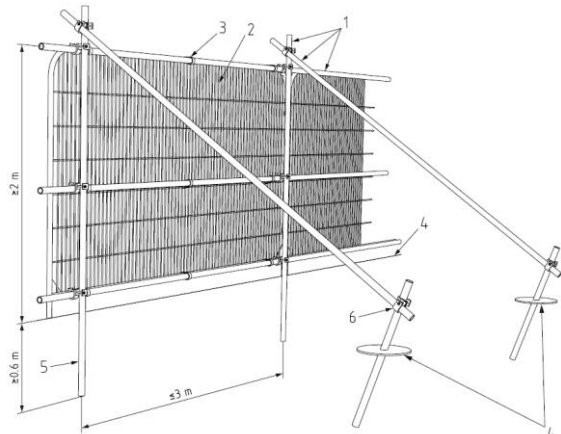

Hard ground

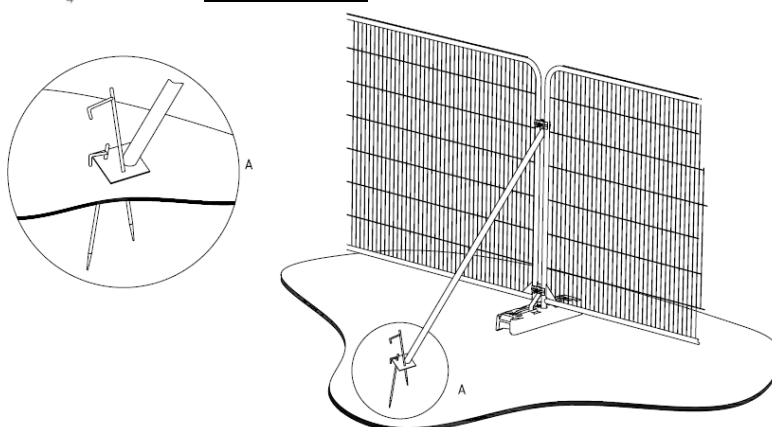

The rooting area is calculated by using a stem measurement. For single stems trees the diameter if the stem is measured at 1.5m above ground level or point of even stem taper. This figure, in millimeters is then multiplied by twelve and this will then give the radial measurement from the stem to the edge of the rooting area. A circular area is created around the tree at the radial measurement. This is where the fencing should be located. Multi stemmed trees now require average stem size calculations based on 2-5 stems or 5+ stems. Contact the arboriculturist if in any doubt.

The design of RPA or CEZ fencing should be so that it cannot be moved during works. It must also be robust enough to withstand minor knocks and scrapes from plant equipment. The fence must be in place prior to site occupation by plant equipment and should be removed once the site has been vacated by construction traffic. Should there be a requirement to place pedestrian walkways across and RPA a suitable method of ground protection should be used. A geo textile layer, compressible material and then boards should suffice as a walkway. This specification will need to be agreed by the arboriculturist prior to installation. It should also be laid in front of the direction of travel during installation. All hedges and trees over 150mm diameter at 1.5m need root protection. If no RPA measurement is provided for a tree or hedge requiring root protection ensure the fence is set 2m from the outer edge of the tree/hedge drip line.

Fences will require clear signage as to purpose – Tree Protection Fencing.

Soils

Chapter 6 of BS 3998 2010 (British Standard for Treework) explains that adverse and sudden changes to soil structure, nutrient, oxygen and hydrology can have catastrophic outcomes for trees. Steps must be taken to protect the soils within a rooting area where retained tree roots are present. It is crucial to tree survival that soils are not altered.

A basic tactile assessment of soils by hand has been made of the site soil structures. Common soils are found to be present on site but soil condition can always be improved upon. Soil improving ameliorants can be found in Annex B, Table B2 of BS 3998 2010 where recommendations are made to improve soils on site.

BS3998 2010 advises the use of soil mulches such as woodchip and leaf mould for improving soils around trees. It is advisable that where suitable, woody material being removed from site is turned into a woodchip mulch and applied to rooting areas. This mulch improves worm activity thus increasing oxygen levels plus it adds vital nutrients to the soil environment. Mulches also help retain soil moisture levels and as such help promote growth and development in retained trees.

Stripping/delivering soil

Stripped or delivered soil to site must be stored as follows:

- Loose tipped.
- Away from contaminants.
- Clearly marked to future use.
- Foreign bodies removed.

New soils to site

- Planting pits will be new construction of the appropriate soil volume as requested by the LPA.
- Soils must be handled according to good practice as laid out in BS3882:2007 and the DEFRA code (2009).
- Imported soils will be used for the planting pit. (The ideal planting soil contains approximately 45% mineral solids, 5% organic mineral solids and 25% each water and air, as shown in Figure B.1.BS8545).
- Planting pits to only contain imported top quality planting soil/top soil mix at upper 400mm depth only, in accordance with the specifications laid out in BS3882:2007.
- Soils below 400mm must be suitable sub soil as specified by BS3882:2007 and BS8545.
- All soils used in the planting pit soil must have a certificate of compliance from the soil supplier that also states the volumes supplied.

Ground Protection (if required)

Existing soil structure and texture must not be destroyed or altered in the vicinity of trees. Future planting sites should also have their structure preserved by the use of ground protecting plates. This will allow mechanical plant to move around the site and transit areas of high root occupancy or planting sites of high value.



The use of ground protecting boards such as these seen in the adjacent picture should be used. Geo textile and felt may be required beneath these routes to minimize puddling of the soil surface. Should puddling occur a capped layer may well be formed which will reduce the lateral diffusion of soil gasses and cause significant problems for retained trees.

Any ground protection must be capable of withstanding the load placed upon it. An engineer must be consulted for advice on the specification of such protection.

Another method of ground protection can be utilized by using the installation of raised platforms mounted onto scaffold legs.

Platforms such as these could be used for light storage, walkways or as an area for construction workers to stand whilst carrying out operations such as block laying and pointing. Water proof sheeting on top of the boarding should be used to catch any material that could leach into soils where tree roots are present or run off could reach.

Particular attention should always be made when using ground protection to surface run off. Fuel oils, cement and water with high fines content are all very damaging to trees. Provision must be made to ensure that run off does not leach into soils.

Temporary track ways can also be constructed by using geo textile onto top of the ground and type 1 road stone with no fines be used as the surface. This method must only be used at the outer limits of an RPA.

Methods and specifications of paths using cellular confinement systems



When considering possible damage to tree roots during the applications of vehicular access and parking, the risk to trees is from oxygen depletion caused by compaction of subsoil's and site clearance work damaging the soil structure and roots below ground.

This damage may well lead to tree failure and can be traced back to the contractor responsible for liability claims.

Risk factors include

Creating an impermeable surface
Causing a rise in the water table due to construction
Increasing ground level
Contamination of subsoil's

Compaction

When looking at site conditions and use, the following information should be considered to enable a load bearing structure capable of supporting traffic to be proposed:

Californian Bearing ratio (CBR)

– Standard test method for measuring soil strength

Soil types

Water table

Maximum load (vehicles)

Acceptable rut depth

Reinforcement type

Type and Depth of engineered infill material

Cellular Confinement

Clean, angular. Usually 40mm to 20mm.

Digging surfaces (site strip)

Site stripping does damage root structures present prior to construction; however, the use of no-dig construction elevates the access road requiring edge protection.

No dig

1. Remove surface vegetation
2. Place geo textile separation filtration layer
3. Cellular Confinement System

Use a suitable herbicide suitable for the specific vegetation and not harmful to the tree root system.

Use a Fibretex F4M non-woven Geo textile over the prepared sub-grade. Overlap dry joints by 300mm.

The three dimensional cell structure, is formed by ultrasonically welding polyethylene (perforated) strips / panels together to create a three dimensional network of interconnecting cells. A high degree of frictional interaction is developed between infill and the cell wall, increasing the stiffness of the system.

4. Edge restraint

A treated timber edging is usually acceptable.

Cellular Confinement and Backfill Material.



Expand the confinement systems 2.56m wide panels to the full 8.1 meter length. Pin the panels with staking pins to anchor open the cells and staple adjacent panels together to create a continuous mattress. Infill the cells with a no fines angular granular fill (typically 40-20mm) within each open cell. The use of cellular confinement reduces the bearing pressure on the subsoil by stabilizing aggregate surfaces against rutting under wheel loads. Comparisons between cellular confinement and traditional aggregate and geo grid-reinforced structures

demonstrate a 50% reduction in construction thickness of the granular material.

Surfacing Options

Block Paving:

1. Lay second layer of Fibretex F4M Geo textile separation fabric over the filled confinement sections.
2. Lay sharp sand bedding layer compacted with a compaction plate to recommended depth to consolidate but not compact.
3. Lay block pavers as per manufacturer's instructions.

Tarmac:

Place 25mm layer of the granular material above the confinement system and lay the bitumen base and wearing courses.

Loose Gravel:



4. Place second layer of Fibretex F4M Geo textile separation fabric over the filled confinement sections.
5. Place decorative aggregate to required depth.

NOTE: A treated timber edge should be provided to restrict gravel movement.

Grass Blocks:

6. Place second layer of Fibretex F4M Geo textile separation fabric over the filled confinement sections.
 7. Place 50/50 root zone bedding layer to the required depth.
 8. Lay recycled Duo Block 500 Grass Protection System filled with 50/50 root zone mix.
 9. Seed as per architects instructions.
- (Alternatively the Grass Blocks may be filled with gravel.)

Below are illustrations of the correct stapling procedure for joining both edges and ends of panels together;

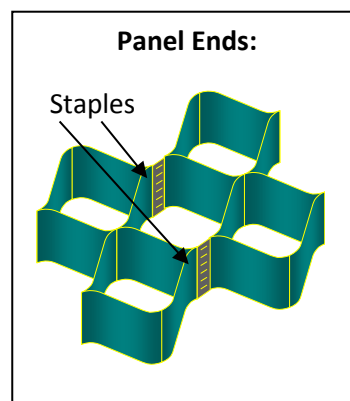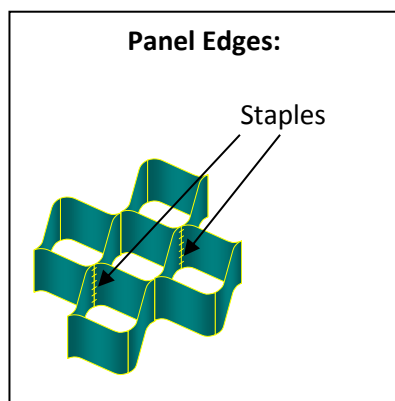

Site do and Don'ts

- Do not occupy ground space within the crown spread of a tree.
 - Do not work without suitable protection fencing around retained trees.
 - Do not travel the site without suitable ground protection where roots exist.
 - Do not break the ground near trees unless being supervised by a competent person in tree care and management.
 - Do not allow builders sand to be placed near rooting areas as this is toxic to trees.
 - Do not store fuels, cement or other toxic materials near trees.
 - Do not light fires within 15m of a tree crown.
 - Do not trench through roots above 10mm in diameter unless under direct supervision by an arboriculturist.
 - Do not lean objects against tree stems or branches.
 - Do not tie ropes or cables to trees unless during a temporary and authorized task.
 - Do not allow plant equipment to make contact with any part of trees.
 - Do not allow exhaust pipes to be directed at trees and shrubs.
 - Do not place service or drain runs through an RPA.
-
- ✓ Do discuss site operations with an arboriculturist.
 - ✓ Do use toolbox talks to inform staff on site of the tree's needs.
 - ✓ Do liaise with the planning officer regularly to ensure full compliance at all times.
 - ✓ Do erect barriers such as RPA and CEZ fencing early.

RPA dos & don'ts




Don't use site vehicles within the root system, this will compact the soil and can lead to root suffocation.



Don't store poisons, chemicals, fuel, diesel, oil or cement beneath a tree. Don't light fires.



Don't store or deposit building materials against or beneath a tree.

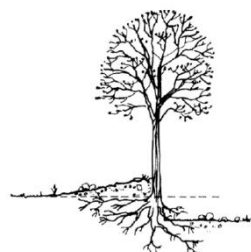

Excavations will damage roots, whilst increasing levels will exclude air vital for healthy roots.

Arboricultural Watching Brief (AWB)

When adequate tree protection and suitable distances to trees and rooting areas can be put in place on site, there is often no need for an Arboricultural Watching Brief (AWB). However, when the design dictates that work may be required in an area of sensitivity in regard to trees and rooting areas, an AWB may be required. You may also find that a planning authority places a planning condition on using an AWB on certain aspects of work.

It is strongly advised that you utilise the knowledge of your site arboriculturist/AWB. This advice should start to take place prior to any design ideas being formed. This can save many issues in regards to design and planning issues.

Common items where an AWB may be required:

- Installation of Tree Protection Fences.
- Movement of Tree Protection Fences.
- Work within or close to a tree RPA.
- Installation of piles within an RPA.
- Installation of temporary ground protection in or near tree rooting areas.
- Certain pruning needs for trees – specific and sensitive pruning.
- Excavation adjacent to rooting areas.
- Supervised hand or air spade work within a root protection area.
- Installation of ducting within a rooting area.
- Grading/blending of a bank batter to/from rooting area extremities.
- Overseeing soil nibbling to record the true extent of a rooting area radius.
- New planting locations. Locations and species selection.
- Crane operations past tree canopies.
- Removal of tree protection fences upon discharge of tree protection conditions for the site.
- Final landscaping and soil coverings from new back into existing soils/rooting areas.

The AWB is not there to hinder work but to advise on the best way forward. This advice is based on known issues, experience and requirements of planning legislation.

Please feel free to ask JPTC any questions that you feel may require the use of and AWB. Most issues are easily resolved well before any damage to retained trees occurs if the advice is sought at an appropriate stage.

Tree Data

It is often essential to gain the tree information for the site first and then design the site around what the tree cover (following arboricultural management work) allows.

A sites use can be maximised if the plans are drawn after the vegetation survey is complete. This is to allow the architect to see exactly what area is available for development. A design which is correct and that fits the landscape, without causing significant disruption would then be achievable. This is particularly important if protected trees or trees of very high value are present.

Within the data captured on site, any immediate management work is also noted within the schedule of findings. This work is to help trees with minor problems and to increase site safety to construction workers and the new occupiers of the site following development.

The table on the following page is the cascade chart as per BS5837 2012 for capturing consistent tree data whilst carrying out development based tree surveys. It allows for trees to be clearly seen by the planning process with a standardised, alpha numerical grading system. The alphabetical system also allows a colour coded approach to see the trees marked on a site plan according to its category (A, B, C & U). It is important to show tree canopy spreads in these standard colours, Green, mid-Blue, Grey and Red. Groups are shown as a Pink line by JPTC.

Each tree is assessed to identify its species, capture its physical dimensions, assess its physiological health and assess its structural condition. Further assessment is made to how the tree is suited to the location where the proposed design is already known.

Trees which are in decline but have useful life left such as veteran trees are also included. This allows for them to be kept on sites where possible because of the high ecological, historic and cultural benefits they may bring to the locality. It is important to remember that these trees may be in excess of one hundred years old and their loss to the area could be dramatic for hydrology, ecology and landscape features not immediately obvious stood on site.

The construction company's name is on the site and how the site is left is how the site will be remembered. Trees may appear to be a nuisance to development processes but they should not be overlooked as they can add value to a site and reduce the future landscaping needs and associated costs.

Key to tree data classifications overleaf:

A separate large scale version of this can be made available should it be required.

Table 1 Cascade chart for tree quality assessment

Category and definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention (see Note)				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline - Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality <i>NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7.</i>			See Table 2
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	See Table 2
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	See Table 2
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	See Table 2

Minimum Arboricultural Method Statement

The list below must be in place before any development activity occurs on site, if in doubt ask, do not assume or carry on regardless.

1. **Before any construction plant equipment, vehicles and associated activities start** on site, carry out preliminary tree pruning/management works as listed within the tree schedules within this document subject to permissions from LPA – check for type, size and access for tree equipment to be used – get written approval from LPA for use. Permission will be required in writing from an LPA for trees subject to tree preservation orders and conservation areas - 211 notifications made if applicable if the area is a conservation area. Trees subject to a TPO also include the root system of the tree and soils in the vicinity of the tree.
2. No mechanical plant equipment is to access retained tree RPAs areas (marked as grey hatching) as noted on the site plan at the rear of this document at any stage – ground protection must be used and advice from an arboricultural watching brief advised if roots are under access routes. The same equipment/personnel must not use the construction exclusion zones. Storage of materials is also not allowed in the CEZ or tree RPAs or in a location where run off can enter tree soils.
3. Layout suitable rooting area and tree structure protection fences in accordance with BS5837 2012 or as type agreed by the LPA around retained trees rooting areas, as defined in this document on the site plan. This temporary fence must remain until the LPA discharge the condition for the use of Tree Protection Fencing.
4. Mark RPA fences clearly to their intended use –

“Construction Exclusion Zone (CEZ) KEEP OUT”

These fences, once installed, must not be altered or moved without written permission.

5. No development work should take place within a theoretical rooting area of trees as defined by BS5837 2012 on site. Ample working room should be made available on site.
6. No roots should be cut in excess of 10mm – seek immediate arboricultural advice if roots are found outside an RPA.
7. Protect all trees large and small and future planting locations from development processes until the LPA discharge the tree protection condition.
8. Always use or seek the advice of the arboricultural watching brief if working adjacent to RPAs, lifting hard surfaces with possible roots below, working within 10m of a tree, woodland or tree group.
9. Ensure hedge have at least half their height available as a distance for an RPA.

Arboricultural Implications Assessment – AIA (surveyors overall thoughts)

This AIA has been written by the tree surveyor for the site and is based upon tree condition, relationship to the site and potential future use or simply to explain obvious arboricultural constraints, tree threats or management issues – discussion that is useful for the Tree Officer looking at the application and also the architect/site manager.

Hymenoscyphus fraxineus is ravaging the UK at present and Lady Margaret's Park has not escaped infection. I have recorded a high volume of trees suffering infection/decline that will need to be felled due to safety concerns – trees in stage 2+ should be felled sooner rather than later to avoid further safety implications to tree work professionals – in most cases the dying trees are a direct threat to CAMC customers/guests.

In all other areas I was able to see how improvement work can take place on site. Further detail is required in the region of G6 as rooting areas of retained trees are at risk from any work involving breaking the ground. Detailed drawings should be provided for comment.

The proposed toilet block revision clashes with G9 and G2. Trees will require removal to facilitate this new buildings construction. Sufficient space on site does however allow for good re planting opportunity. Working room/landscaping may be tight on the rooting area of T14, this needs to be well thought through and all must not enter the rooting areas of retained trees across the site.

G11 and G12 are dominant ash groups. A high volume of tree loss is expected in these areas but suitable re planting is possible.

G15 is earmarked for removal due to tree decline. Replanting will be required with native broad leaf species.

By far the biggest threat to retained trees on this site is construction activity and the control of work operations, material storage and potential lay out concerns.

Trenching must not go through any tree group or lone tree rooting areas – trenches for all services must go around trees to avoid damage and therefore tree decline/loss of stability. It is very important that all potential service drawings are assessed prior to any ground work taking place.

Storage of materials and also storage of soils from soil stripping will also need to be agreed up front in clearly identified areas where retained trees and their rooting areas will not be affected. Regular communication with the site arboriculturist (JPTC) is required to avoid needless damage to trees. JPTC can also provide any AWB cover and also advise contractors on site/update LPA as required during the work.

Tree Work List

Felling list

Numerous trees due to *Hymenoschyphus fraxineus*. Trees 1, 2, 3, 4, 6, 7, 9, 11. Groups (or part of) 1, 4, 5, 7, 8, 9, 11, 12, 15 and G20.

Pruning works

Trees 5, 8, 12, 13, 14. Groups 2, 10, 13, 16, 17.

Coppicing works

NA.

Transplanting works

NA.

Planting list

To be confirmed.

Data Sheets - site survey carried out week commencing 10th May 21

The following data tables contain specific tree dimensions that are used to calculate the relevant protection from development. This protection is to ensure the long term survival of retained trees. Should any questions arise please contact Treecare Consulting.

Individual trees & Groups

Tree Number	Species	Height	Tag Number	Spread N	Spread E	Spread S	Spread W	Low Limb Height	Low Limb Direction	Stems	Diameter @ 1.5m in MM	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
T1	Ash	22	7811	4	4	6	6	6	SW	1	570	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T2	Ash	22	7812	4	2	6	5	5	All round	1	580	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T3	Ash	22	7813	4	4	4	4	10	All round	1	480	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T4	Ash	22	7814	5	4	6	7	7	All round	1	640	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T5	Beech	23	4573	6	6	6	6	4	All round	1	630	Normal for species	Normal for species	Historical bank cut and root damage, proximity to occupied buildings, altered exposure due to ash clearance	Reduce crown by up to 3m ASLB or consider tree removal due to root severance and altered exposure. Re plant replacement beech tree	Mature	20+	C Low Quality	2 Landscape value	Potential hazard tree due to altered exposure. Tree close to existing buildings

Tree Number	Species	Height	Tag Number	Spread N	Spread E	Spread S	Spread W	Low Limb Height	Low Limb Direction	Stems	Diameter @ 1.5m in MM	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
T6	Ash	24	7815	4	4	7	7	3	All round	1	720	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T7	Ash	23	8725	4	5	7	6	6	All round	1	600	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3. Significant 150mm limb tear out and hung up over path	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T8	Sycamore	14	7816	3	5	6	5	3	All round	1	450	Normal for species	Normal for species	One sided phototropic form.	Re balance/re shape crown by up to 1.5m crown reduction to South using NTP ASLB	Mature	20+	C Low Quality	2 Landscape value	Rooting area constraints
T9	Ash	19	7817	1	3	6	3	6	All round	1	440	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T10	Larch	26	7818	4	6	6	5	9	All round	1	650	Normal for species	Normal for species	No significant defects	None	Mature	20+	B Moderate Quality	2 Landscape value	Rooting area constraints
T11	Ash	23	6402	6	5	6	7	5	All round	1	650	Hazardous defect/tree	Poor	Hymenoschyphus fraxineus infection stage 3	Fell and replace with beech	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Tree removal required on safety grounds
T12	Beech	19	7819	8	7	6	6	4	All round	1	630	Normal for species	Normal for species	Characteristic non-tensile forks. Dead wood. Wind firm tree.	Remove dead wood. Alter layout not to clash with rooting area plus 3m	Mature	40+	B Moderate Quality	2 Landscape value	Rooting area constraints
T13	Douglas fir	23	None	6	6	6	6	4	All round	1	700	Normal for species	Normal for species	Dead wood	Crown clean tree	Mature	40+	A High Quality	2 Landscape value	Rooting area constraints

Tree Number	Species	Height	Tag Number	Spread N	Spread E	Spread S	Spread W	Low Limb Height	Low Limb Direction	Stems	Diameter @ 1.5m in MM	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
T14	Beech	22	7820	7	7	7	7	3	All round	1	880	Normal for species	Normal for species	Dead wood	Crown clean tree	Mature	20+	B Moderate Quality	2 Landscape value	Rooting area constraints
T15	Oak	19	None	7	6	6	8	4	All round	1	530	Normal for species	Normal for species	No significant defects	None	Mature	40+	B Moderate Quality	2 Landscape value	Tree not affecting site
T16	Oak	17	224	6	8	8	7	2	All round	1	1165	Damaged	Normal for species	Veteran tree, decay in stem, limbs and historical pruning points. Laetiporus sulphureus decay present	Retain tree as historical landscape feature/habitat. Fence off from public access at RPA edge	Veteran	40+	B Moderate Quality	³ Cultural/Conservation	Rooting area constraints. Crown hazardous but retention required

Group Number	Species	Low Limb Height	Low Limb Direction	Average group height	Expected RPA (stem to fence M)	Prelim RPA fence locations	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
G1	Mixed	Ground level	All round	4	1	Follow feature edge	Normal for species	Normal for species	Young self set regeneration growth, brambles and scrub	Clear as required	Young	less than 10	C Low Quality	³ Cultural/Conservation	No constraints to development
G2	Mixed	Ground level	All round	8	4	Follow feature edge	Normal for species	Normal for species	Young self set regeneration growth, brambles and scrub	Clear as required	Mature	10+	C Low Quality	³ Cultural/Conservation	No constraints to development

Group Number	Species	Low Limb Height	Low Limb Direction	Average group height	Expected RPA (stem to fence M)	Prelim RPA fence locations	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
G3	Larch	4	S	18	6	6	Normal for species	Characteristic defects present	Dead wood, altered exposure	Remove dead wood. Review wind exposure value following ash tree fells	Mature	20+	B Moderate Quality	2 Landscape value	Observe 6m RPA to trees
G4	Woodland	5	All round	22	8	8	Characteristic defect	Characteristic defects present	Hymenoscyphus fraxineus infected trees in failure distance of paths, pitches and roads.	Fell infected ash within 1.5 tree lengths of paths, pitches and roads. Re plant lost trees with beech and oak.	Mature	40+	B Moderate Quality	2 Landscape value	Hazard ash present - do not ignore. Construction CEZ.
G5	Mixed	5	All round	18	7	Follow feature edge	Characteristic defect	Characteristic defects present	Hymenoscyphus fraxineus infected trees in failure distance of paths, pitches and roads.	Fell infected ash within 1.5 tree lengths of paths, pitches and roads. Re plant lost trees with beech and oak.	Mature	20+	B Moderate Quality	2 Landscape value	Hazard ash present - do not ignore. Construction CEZ.
G6	Larch	9	All round	20	7	7	Normal for species	Normal for species	Proximity to existing waste point. Rooting areas. Historical root injuries.	Detailed layout required in relation to retained tree RPAs. AWB required for service alterations in location.	Mature	20+	B Moderate Quality	2 Landscape value	Rooting area constraints

Group Number	Species	Low Limb Height	Low Limb Direction	Average group height	Expected RPA (stem to fence M)	Prelim RPA fence locations	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
G7	Woodland	6	All round	20	7	7	Characteristic defect	Characteristic defects present	Hymenoscyphus fraxineus infected trees in failure distance of paths, pitches and roads.	Fell infected ash within 1.5 tree lengths of paths, pitches and roads. Re plant lost trees with beech and oak.	Mature	20+	B Moderate Quality	2 Landscape value	Hazard ash present - do not ignore. Construction CEZ.
G8	Rowan	1	All round	5	3	3	Hazardous defect	Normal for species	Southern Tree 50% dead with open fracture in stem. Design clash with remaining trees	Fell group but allow for four replacement rowan trees around proposed alterations	Mature	10+	C Low Quality	1 Arb Values	Safety issue with Southern Tree, rooting area clash with remainder
G9	Birch/rowan/beechn	4	All round	12	6	6	Characteristic defect	Normal for species	Historical wounding to roots. Non-tensile unions. Stubbed branches. Design clash with proposal	Fell group and replace with 6 gold Dawyck beech around completed work	Mature	20+	B Moderate Quality	2 Landscape value	Design clash
G10	Woodland	4	All round	18	7	7	Normal for species	Normal for species	Dead wood, damaged branches	Remove dead wood over paths and around periphery	Mature	40+	B Moderate Quality	2 Landscape value	Construction CEZ.
G11	Mixed	3	All round	10	6	5	Hazardous defect	Characteristic defects present	Hymenoscyphus fraxineus infected trees in failure distance of paths, pitches, buildings and roads.	Fell infected ash within 1.5 tree lengths of paths, pitches and roads. Re plant lost trees with 3x hornbeam and 3x field maple on boundary	Mature	Dangerous 0	C Low Quality	2 Landscape value	Hazard ash present - do not ignore. Construction CEZ.

Group Number	Species	Low Limb Height	Low Limb Direction	Average group height	Expected RPA (stem to fence M)	Prelim RPA fence locations	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
G12	Ash woodland	4	All round	18	6	7	Characteristic defect	Poor	Hymenoscyphus fraxineus infected trees in failure distance of paths, pitches and roads.	Fell infected ash within 1.5 tree lengths of paths, pitches and roads. Re plant lost trees with beech, field maple and oak.	Mature	Dangerous 0	U Un-gradable in 5837	U Un-gradable in 5837	Hazard ash present - do not ignore.
G13	Mixed	2	All round	12	6	7	Normal for species	Normal for species	Dead wood, damaged branches	Remove dead wood over paths and around periphery	Mature	20+	B Moderate Quality	2 Landscape value	Construction CEZ.
G14	Acer mix woodland	2	All round	12	6	7	Normal for species	Normal for species	No significant defects in relation to proposals	None. Use foot of bank in lower proposal field as tree buffer zone - no access to bank	Mature	20+	B Moderate Quality	2 Landscape value	Construction CEZ. Use foot of bank in lower proposal field as tree buffer zone - no access to bank
G15	Ash/conifer mix	1	All round	15	6	7	Characteristic defect	Characteristic defects present	Hymenoscyphus fraxineus infected trees in failure distance of paths, pitches and roads. Outgrown cypress, cypress aphid decline, storm damage	Fell group. Replace numbers with beech, field maple and hazel mix.	Mature	10+	C Low Quality	2 Landscape value	Hazard ash present - do not ignore.
G16	Beech/Douglas fir	Ground level	All round	12	7	Follow feature edge	Normal for species	Normal for species	Low foliage over road	Raise foliage over road to 6m	Mature	40+	B Moderate Quality	2 Landscape value	Construction CEZ.
G17	Woodland	Ground level	All round	12	5	5	Characteristic defect	Characteristic defects present	Low foliage over access. Damaged trees in woodland.	Raise foliage over access to 6m full length of access boundary. Make safe damaged woodland trees by cutting flat to floor	Mature	40+	B Moderate Quality	2 Landscape value	Construction CEZ. 5m buffer to access road required

Lady Margaret's Park – BS5837 – Tree Data

Group Number	Species	Low Limb Height	Low Limb Direction	Average group height	Expected RPA (stem to fence M)	Prelim RPA fence locations	Structural Condition	Physiological Condition	Noted defects	Management Recommendations	Age Class	Years Remaining	Tree Quality	Tree Value	AMS Comment
G18	Mixed	1	All round	18	6	7	Characteristic defect	Characteristic defects present	Private tree boundary in places. Dead private elm overhangs site.	Contact elm owner re making safe. Use 6m buffer to trees.	Mature	20+	B Moderate Quality	2 Landscape value	Construction CEZ. Use 6m buffer to trees.
G19	Mixed	1	All round	8	4	4	Normal for species	Normal for species	No significant defects in relation to proposals	None	Young	20+	C Low Quality	2 Landscape value	Construction CEZ.
G20	Birch	2	All round	6	3	4	Normal for species	Normal for species	Design conflicts	Fell both trees, allow for four replacement birch	Semi mature	20+	B Moderate Quality	3 Cultural/Conservation	Design clash

Site Plans – Key

Scale plans can be sent as PDF files if required. The plans are to indicate locations of trees, locations of main objects on site and the location of tree protection fencing. Stem diameters found in tree and tree group data tables should be used to mark out the location of root protection fencing on site.

Dark Red U = trees requiring removal due to condition/grade.

Grey = C Class trees (low value).

Blue = B Class trees (moderate value).

Green = A Class trees (high value).

Grey hatched area = Root protection areas (RPA).

Black dash line = Tree protective fence locations.

Shade quadrants = Hatched grey fan area.

ALL SITE PLANS CAN BE PRINTED AS A3 OR BE SENT AS DXF FILES. ALTERNATIVELY THE CSV FILE CAN BE EMAILED WITH TREE DATA ON.

Site Plan screen grab – please see scale pdf plan also

