Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-01 Existing 	G01	Welcome	OVERHAUL	TYPE 1	Leaf and Half	Y	N/A	N/A	TBC ON SITE	TBC ON SITE	TBC ON SITE	Paint	TBC	N/A	N/A	SH	OH-01 TO BE REVIEWED	Repair Notes Retained existing Fire Door, now with no fire requirement Make good door leaf and frame where ironmongery amended. Existing Ironmongery 2 x 3 x 100mm hinges Concealed bolt (to 1/2 leaf) o/h door closer Intumescent / smoke seals 700mm Push plate 600mm D pull handle "FDKS" fire signage - remove and make good Digilock already removed - make good as required Ironmongery Notes Note: Mechanical Digilock access (TBC)
DG-02 - existing EXISTING  PROPOSED 	G02	Retail	RECLAIMED FROM SITE (DF-21 from 1.19)	TYPE 5 Historic Door reclainmed from site	Single	N	N/A	N/A	XTG TBC FROM SITE RECLAIMED 2010	XTG 810 RECLAIMED 767	XTG 46 RECLAIMED 51	Paint	TBC	N/A	N/A	SH	ND-24 TO BE REVIEWED	Repair Notes Remove existing door and ironmongery. Make good existing door frame where ironmongery has been removed. Existing Ironmongery 2x 100mm (h) Door hinges - remove and make good Rim lock and receiver - retain Escutcheon - retain No smoking sign - remove and make good Ironmongery Notes 3 x 100mm hinges Mechanical Digilock with levers o/h closer 1 x eurolock cylinder/ escutcheons NOTE: Coordination between the door handle and the shutter installation required to ensure the ironmongery does not foul shutter operation.

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC


LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-04 - EXISTING 	G05	Staff Mess	OVERHAUL	TYPE 1 Square Vision Panel	Single	N	N/A	N/A	1980	827	48	Paint	TBC	N/A	N/A	N/A	OH-02	Repair Notes Make good door leaf and frame where ironmongery amended. Retain the follow ironmongery as indicated: Existing Ironmongery 3 x 100mm hinges Intumescent / smoke seals o/head door closer Lock and latch set and receiver - remove and make good 2 brass escutcheons - remove and make good 2 SAA lever handles - remove and make good Door guard - remove and make good "FDKS" x 2 + open safely - remove and make good Ironmogery Notes Retained existing Fire Door, now with no fire requirement Note: Mechanical Digilock access (TBC)
DG-05 - existing 	G05	Staff Mess	NEW	TYPE 3A	Single	Y	N/A	N/A	1995	840	43	Paint	TBC	FD30S	N/A	N/A	ND-24 TO BE REVIEWED	Notes Non standard application and door to be reviewed by FE Ironmongery Notes Locable Mechanical Digilockis required.
DG-07 - existing 	G51	Former Store (Room not in use)	OVERHAUL	TYPE 1 Existing original 4 panel Door retained	Single	N	N/A	N/A	1835	740	47	Decorate to match existing	TBC	N/A	N/A	N/A	OH-04 TO BE REVIEWED	Repair Notes NOTE: Room to be mothballed as historic door cannot tbe upgraded to a fire door. Make good door leaf and frame where ironmongery amended. Existing Ironmongery 3 x 100mm hinges - retain Rim lock and latch - adjust (provide receiver) 1 x escutcheon - retain 2 x brass knobs - retain and adjust 1 x eceiver, deadlock and escutcheon - remove and make good door and frame Door keep locked sign - remove and make good door Ironmongery Notes Provide recever to existing rim lock Provide new signage ROOM NOT IN USE - KEEP LOCKED

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-09 - existing 	G09	WC	OVERHAUL	TYPE 1 Existing Door	Single	N	N/A	N/A	1983	685	36	**Paint**	TBC	N/A	N/A	N/A	OH-06	Repair Notes Make good door leaf and frame where ironmongery amended. Retain the follow ironmongery as indicated: Existing Ironmongery 3 x 75mm hinges - retain 300 push plate (SAA)- remove and make good 225 pull handle (SAA) - remove and make good Bathroom indicator bolt - remove and make good
DG-10 - existing 	G05	WC	OVERHAUL	TYPE 1 Existing Door	Single	N	N/A	N/A	1990	680	36	**Paint**	TBC	N/A	N/A	N/A	OH-07	Repair Notes Make good door leaf and frame where ironmongery amended. Retain the follow ironmongery as indicated: Existing ironmongery: 3 x 75mm hinges - retain 1 x push plate 300mm - remove and make good 1 x Pull handle 225mm - remove and make good 1 x Bathroom indicator bolt -remove and make good Ironmongery Notes Gender Neutral signage required
DG-14 - existing 	G07	WC	OVERHAUL	TYPE 1 Existing Door Leaf	Single	N	N/A	N/A	1985	689	33	**Paint**	TBC	N/A	N/A	N/A	OH-07 (Omit Deadlock)	Repair Notes Make good door leaf and frame where ironmongery amended. Retain the follow ironmongery as indicated: Existing Ironmongery 3 x 75mm hinges 1 x 300mm brass push plate - remove and make good 1 x 225mm SAA pull handle - remove and make good 1 x o/head door closer - remove and make good Signage - remove and make good Ironmongery Notes Gender Neutral signage required
DG-15	G53	Electrical Cupboard	NEW	TYPE 3C	Single	N	TBC - SITE DIMS	TBC - SITE DIMS	XTG 2010	XTG 675	XTG 38 Upgrade door and frame to FD30	**Paint**	TBC	FD30	N/A	N/A	ND-25	
DG-16 - existing 	G08	WC	OVERHAUL	TYPE 1 Existing Door + Frame	Single	N	N/A	N/A	2000	690	36	**Paint**	TBC	N/A	N/A	N/A	OH-06	Repair Notes Make good door leaf and frame where ironmongery amended. Retain the follow ironmongery as indicated: Existing Ironmongery 3 x 75mm hinges - retain 1 x 300 SAA push plate - remove and make good 1 x Indicator bolt and receiver - remove and make good 1 x 225mm SAA pull handle - remove and make good Ironmongery Notes Gender Neutral signage required

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-17	G52	Lobby	NEW	TYPE 3A	Single	Y	TBC - SITE DIMS	TBC - SITE DIMS	XTG 2045	XTG 882	XTG 65 Amend to FD30S	Paint	TBC	FD30S	N/A	SH	ND-26	Notes New fire door and frame in this location Existing door to be overhauled and relocated (DG-80)
DG-18 - existing 	G59	Former Store	OVERHAUL	TYPE 1 Existing Historic boarded door to be retained for re-use	Single	N	N/A	N/A	1835	690	72	Paint	TBC	N/A	N/A	N/A	OH-04 TO BE REVIEWED	Repair Notes Make good door leaf and frame where ironmongery amended Review scope of repairs with AABC prior to undertaking. Existing Ironmongery 3 x 100mm steel hinges - retain 1 x Historic rim lock restore/ replace to match - specialist item 1 x cup hook - remove and make good Ironmongery Notes Provide new signage ROOM NOT IN USE - KEEP LOCKED
DG-19 - existing relocated 	G52	Stair 3	RECLAIMED FROM SITE	TYPE 5 Existing Historic boarded door to be relocated in DF-13	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Refer to DF-13 for details of work required
DG-20	G12	Special Exhibition Gallery	NEW	TYPE 3C	Single	N	TBC - SITE DIMS	TBC - SITE DIMS	XTG 1980	XTG 834	XTG TBC	Paint	TBC	FD30S	N/A	SH	ND-27 TO BE REVIEWED	Ironmongery Notes Means of escape in case of fire - WCBC to confirm panic boltro override In a gallery space

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC


LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-22	G12	Special Exhibition Gallery	NEW	TYPE 2B	Double Leaf	N/A - Glazed Door	SITE DIM (TBC On Site)	SITE DIM (TBC On Site)	XTG 1910	XTG 742	N/A	**PCC Aluminium**	TBC	**FD30**	Rw30dB	SH	X	IRONMONGERY ASSUMED TO BE PROVIDED BY DOOR SUPPLIER - to match Allgood Automatic Door G12 - wall mounted Push Pads? G17 - pedestal mountedPush Pads?
DG-23	G13	Exhibition Prep	NEW	TYPE 3C	Single	N	(2100mm TBC)	1200	N/A	N/A	N/A	**Paint**	TBC	**FD30**	Rw35dB	N/A	ND-27 TO BE REVIEWED	DOOR AND FRAME TO BE FLUSH WITH GALLERY LINING No push handle/ pull plate
DG-24  	G14	Corridor	OVERHAUL	TYPE 1	Single	Y	N/A	N/A	1920	827	42	Paint	TBC	**FD30**	Rw30dB	SH	ND-28 TO BE REVIEWED	<u>Existing Ironmongery</u> Remove existing concertina security shutter 3 x 100mm hinges - signs of corrosion, remove and replace the existing hinges with 3no. UKCA/CE embossed Certifire hinges. o/head door closer Smoke/intumescent seals in frame Room sign - remove and make good Lock and lever set Lever handle/thumb turn Eurolock Escutcheon 2 x kickplates <u>Ironmongery Notes</u> Replace Eurolock cylinder (Suiting TBC) Digilock required/ fire signage Acoustic Seals? NOTE: Acoustician recoomends dB30 door, but performance of existing is unknown

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-25 EXISTING 	G43	SE Turret	OVERHAUL	TYPE 1 Existing Historic boarded door to be retained for re-use	Single	N	N/A	N/A	1925	680	23 (+25)	Paint	TBC	N/A	N/A	N/A	OH-08	Repair Notes Remove any redundant ironmongery and make good door and frame. Existing Ironmongery 2 x T hinges (250mm) - retain Suffolk latch set (195mm) - retian Receiver - retain Ironmongery Notes Add lock
DG-30  	G31	Lobby	OVERHAUL	TYPE 1 Existing historic boarded door + frame to be retained	Single	N	N/A	N/A	2110	1035	66-70	Paint	TBC	N/A	N/A	N/A	OH-09	Repair Notes Retain steel plate to G01 side of the door. Repair door and frame following removal of redundant fixtures and fittings. Existing Ironmongery Repair existing ironmongery: Existing 3 x 125mm hinges - retain 2no. T hinges - decorative - retain 1no. decorative handle rose - repair 1no. nmlock / latch box - retain 1 no. deadlock - remove, make good door and frame 2no. 225mm painted bolts and recievers - retain 'Staff Only' sign - remove and make good Ironmongery Notes: Add Eurolock (Suiting TBC) Escutcheons (Note: requested digilock to be fitted to DG-58
DG-37	G21	Materials Store	NEW	TYPE 3C	Single	N	N/A	N/A	1950	764	43	Paint	TBC	FD30S	N/A	N/A	ND-29 TO BE REVIEWED	Ironmongery Notes Eurolock/ deadlock Digilick required

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-40 	G44	SW Turret	OVERHAUL	TYPE 1 Existing historic boarded door, frame + fanlight to be retained	Single	N	N/A	N/A	1935	655	48 (20+28)	Paint	TBC	N/A	N/A	N/A	OH-08	HISTORIC DOOR - RETAIN HISTORIC IRONMONGERY Existing Ironmongery 2no. T hinges (250mm) Suffolk latch (195mm) Receiver Ironmongery Notes Add lock
DG-42	G24	Learning Space	NEW	TYPE 2B	Double Leaf	N/A	XTG SITE DIMS TBC	XTG SITE DIMS TBC	XTG 1960	XTG 760	XTG 33	PCC Aluminium	TBC	N/A	Rw35dB	N/A	X	IRONMONGERY ASSUMED TO BE PROVIDED BY DOOR SUPPLIER - to match Allgood Automatic Door - Operation to be confirmed by WCBC G12 - wall mounted Push Pads/ key operation G17 - PIR? Manifestation required to provide privacy
DG-47	G34	Kitchen	NEW	TYPE 3A	Single Leaf Dual Swing	Y	2100(TBC ON SITE)	1050 (TBC ON SITE)	XTG 2068	XTG 925	XTG 42	**Paint**	TBC	**FD30S**	N/A	N/A	ND-03 TO BE REVIEWED	Installation Notes Frame to be relocated so floor pivot is located in concrete screed not in stone paving. Allow for any making good required to masonry. Ironmongery Notes Deadlock required (Suiting TBC) Floor pivot not o/h closer Note: Digilock wont work with dual swing - confirm to WCBC

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

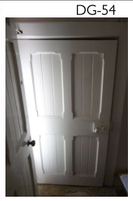
LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-51 	G01	Welcome	OVERHAUL	TYPE 1 Existing historic door + frame to be retained	Single	N	N/A	N/A	2180	1080	66	Paint	TBC	N/A	N/A	N/A	OH-11	Existing Ironmongery 3 x 125mm hinges o/head door closer Digilock and receiver removed - make good or re-fit digilock Room signage - remove and make good Remnants of bolt and receiver to be retained Ironmongery Notes Add Digilock Remiedial Works Make good damage to bottom of boards at no cost. Add timber strip to underside of door lead to minimise acoustic weak point Install acoustic seals - Sides/top/cill
DG-52	G25	Learning and Community Hub 2	NEW	TYPE 3A	Single	Y	N/A	N/A	1990	835	43	Paint	TBC	FD30S	N/A	N/A	ND-30 TO BE REVIEWED	The existing door is a fire door in an original door frame and therefore not compliant. Carefully remove architraves and retain for re-use. Remove existing door and frame and provide new, re-fix architraves Ironmongery Notes Digilock vs Deadlock - on fire exit, need override - review with WCBC Provide push plate or pull handle?
DG-53 	G29	Lobby	OVERHAUL	TYPE 1 Existing historic door + frame to be retained	Single	N/A	N/A	N/A	2043	830	47	Paint	TBC	N/A	N/A	N/A	OH-12	HISTORIC 6 PANELLED DOOR TO BE RETAINED Existing Ironmongery 2 x 125mm hinges - retain Night latch and receiver - removed, make good door 1 x rim lock / latch - clean off paint - retain/ adjust 1 x receiver - retain 2 x brass knobs - retain/ adjust 1 x escutcheon - clean off paint Ironmongery Notes Eurolock (Suiting TBC) Eschuteons

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

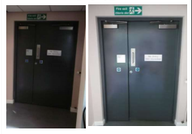
LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-54 	G55	Store	OVERHAUL	TYPE 1 Existing historic door + frame to be retained	Single	N/A	N/A	N/A	1660	835	45	Paint	TBC	N/A	N/A	N/A	OH-04 TO BE REVIEWED	Existing historic four panelled door to be retained (Note: this door cannot be upgraded to a fire door). Existing Ironmongery 2 X 100mm hinges - retain 1no. rim lock / latch and receiver - painted, clean/ adjust 1 pr knobs - brass, painted - remove paint and adjust Fire Remedial works Remove services passing through door frame as good practice (Please ensure these are redundant- - if not this will need fire stopping to both sides). The room not in use needs to be separated from the escape route. Repair the architrave with timber and prime and undercoat in advance of decoration Ironmongery Notes New eurolock (Suiting TBC) Bilingual Welsh/English Sign - 'Room not in Use - keep locked'
DG-56 	G45	Stair 1	OVERHAUL	TYPE 1 Existing historic door + frame to be retained	Single	N/A	N/A	N/A	2090	752	47	Paint	TBC	N/A	N/A	N/A	OH-13 TO BE REVIEWED	HISTORIC FLB DOOR TO BE RETAINED Repair Notes Remove redundant fixtures and fittings and make good door and frame Existing Ironmongery 1 pr 125mm hinges - retain 1no. night latch and receiver -remove and make good door and frame 1 x rim lock / latch - retain/ adjust 2 x brass knobs (painted / clean/ adjust) 1no. escutcheon - retain o/head closer - retain 2no. bolts (225mm) and receivers - remove and make good door and frame Ironmongery Notes Floor Bolt and receiver to fix open when in operation Eurolock Escutcheons
DG-57	G32	Cafe Store	NEW	TYPE 3A	Single	Y	TBC SITE DIM	TBC SITE DIM	XTG 1985	XTG 758	XTG 43	Paint	TBC	FD30S	N/A	N/A	ND-30 TO BE REVIEWED	The eixting door is a fire door in anoriginal door frame and therefore not compliant. Carefully remove architraves and retain for re-use. Remove existing door and frame and provide new, re-fix architraves Ironmongery Notes Deadlock - on fire exit, need override - review with WCBC Provide push plate or pull handle?

Wrexham Museum Redevelopmen	Schedule	Author
241084-PUR-00-XX-SH-A-0005	Door Schedule	

Version	Drawn	Checked
P01 06/10/2023	CH	PS
P02 17/10/2023	CH	PS
P03 14/12/2023	CH	PS
P04 19/01/2024	PS	PS
P05 22/08/2024	CH	ZB
P06 13/09/2024	CH	JR
P07 28/10/2024	CH	ZB
C01 21/03/2025	JR	JR

Notes:
This Schedule should be read in conjunction with the following drawings:
Wall Type Drawings: **241084-PUR-00-GF-DR-A-2600** , **241084-PUR-00-01-DR-A-2610** , **241084-PUR-00-02-DR-A-2615** & **241084-PUR-00-RF-DR-A-2620**
Fire Strategy Drawings: **241084-PUR-00-GF-DR-A-2510** , **241084-PUR-00-01-DR-A-2511** & **241084-PUR-00-02-DR-A-2512**
Security Strategy Drawings: **241084-PUR-00-GF-DR-A-2520** , **241084-PUR-00-01-DR-A-2521** & **241084-PUR-00-02-DR-A-2522**

IRONMONGERY PROPOSALS IN ABEYANCE - TBC

LOCATION				OPENING										DOOR PERFORMANCE				
DOOR REF NUMBER	ROOM NUMBER	ROOM NAME	NEW / OVERHAUL / RECLAIMED FROM SITE	NEW DOOR TYPE TYPE 1 - EXISTING DOORS TYPE 2A/B - ALUPROF GLAZED DOORS TYPE 3A/3B/3C - NEW DOORS TYPE 4 - SR RATED TYPE 5 - HISTORIC DOOR RELOCATED REFER TO DRAWINGS 4330,4331,4332 FOR DOOR TYPES	SINGLE / DOUBLE LEAF / LEAF AND HALF / DOUBLE SWING / SLIDING	VISION PANEL	NEW SO HEIGHT (mm)	NEW SO WIDTH (mm)	EXISTING DOOR LEAF HEIGHT (mm)	EXISTING DOOR LEAF WIDTH (mm)	EXISTING DOOR LEAF THICKNESS (mm)	DOOR FINISH	COLOUR	FIRE RATING	ACOUSTIC RATING	SHUTTERS	IRONMONGERY (ALLGOOD SET NUMBER)	COMMENTS
Ground Floor																		
DG-58	G32	Café Store	NEW	TYPE 3A	Single	Y	XTG SITE DIM	XTG SITE DIM	XTG 1990	XTG 795	XTG 35	Paint	TBC	FD30	N/A	N/A	ND-30 TO BE REVIEWED	Installation Notes Retain original architrave - refix after installation of door and frame. Ironmongery Notes Deadlock/ escutcheons required Digilock
DG-61 	G39	Delivery	OVERHAUL TBC	TYPE 1	Double Leaf	N	N/A	N/A	2052	885 (TBC ON SITE)	47	Paint TBC	TBC	FD30	N/A	N/A	ED-01 TO BE REVIEWED	The original specification for this door identifies it as 3-4 hour fire resistance to protect the collection sotre. Fire Remedial Works Ensure no services pass through the mastic or frame. Rake out mastic and provide fore stopping to provide 240FR to match the door. Note: Fire stopping remedial works required between the frame and aperture which is tested for a steel door application as the steel will expand at different rates to timber fire door assemblies. Ironmongery Notes New eurolock (Suiting TBC) Replace fire signage with Welsh/English (square/size to match)
DG-62 	G38	Collection Store	OVERHAUL TBC	TYPE 1	Leaf and Half	N	N/A	N/A	2055	470	77 (50+22)	Paint TBC	TBC	FD30	N/A	N/A	ED-01 TO BE REVIEWED	The original specification for this door identifies it as 3-4 hour fire resistance to protect the collection sotre. Fire Remedial Works Ensure services pass through the mastic or frame. Rake out mastic and provide fore stopping to provide 240FR to match the door. Note: Fire stopping remedial works required between the frame and aperture which is tested for a steel door application as the steel will expand at different rates to timber fire door assemblies. Ironmongery Notes New eurolock (Suiting TBC) Replace fire signage with Welsh/English (square/size to match)