



NKC Geotech Ltd

engineering geologist specialising in the investigation and treatment of disused mineworkings

25 Grosvenor Road
Wrexham LL11 1BT

t 01352 762080

e neil@nkc.co.uk
w www.nkc.co.uk

Coal Mining Risk Assessment



Rear of 9A Stanley Road, Ponciau

Blueprint Architectural Services
Office 3K4
Redwither Business Tower
Wrexham
LL13 9XT

1942
25 September 2019



NKC Geotech Ltd

Site

A plot for residential development at the rear of 9A Stanley Road, Ponciau, Wrexham.

Risk Assessment by

Neil Catlow B.Sc F.G.S Engineering geologist.

Summary of relevant mining information

Publication CIRIA32 'Construction over Abandoned Mineworkings'
Coal Authority Report 51000371963001 dated 16th September 2013
Ordnance Survey 1:2500 First Edition 1875
Geological Survey 1:10560 plans

Nkc Geotech Ltd investigations with relevance to this site:

0540 Stanley Road June 2005
9048 Bernfels Court August 1990
9313 Stanley Road March 1993
3582. Bernfels, Fennant Road. July 1983

Assessment of risk that coal mining poses to the proposed development

Geology

The site lies on Carboniferous Westphalian rocks that form the Wrexham Coalfield, dipping to the east at 1 in 8. These rocks are predominantly shales and sandstones laid down in a tropical delta environment when Europe lay on the equator as part of the continent of Pangea. Westphalian strata contains seams of coal upto 4.5m in thickness at vertical intervals typically varying from 4.0m to 20.0m. Those coal seams which were of economic importance were given an identity when they were of sufficient quality and thickness to justify extraction by mining. Typical names for local coal seams reflect primarily on quality and thickness, for example Main Coal, Yard Coal and Wall & Bench Coal.

The deepest worked coal seam is the Wall & Bench Coal at 110m below the site, but there are three shallower coal seams known to have been mined here. The shallowest seam is the Main Coal, 2.5m thick. From my previous investigations in Ponciau, this seam will be present at a possible depth of 20m below the site. The Nkc site 9048 at Bernfels Court in 1990 proved the Main Coal to be deeper than 30m. The next deepest coal seam is 6m below the Main Coal and locally known as the Brassey Coal, I have encountered extensive workings in both the Main and the Brassey Coals in Ponciau.


Past underground coal mining

Coal mining in Rhos is recorded in 1410, most probably in the Main Coal at the Delph immediately east of High Street when the area was part of the medieval Bersham Waste, ie common land. Industrial mining deeper than the outcrop workings and simple bell pits of the 'cole farms' in the Waste dates from the 16th century. The last legal coal mining in Rhos was at Coppi Brickworks where the Llwyneinion Half Yard Coal was mined in conjunction with the underlying fireclay in 1971. The Wall & Bench Coal was mined illegally by robbing historic old workings and sold locally during the miners' strike of 1985 from outcrops at Llwyneinion.

There are no records of past mining activity under the site of workings which pre-date the 1887 Coal Mine Regulations which required colliery owners to keep and preserve plans of their workings. The coal seams deeper than the Brassey Coal were principally worked in the 19th century to supply Ponciau Furnace at Gutter Hill.

Present underground coal workings

There is no current coal mining within 20km of the site.

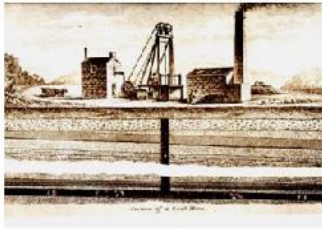

NIKE Geotech Ltd

Future underground coal workings

There are no current coal mining proposals within 20km of the site.

Recorded mine entries on or within 20m of the site boundary

There is one recorded mine entry on or within 20m of the site.

Shaft 329346-488, Ruabon Colliery No 9 Chain Pit, is shown 18m east of the site close to the adjacent Bernfels Court access road. I located this shaft in July 1983 during an investigation into serious subsidence of the former dwelling Bernfels. This property was demolished and shaft treated by the NCB in February 1986. The shaft lining brickwork found at shallow depth immediately under the house foundations at the gable wall. The shaft was subsequently proved by drilling by NCB contractors to be sunk to the Main Coal and is 39.6m deep.

Coal mining geology

The Coal Authority have no records of any damage caused by geological faults.

Past opencast mining

There are no former opencast coal mining sites within 200m of the site.

Present opencast mining

There are no current opencast coal mining sites within 200m of the site.

Future opencast mining

There are no proposed opencast coal mining sites within 800m of the site.

Mine gas emissions

There are no recorded mine gas emissions within the site boundary.

Surface hazards

There are no recorded remedial works being carried out by the Coal Authority on the site nor any subsidence claims.

Further information

The risk to any proposed development is subsidence caused by the collapse of shallow mining tunnels where there is less than 25m of rock cover to underground workings in the Main Coal. As the Main Coal is known to have been extensively mined in the past, with the deeper Brassey Coal only 6m below the Main, there is a risk of potential instability due to past shallow coal mining activity unless there is over 5m of rock cover the Main Coal workings.. An intrusive investigation by rotary drilling at least 2 holes to 30m depth will be required to determine the extent of any hazards.

The location of Shaft 329346-488 has been proved to be off the site and no shaft investigation will be required.

The depth of 39.6m to the Main Coal at Shaft 488 correlates with the results of my investigations further north on Stanley Road and confirms there is a risk, until proved otherwise by drilling, that the the Main Coal workings are sufficiently shallow to affect surface stability.



 **NKC Geotech Ltd**

Mitigation measures

If the Main Coal is proved to be under 25m deep, the site will require remedial works by drilling and grouting the old workings under the bearing areas of the proposed buildings to prevent collapse.

A Coal Authority Permit will be required for the intrusive investigation drilling, and a further Permit required if remedial stabilisation works are necessary.

For Nkc Geotech Ltd



Neil Catlow, B.Sc, F.G.S



NKC Geotech Ltd

Geological plan of the locality
Scale 1:1250 @ A4

