



## ARBORICULTURAL REPORT (BS 5837:2012)

PROPOSED DEVELOPMENT

AT

ELEVENTH AVENUE

LLAY

WREXHAM

LL12 0SN

January 2018

PM/FULL/09/01/18

Murray Tree Consultancy | 0161 425 2138 | 07920 264374 | [peter@murraytreeconsultancy.co.uk](mailto:peter@murraytreeconsultancy.co.uk)

[www.murraytreeconsultancy.co.uk](http://www.murraytreeconsultancy.co.uk)

## TABLE OF CONTENTS

| Contents                                   | Page No. |
|--------------------------------------------|----------|
| 1.0 INTRODUCTION                           | 3        |
| 1.1 Professional Details                   | 3        |
| 1.2 Tree Survey                            | 3        |
| 2.0 FINDINGS                               | 4        |
| 2.1 The Site                               | 4        |
| 2.2 The Soils                              | 4        |
| 2.2 The Trees                              | 4        |
| 2.3 Standard of Work                       | 4        |
| 2.4 Statutory Controls                     | 4        |
| 2.5 Wildlife                               | 5        |
| 3.0 DISUSSION                              | 5        |
| 4.0 ARBORICULTURAL IMPLICATIONS ASSESSMENT | 6        |
| 5.0 MITIGATING PROPOSALS                   | 7        |
| 5.1 Tree Losses                            | 7        |
| 5.2 Replacement Planting                   | 7        |
| 5.3 Sequence of Events                     | 8        |

APPENDIX A – Glossary of Terms and Table 1 of BS 5837:2012

APPENDIX B – Arboricultural Data

APPENDIX C – Site Plans - Tree Constraints Plan  
 Development Layout Plan  
 Tree Planting Plan

#### Disclaimer

*The tree(s) referred to in this report are living entities and are therefore subject to natural processes. They will also be subject to changes to their environment caused by human's activities and to exceptional weather conditions. The inspection undertaken by our qualified staff relies on visual attributes of tree health and structure which can be assessed from a ground based inspection. Hidden defects which are not readily visible may not be detected. We therefore cannot wholly guarantee the condition and safety of the trees inspected beyond what can be reasonably assessed from the procedure used. We would recommend that the trees are regularly inspected and our staff will advise on the suitable frequency of these inspections.*

## 1.0 INTRODUCTION

### 1.1 Professional Details

- 1.1.1 My name is Peter Murray and I have been working and studying in the Arboricultural Industry since 1989. I have many years practical and consulting experience as a Local Authority arboriculturalist and more recently as a private sector practitioner.
- 1.1.2 I so far hold the Higher National Diploma in Arboriculture and am a professional member of the Arboricultural Association. I keep up to date with the latest research and best practice by attending relevant courses and seminars.

### 1.2 Tree Survey

- 1.2.1 I was recently instructed by Ainsley Gommon Architects on behalf of their clients to carry out a site visit at Eleventh Avenue, Llay, Wrexham and survey all significant trees that may be affected by development proposals in accordance with *BS 5837:2012 trees in relation to design, demolition and construction – Recommendations*.
- 1.2.2 The survey on which the findings of this report are based was undertaken on Monday 8<sup>th</sup> January 2018 and the weather was frosty but dry.
- 1.2.3 This report should be read in conjunction with the attached Arboricultural Data and Site Plans of Appendix B and C.
- 1.2.4 The trees were inspected from ground level only and all comments and recommendations made have taken into account their location, surroundings and likely impact on persons or property.
- 1.2.5 The limitations of this report are restricted to the persons, time, information made available and purpose for which this report has been prepared. This report does not deal with any existing tree root/building conflicts and no information has been provided regarding soil type and no analysis undertaken by this company.

## **2.0 FINDINGS**

### **2.1 The Site**

- 2.1.1 The site in question is currently in use as a public open space and is mostly grass with three early-mature trees to the south end. The ground is more or less level.
- 2.1.2 The proposal is to construct a residential development on the land with associated car parking.

### **2.2 Soils**

- 2.2.1 The soil of the site is described at <http://www.landis.org.uk/soilscapes> as being ‘free draining slightly acid loamy soils’. Therefore, the soil is good for tree growth of the majority of deciduous species.

### **2.3 The Trees**

- 2.3.1 A total of three individual trees were surveyed and plotted in order to assess their health and dimensions in accordance with the British Standard and the results are clearly detailed within the Appendices of this report.
- 2.3.2 In general the trees were found to be in reasonable condition for their age and species. Any works identified within the data tables should take place regardless of development in line with best practice. The quality rating for the trees on or affecting this site can be summarised as follows:

- U – 0 trees
- A – 0 trees
- B – 2 trees (T1 & T2)
- C – 1 tree (T3)

### **3.3 Standard of Work**

Any tree work undertaken should be done in accordance with British Standard 3998:2010 and by competent contractors insured with public liability cover of at least two million pounds.

### **3.4 Statutory Controls**

If the trees on site are subject to any Tree Preservation Orders (TPO's) or are encompassed within a Conservation Area then statutory permission from the Local Planning Authority (LPA) will be required before any tree works take place.

### 3.5 Wildlife

All operations should take account of wildlife needs and be planned to take advantage of weather conditions and time of year for minimum damage and disturbance. If any protected species or nesting birds are present or discovered while the works are taking place all work should cease until contact has been made with Countryside Council for Wales for further advice. Countryside Council for Wales can be contacted on 01248 385500 or by e-mail to: [Enquiries@ccw.gov.uk](mailto:Enquiries@ccw.gov.uk). Specific consideration should be given to the possible presence of roosting bats, which are protected by the Wildlife and Countryside Act 1981 (schedule 5) and included in schedule 2 of the Conservation Regulations 1994. Ideally, a survey should be carried out to identify any potential roost sites and if bats are found to be present advice should be sought from a person qualified and experienced in handling such matters and fully conversant with the implications of the Act.

### 3.0 DISCUSSION

- 3.1 The majority of the root system, of a tree, is in the surface 600mm of the soil, extending radically for distances frequently in excess of the trees height. Beyond the main structural roots (close to the base of the trunk), the root system rapidly sub-divides into smaller diameter roots: off this main system, a mass of fine roots develops.
- 3.2 The shape of the main structural roots develops in response to the need for the tree to have physical stability. Beyond these major roots, root growth and development is influenced by the availability of water and nutrients. Unless conditions are uniform around the tree, which would be unusual, the extent of the root system will be very irregular and difficult to predict. It will not generally show the symmetry seen in the branch system.
- 3.3 The parts of the root system, which are active in water and nutrient uptake, are very fine, typically less than 0.5mm diameter. They are short lived, developing in response to the needs of the tree, with the majority dying each winter. It is *essential* that conditions in the soil remain conducive to the healthy growth of these fine roots so that the water and nutrients necessary for healthy tree growth can be absorbed.
- 3.4 All parts of the root system, but especially the fine roots, are vulnerable to damage. Once they are damaged, water and nutrient uptake will be restricted until new roots have regenerated. Vigorous young trees will be capable of rapid regeneration but over mature trees will respond slowly, *if at all*.
- 3.5 In order to live and grow, roots need oxygen from the soil. Respiration by the roots and other soil organisms depletes this oxygen and increases carbon dioxide levels in the soil; a correct balance of these gases is normally maintained by diffusion between the soil and the atmosphere. Anything, which disturbs this balance, will affect the condition of the root system.

- 3.6 The factors that most commonly affect this diffusion adversely, and therefore damage roots, are the following: -
- a) Compaction of the ground, which reduces the space between soil particles. This is particularly important on clay soils. A single passage by heavy equipment on clay soils or storage of heavy materials can cause significant damage.
  - b) Changing soil levels, even for a few weeks.
  - c) Covering the root area with impervious surfaces.
  - d) A rise in the level of the water table. Roots can tolerate submersion for short periods. But a permanent rise will deplete the soil of oxygen.
- 3.7 Serious damage is often caused during preliminary site works by stripping the topsoil. For this reason, such works should be avoided until protective fencing has been erected.
- 3.8 Excavations in the rooting area can sever roots. As the majority of roots are in the surface 600mm, even shallow excavations can cause damage.
- 3.9 Excavations for foundations, landscaping or service trenches are usually sufficiently deep to sever most of the roots, and it should therefore be assumed that all parts of the root system beyond the excavation would no longer serve the tree.
- 3.10 Excavation or soil stripping which sever or damage the roots may impair the stability of the tree and make it dangerous.

#### **4.0 ARBORICULTURAL IMPLICATIONS ASSESSMENT**

- 4.1 The purpose of this section is to assess the implications, if any, the proposed development will have on the trees identified in the Tree Survey of 8<sup>th</sup> January 2018 carried out by Murray Tree Consultancy (see Appendix B) and advise on arboricultural measures, which would be likely to mitigate any damage resulting from the proposed development
- 4.2 The Site Layout Plan within Appendix C identifies the trees in relation to the proposed development and as can be seen T1 (Aspen) will need to be removed. Whilst it is possible to retain T2 & T3 (Sycamore) it is recommend that they are also removed and replaced with alternative species as their crown spreads are very close to the built development and they will seriously affect the rear amenity space. Owing to the constraints of the development it is not feasible to move the development forward in order to provide adequate room for these trees. Therefore, it is proposed to mitigate their loss with new planting to the front and rear of the development.

## 5.0 MITIGATING PROPOSALS

### 5.1 Tree Losses

- 5.1.1 The loss of any tree is always regrettable although in this instance with any development design it would not be appropriate to retain T1 (Aspen) due to its position within the site as well as its vigorous and fragile nature. T3 (Sycamore) is also a poor specimen and appears to be coppice growth from a previously cut stump.

### 5.2 Replacement Planting

- 5.2.1 The replacement trees should be of the nursery stock Select Standard Trees of a size not less than 10-12cm in girth measured at 1m and have an overall height of approx. 2.5m. They should be planted in prepared pits not less than 800mm (w) x 800mm (b) x 600mm (d). The bottom and sides of the pits shall be roughened with a fork to assist in free drainage and root penetration. Any extraneous matter including weeds, broken brick and large stones shall be removed.
- 5.2.2 The replacement trees shall be planted in the following planting season post development and planted in the positions clearly identified on the Tree Planting Plan of Appendix C and shall be of the following species:
- 3 x *Sorbus aucuparia* Joseph Rock (Rowan)
  - 3 x *Pyrus calleryana* Chanticleer (Chanticleer Pear)
  - 3 x *Crataegus laevigata* Paul's Scarlet (Thorn)
  - 2 x *Malus tschonoskii* (Pillar Apple)
- 5.2.3 All plant material shall generally be planted between November and March in open cool weather. Planting shall not take place in frosty, snowy or waterlogged conditions. Where approved, root-ball or container grown plants may be planted outside the described season, but adequate watering shall be supplied. Torn or damaged roots shall be cleanly pruned prior to planting.
- 5.2.4 The trees should be supplied bare root or root-balled. If root-balled they shall have low double staking with a bar and tie or if bare root they should have a single stake with tie. All double staking should be to a third the height of the stem.
- 5.2.5 All newly planted trees shall be well watered in to full root depth before they receive a layer of mulch consisting of bark chips spread on a radius of 500mm at a depth of approximately 50mm.
- 5.2.6 At the end of the growing season trees shall be checked and all broken, crossing and damaged branches or wood that has died shall be cut out. This is to be done in accordance with BS 3998 recommendations for tree work.

- 5.2.7 The newly planted trees shall be watered as necessary in dry periods to ensure satisfactory growth. Provision shall be in place for watering on four separate occasions within the first three years post planting. Water shall be applied slowly by hose sufficient to soak the soil/root area to field capacity using approximately 40 litres per tree.
- 5.2.8 All trees shall be seen to be in a healthy and vigorous condition at completion of the installation phase. Any trees, which fail to develop within the first year after planting, shall be replaced within the first available planting season. Similarly, any planting failures, which are present at the end of 5 years, shall be replaced. The replacement shall be to the same specification, including all work to pits, compost and maintenance etc.

### 5.3 Sequence of Events


1. **Removal of T1, T2 & T3 by a competent and fully insured arboricultural contractor in accordance with BS 3998:2010.**
2. **Removal of stumps; T2 & T3 may require a stump grinder due to location.**
3. **Construction of Development.**
4. **Replacement tree planting, which may require imported soil if none available in order ameliorate the planting areas.**

Signed



Peter Murray (HND. ARB, M, Arbor A)  
Consulting Arborist

10<sup>th</sup> January 2018

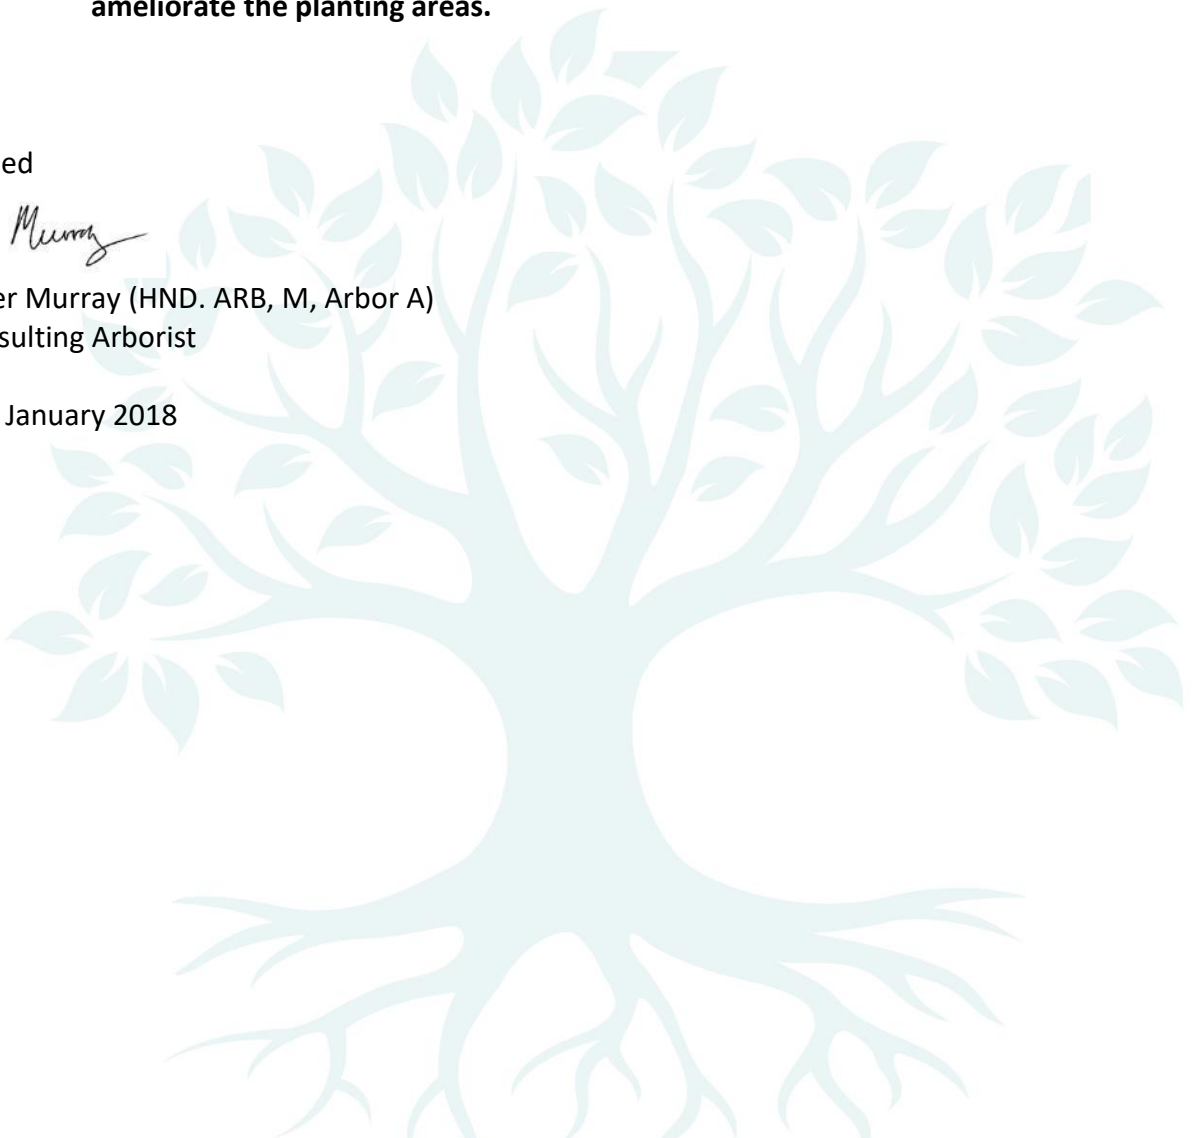

# **APPENDIX A**

## **Glossary of Terms**

### **Table 1 of BS 5837:2012**

## **Arboricultural Glossary of Terms**

The following terms are concurrent with best Arboricultural practice and within the guidelines set by the International Society of Arboriculture (ISA), the Arboricultural Association (AA) and the British Standards Institute (BSI).

**Dbh:** Diameter at Breast Height is measured at 1.5m and recorded in millimetres. Where a tree becomes multi-stemmed below 1.5m the diameter of each stem is measured at 1.5m and added together. Where a tree has low branching or has swelling the stem is measured at the narrowest point below.

**Height:** Height was estimated and recorded in metres.

**Age Range:** Age is site specific and categorised:

|                   |                                                           |
|-------------------|-----------------------------------------------------------|
| Young (Y)         | Out-planted trees that have not yet established.          |
| Semi-Mature (SM)  | Established trees up to 1/3 of expected height and crown. |
| Early Mature (EM) | Between 1/3 and 2/3 of expected height and crown.         |
| Mature (M)        | Between 2/3 and full expected height and crown.           |
| Fully Mature (FM) | Full expected height and crown.                           |
| Over Mature (OM)  | Crown beginning to break-up and decrease in size.         |
| Senescent (S)     | Crown in advanced stage of break-up.                      |

**Crown Spread:** Measured in metres at four cardinal points (N, E, S & W).

**Crown Clearance:** Measured in metres from the ground to the first branch tip on development side only.

**Condition** - Assessment of current physiological condition and structural morphology incorporating vigour and vitality and categorised:

- A - Tree needing little, if any attention
- B - Tree with minor, but rectifiable defects, or in the early stages of physiological stress
- C - Tree with significant structural and physiological flaws and/or extremely stressed
- D - Tree that is dead, biologically/physically moribund or dangerous

**Desirability To Retain** – As Outlined in Table 1 of BS 5837:2012 Trees in relation to design, demolition and construction – Recommendations (see below).

## Definition of Physiological & Morphological Terms

**Adaptive Growth** - The process whereby wood formation is influenced both in quantity and in quality by the action of gravitational force and mechanical stresses on the cambial zone.

**Bifurcation** – Forked or divided union.

**Brown Rot** - Form of decay where cellulose is degraded, while lignin is only modified.

**Cankers** (target or tumorous) - A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by woundwood development on the periphery. This may be annual or perennial.

**Cavity** - An open wound, characterised by the presence of extensive decay and resulting in a hollow.

**Chlorotic Leaf** - Lacking in chlorophyll, typically yellow in colour.

**Compartmentalisation** - The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms.

**Coppicing** - Is an ancient form of woodland management that involves repetitive felling on the same stump, near to ground level, and allowing the shoots to re-grow from that main stump. (Also known as the coppice stool).

**Crack** - Longitudinal spilt in stem or branch, involving bark and/or underlying wood. These may be vertically and horizontally orientated.

**Decay** - Process of degradation of woody tissues by fungi and bacteria through decomposition of cellulose and lignin.

**Deadwood** - Deadwood is often present within the crown or on the stems of trees. In some instances it may be an indication of ill health, however, it may also indicate natural growth processes. If a target is present beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc.).

**End Weight** - The concentration of foliage at the distal ends of stems and deficient in secondary branches.

**Girdling Root** - Root which circles and constricts the stem or roots causing death of phloem and/or cambial tissue.

**Hazard Beam** - An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases).

**Included Bark Union** - Pattern of development at branch junctions where bark is turned inward rather than pushed out. Potential weakness due to a lack of a woody union.

**Ivy Growth** - Ivy growth may ascend into the tree's crown, increasing wind resistance, concealing potential defects and reducing the tree's photosynthetic capacity. Ivy growth is often acceptable in woodland areas as a conservation benefit.

**Live Crown Ratio** - The relative proportion of photosynthetic mass (leaf area) to overall tree height.

**Reaction Wood** - Specialised secondary xylem, which develops in response to a lean or similar mechanical stress, attempting to restore the stem to the vertical.

**Root Plate Lift** - The physical movement of the rooting plate causing soils to shift and crack. May occur during adverse weather conditions. Trees may become unstable.

**Structural Defect** - Internal or external points of weakness, which reduce the stability of the tree.

**Suppressed** - Trees which are dominated by surrounding vegetation and whose crown development is restricted from above.

**Topping** - A highly disfiguring practise, likely to cause severe xylem dysfunction and decay in major structural parts of the wood.

**White Rot** - Form of decay where both cellulose and lignin are degraded.

**Wound** - Any injury, which induces a compartmentalisation response.

**Woundwood** - Wood with atypical anatomical features, formed in the vicinity of a wound and a term to describe the occluding tissues around a wound as opposed to the ambiguous term "callus."

**Woodland Structure** - The vertical and horizontal arrangement of trees within a group or woodland i.e. Dominant - trees with a crown above the upper layer of the canopy, Co-dominant trees that define the general upper edge of the canopy, Intermediate trees that have been largely overgrown by others, Suppressed trees that have been overgrown and occupy an under storey position and grow slowly, often severely asymmetrical.

**Note:** The definitions described above, may not necessarily be included within the Arboricultural Survey Data.

Table 1 – Cascade chart for tree quality assessment

| Category and definition                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                                                                         | Criteria (including subcategories where appropriate)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |                                                                                                                                       |  |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------|--|
| Trees unsuitable for retention (see note)                                                                                                                                 |                                                                                                                                                                                                                                                                                                                                                                                         |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                                                                                                                                       |  |
| <b>Category U</b><br>Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years |                                                                                                                                                                                                                                                                                                                                                                                         | <ul style="list-style-type: none"><li>Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other U category trees (i.e. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning)</li><li>Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline</li><li>Trees infected with pathogens of significance to the health and/or safety of other trees nearby (e.g. Dutch elm disease), or very low quality trees suppressing adjacent trees of better quality</li></ul> <b>Note</b> – <i>Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7.</i> |                                                                                                                                       |  |
|                                                                                                                                                                           | <b>1 Mainly arboriculture qualities</b>                                                                                                                                                                                                                                                                                                                                                 | <b>2 Mainly landscape qualities</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | <b>3 Mainly cultural values, including conservation</b>                                                                               |  |
| Trees to be considered for retention                                                                                                                                      |                                                                                                                                                                                                                                                                                                                                                                                         |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                                                                                                                                       |  |
| <b>Category A</b><br><b>Trees of high quality</b> with an estimated remaining life expectancy of at least 40 years                                                        | Trees that are particularly good examples of their species, especially if rare or unusual, or those that are essential components of groups or formal or semi-formal arboriculture features (e.g. the dominant and/or principal trees within an avenue)                                                                                                                                 | Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood pasture) |  |
| <b>Category B</b><br><b>Trees of moderate quality</b> with an estimated remaining life expectancy of at least 20 years                                                    | Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and minor storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation | Trees present in numbers, usually as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Trees with material conservation or other cultural value                                                                              |  |
| <b>Category C</b><br><b>Trees of low quality</b> with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm       | Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories                                                                                                                                                                                                                                                                       | Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Tree with no material conservation or other cultural value                                                                            |  |

## **APPENDIX B**

### **Arboricultural Data**


| Arboricultural Data Sheet: Eleventh Avenue, Llay, Wrexham, LL12 0SN                                                                                                                                                                                                                                                           |          |          |            |     |              |   |   |   |         | Date of Survey: 08/01/18 |                                                                                                                                                                                                                                                                                                      | Surveyor: PM |      |                       |                       |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------|------------|-----|--------------|---|---|---|---------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------|------|-----------------------|-----------------------|
| Crown C = Crown Clearance; Cond R = Condition Rating; ERC (Yrs) = Estimated Remaining Contribution; TQRA = Tree Quality Category Rating; RPA (m <sup>2</sup> ) = Root Protection Area (m <sup>2</sup> )<br>Recommended works should be carried out to the <i>British Standard Recommendations for Tree Work, BS 3998:2010</i> |          |          |            |     |              |   |   |   |         |                          |                                                                                                                                                                                                                                                                                                      |              |      |                       |                       |
| Tree No.                                                                                                                                                                                                                                                                                                                      | Species  | Dbh (mm) | Height (m) | Age | Crown Spread |   |   |   | Crown C | Cond R                   | Comments and Preliminary Management Recommendations                                                                                                                                                                                                                                                  | ERC (Yrs)    | TQCR | RPA (m <sup>2</sup> ) | RPA Circle Radius (m) |
|                                                                                                                                                                                                                                                                                                                               |          |          |            |     | N            | E | S | W |         |                          |                                                                                                                                                                                                                                                                                                      |              |      |                       |                       |
| T1                                                                                                                                                                                                                                                                                                                            | Aspen    | 420      | 13         | EM  | 6            | 6 | 5 | 6 | 1.5     | A                        | A vigorous specimen exhibiting good form with a slightly dense crown structure. However, this species is not usually appropriate close to residential development due to its vigorous and fragile nature.                                                                                            | 20+          | B1   | 79.80                 | 5.04                  |
| T2                                                                                                                                                                                                                                                                                                                            | Sycamore | 500      | 11         | EM  | 6            | 5 | 6 | 4 | 2.5     | B                        | A reasonable co-dominant specimen located on the boundary adjacent a residential garden. Very minor deadwood present in the crown and Elderberry and basal shoots present. - <b>Remove Elderberry and remove epicormic growth.</b>                                                                   | 20+          | B2   | 113.10                | 6.00                  |
| T3                                                                                                                                                                                                                                                                                                                            | Sycamore | 830      | 12         | EM  | 6            | 6 | 6 | 5 | 2       | B/C                      | A co-dominant multi-stemmed specimen located on the boundary with a residential garden. It appears to be previously Coppiced with varying stems at varying heights. Therefore, in this instance the dbh was taken below the forks. Several crossing branches within the crown. - <b>Crown clean.</b> | 10+          | C2   | 311.65                | 9.96                  |

## **APPENDIX C**

**Site Plans – Tree Constraints Plan**

**Development Layout Plan**

**Tree Planting Plan**

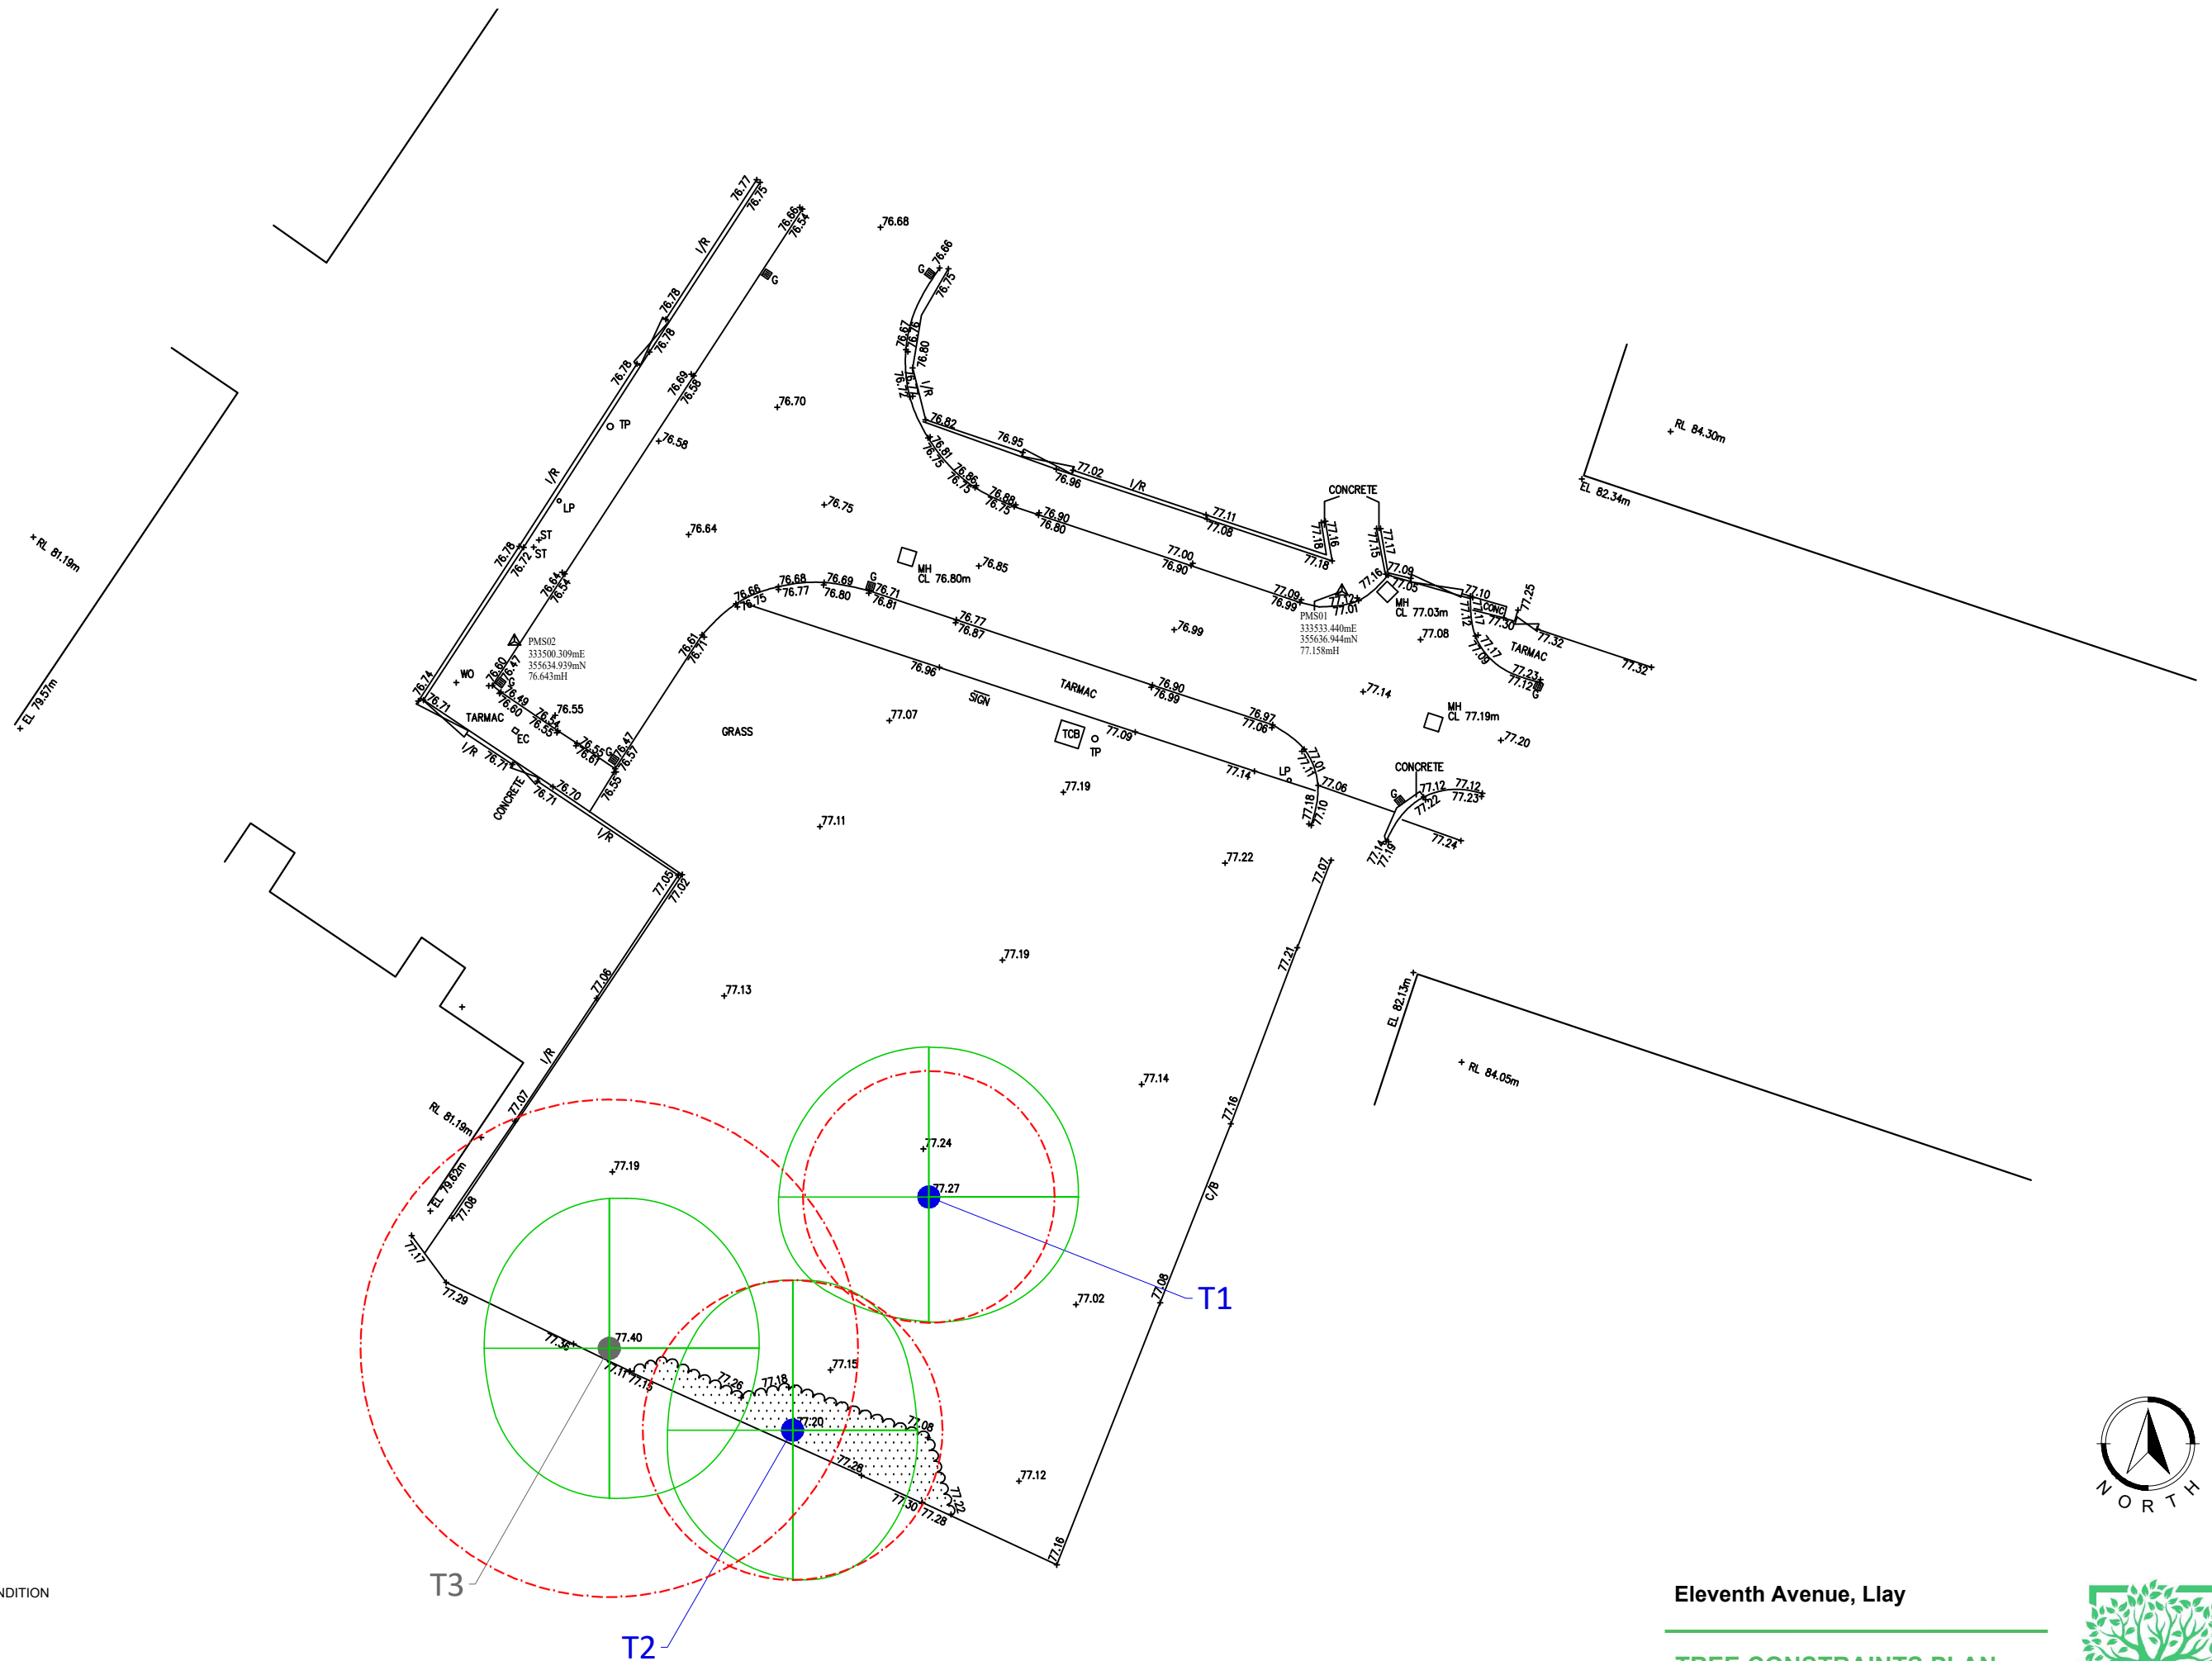


# KEY

-  TREE LOCATION AND CONDITION
-  GROUP/ HEDGE LOCATION AND CONDITION
-  ROOT PROTECTION AREA (RPA)
-  CROWN SPREADS

## Key to Condition

**Red** – Trees of poor quality **Blue** – Trees of moderate quality  
**Grey** – Trees of low quality **Green** – Trees of high quality

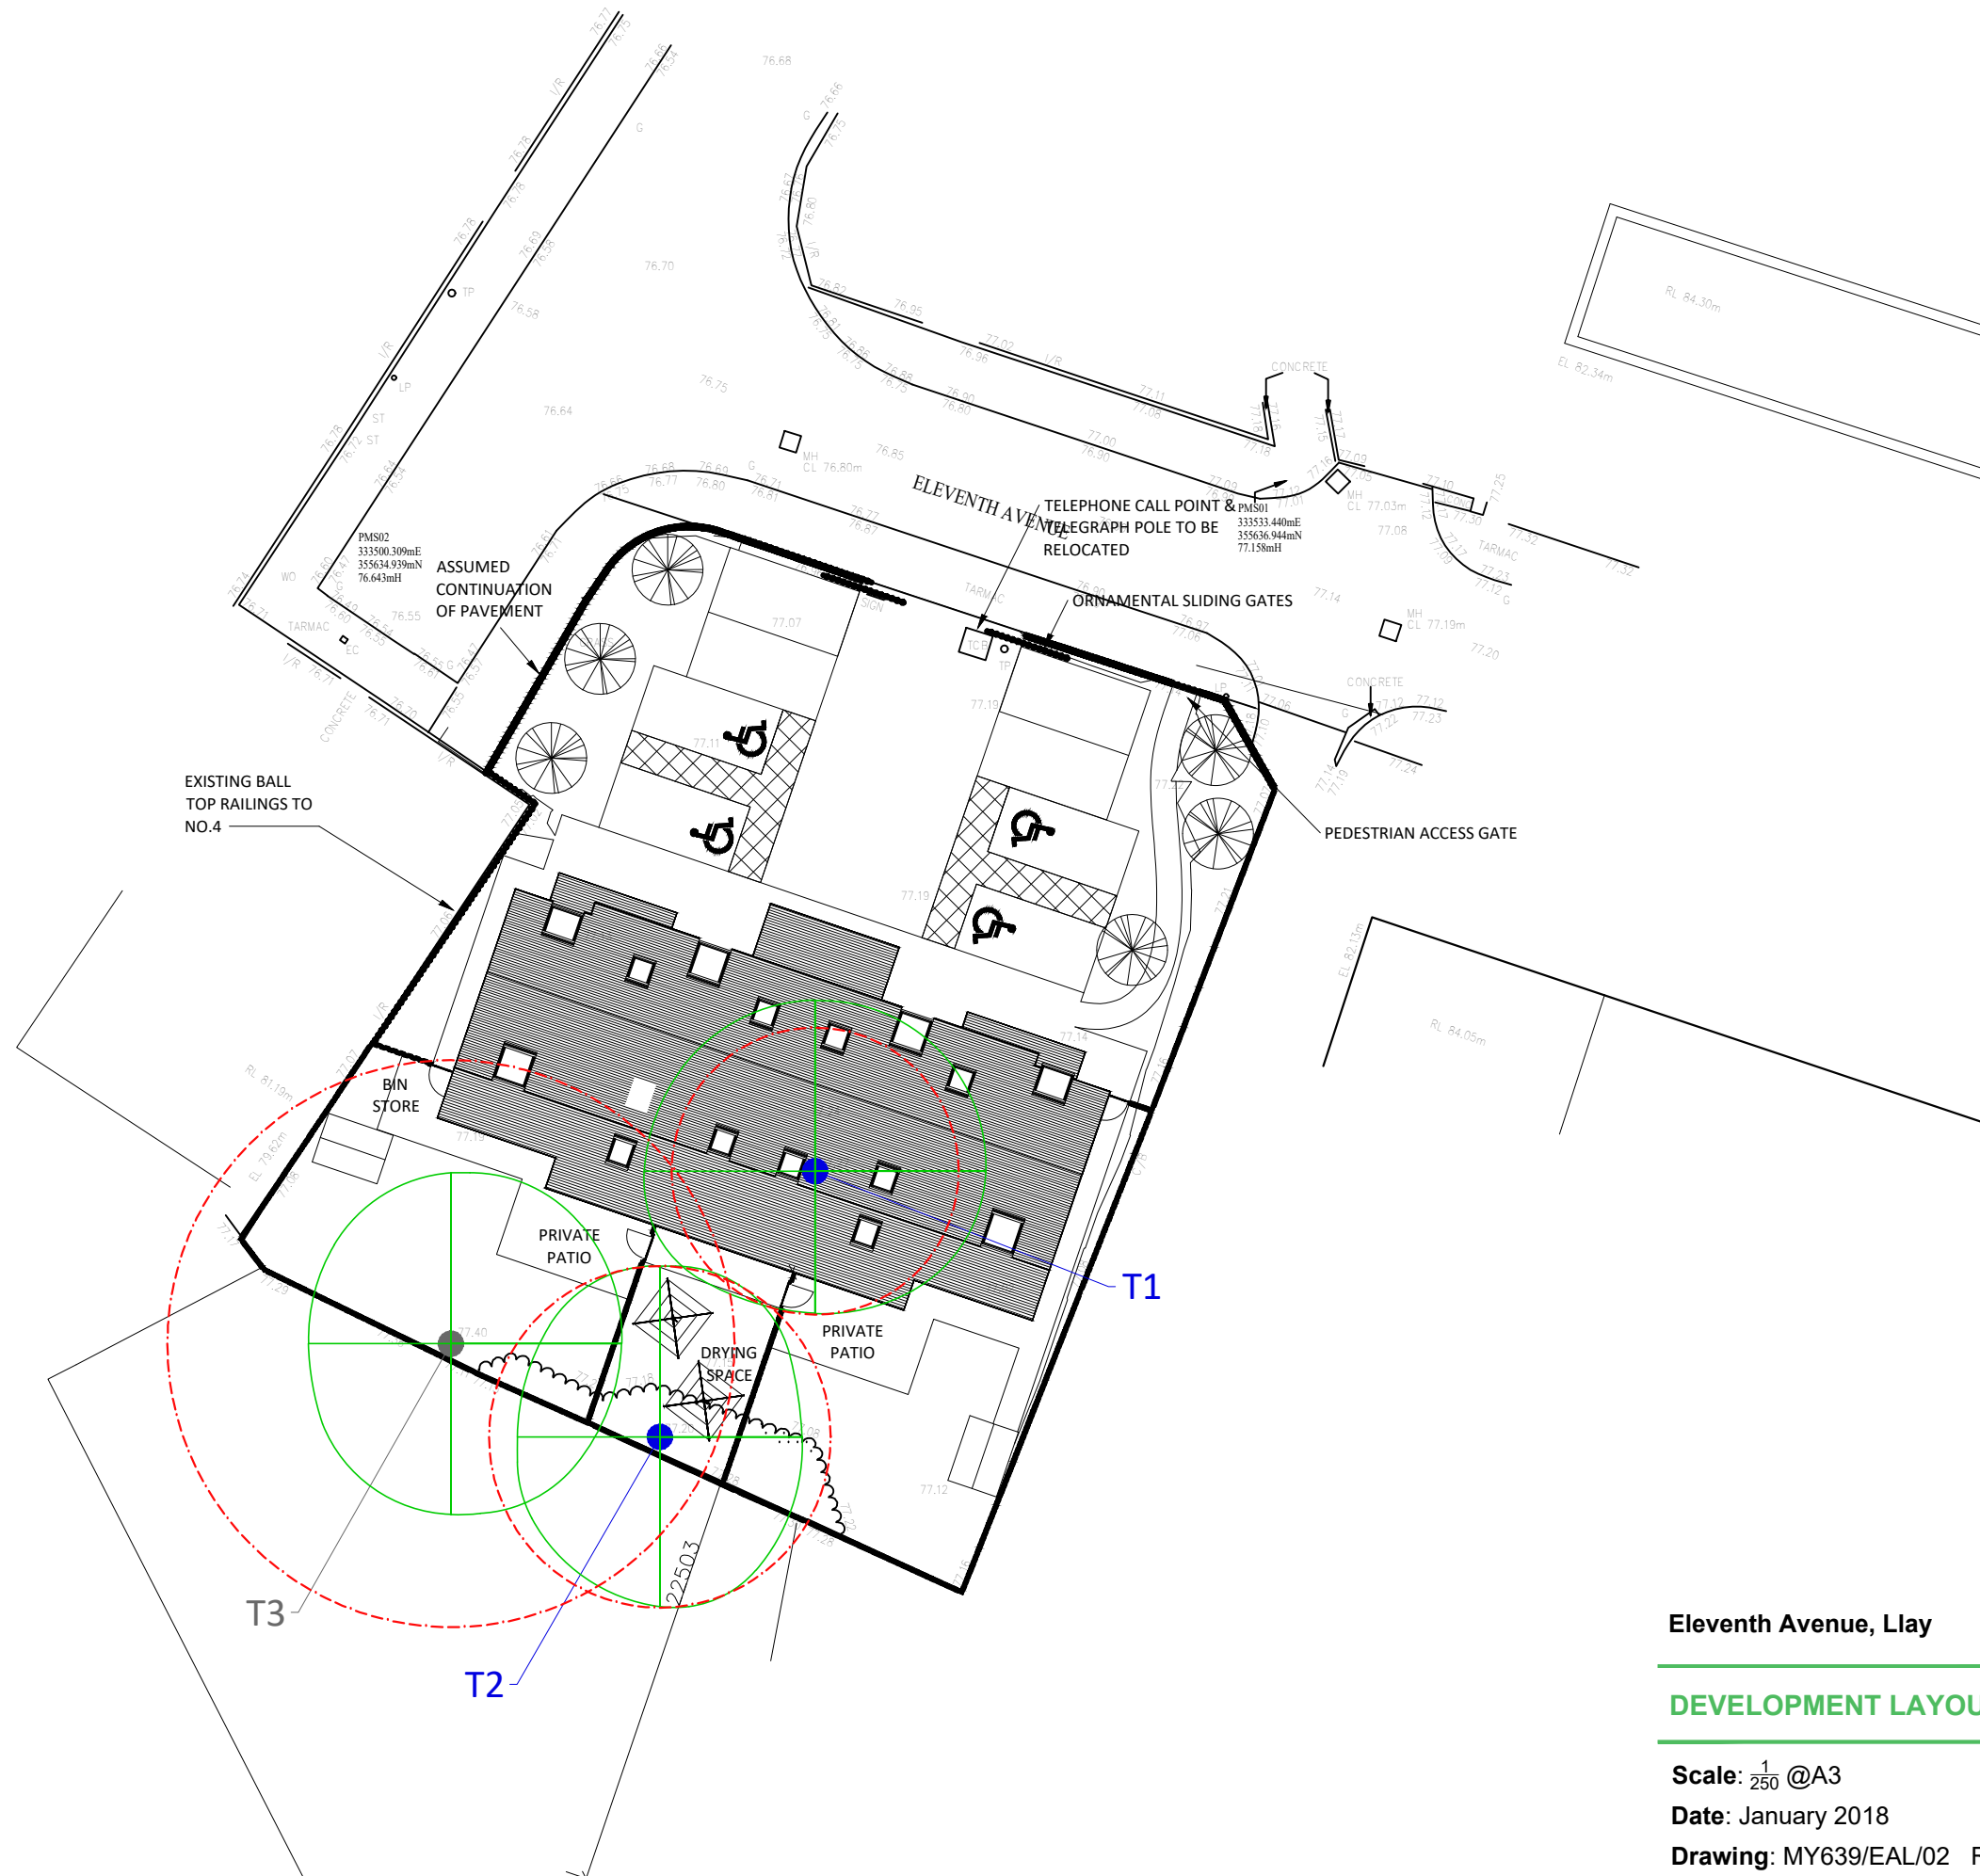

Eleventh Avenue, Llay

## DEVELOPMENT LAYOUT PLAN

Scale:  $\frac{1}{250}$  @A3


Date: January 2018

Drawing: MY639/EAL/02 REV -



KEY

- REPLACEMENT TREE LOCATION
- 3x PcC- Pyrus calleryana Chanticleer
- 3x SaJR- Sorbus aucuparia Joseph Rock
- 2x Mt- Malus tschonoskii
- 3x CiPS- Crataegus laevigata Paul's Scarlet

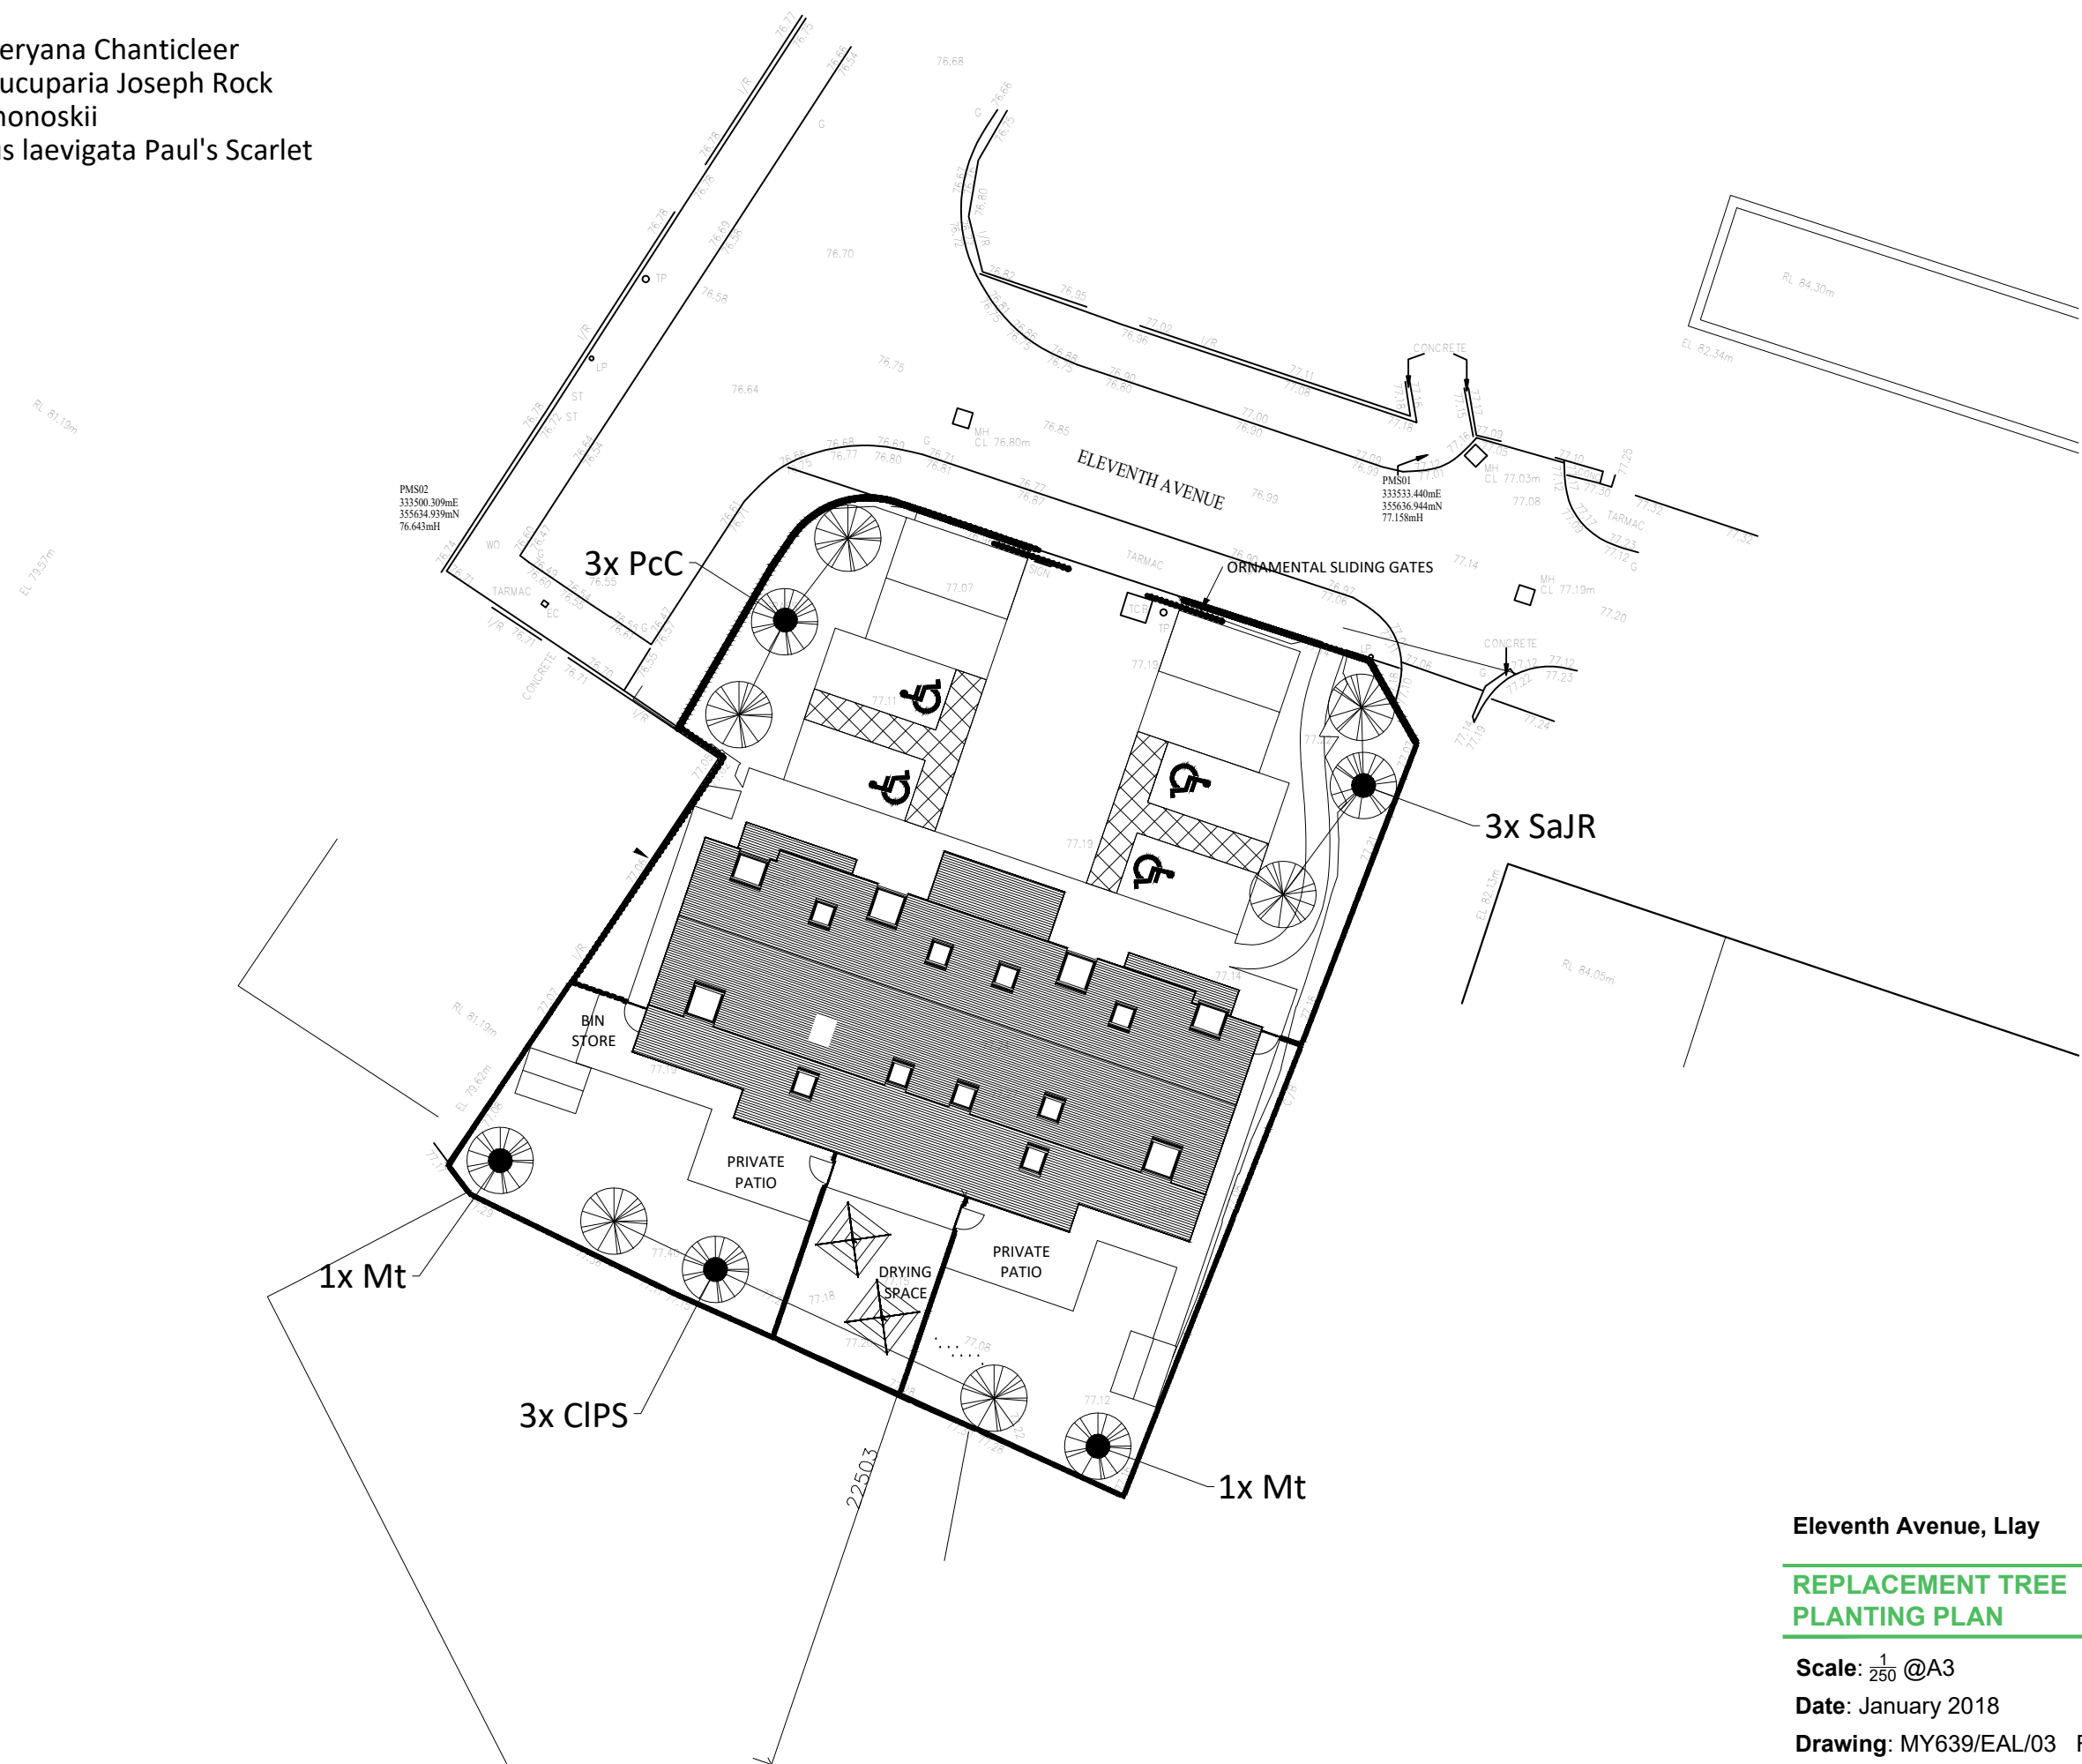

Eleventh Avenue, Llay

REPLACEMENT TREE  
PLANTING PLAN

Scale:  $\frac{1}{250}$  @A3  
Date: January 2018  
Drawing: MY639/EAL/03 REV -

