






300mm

200mm


100mm

50mm

0 10mm

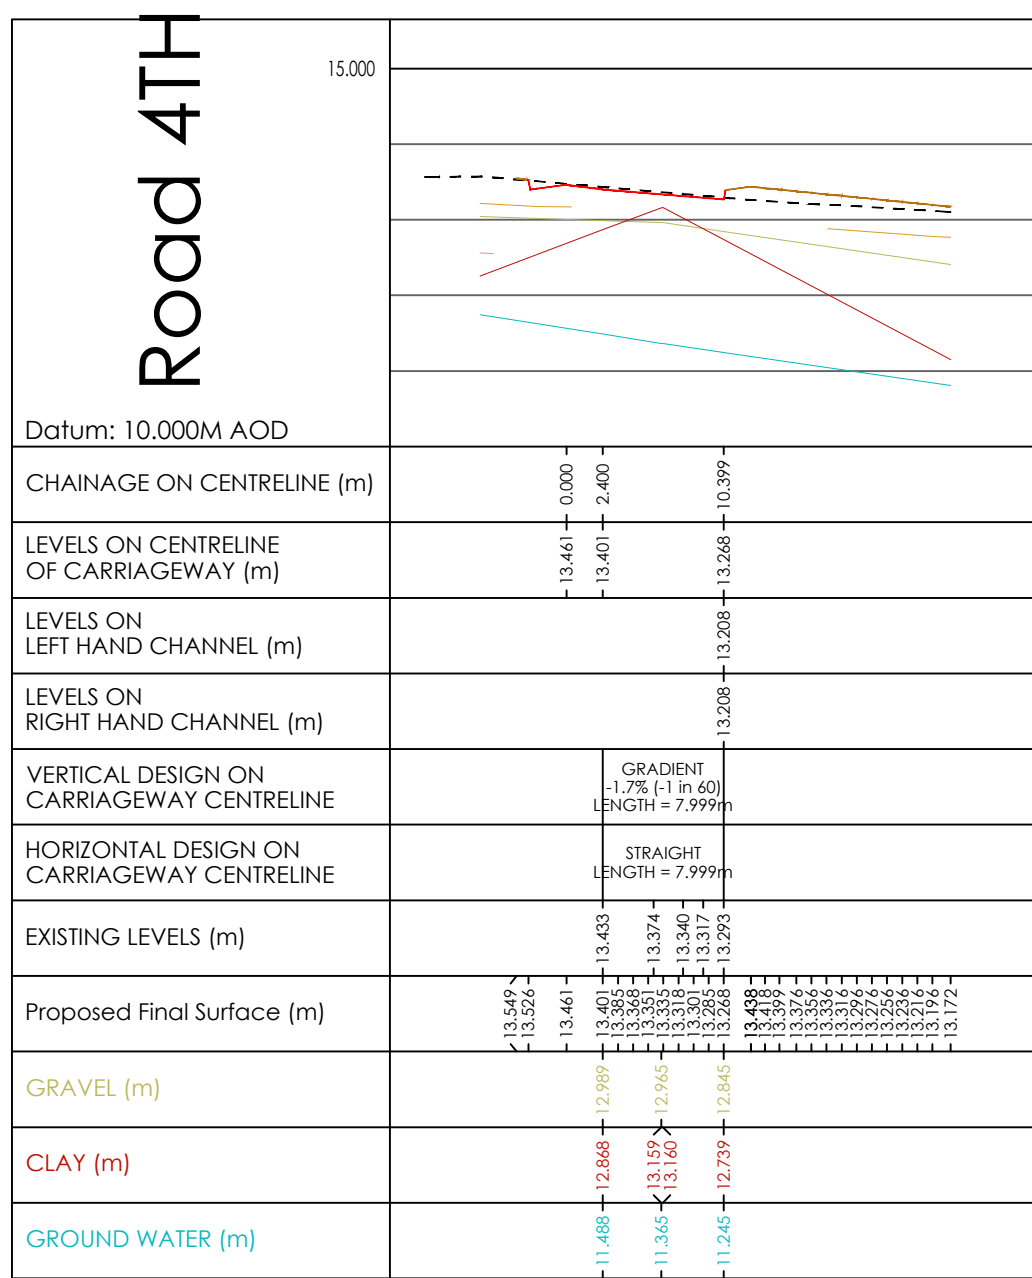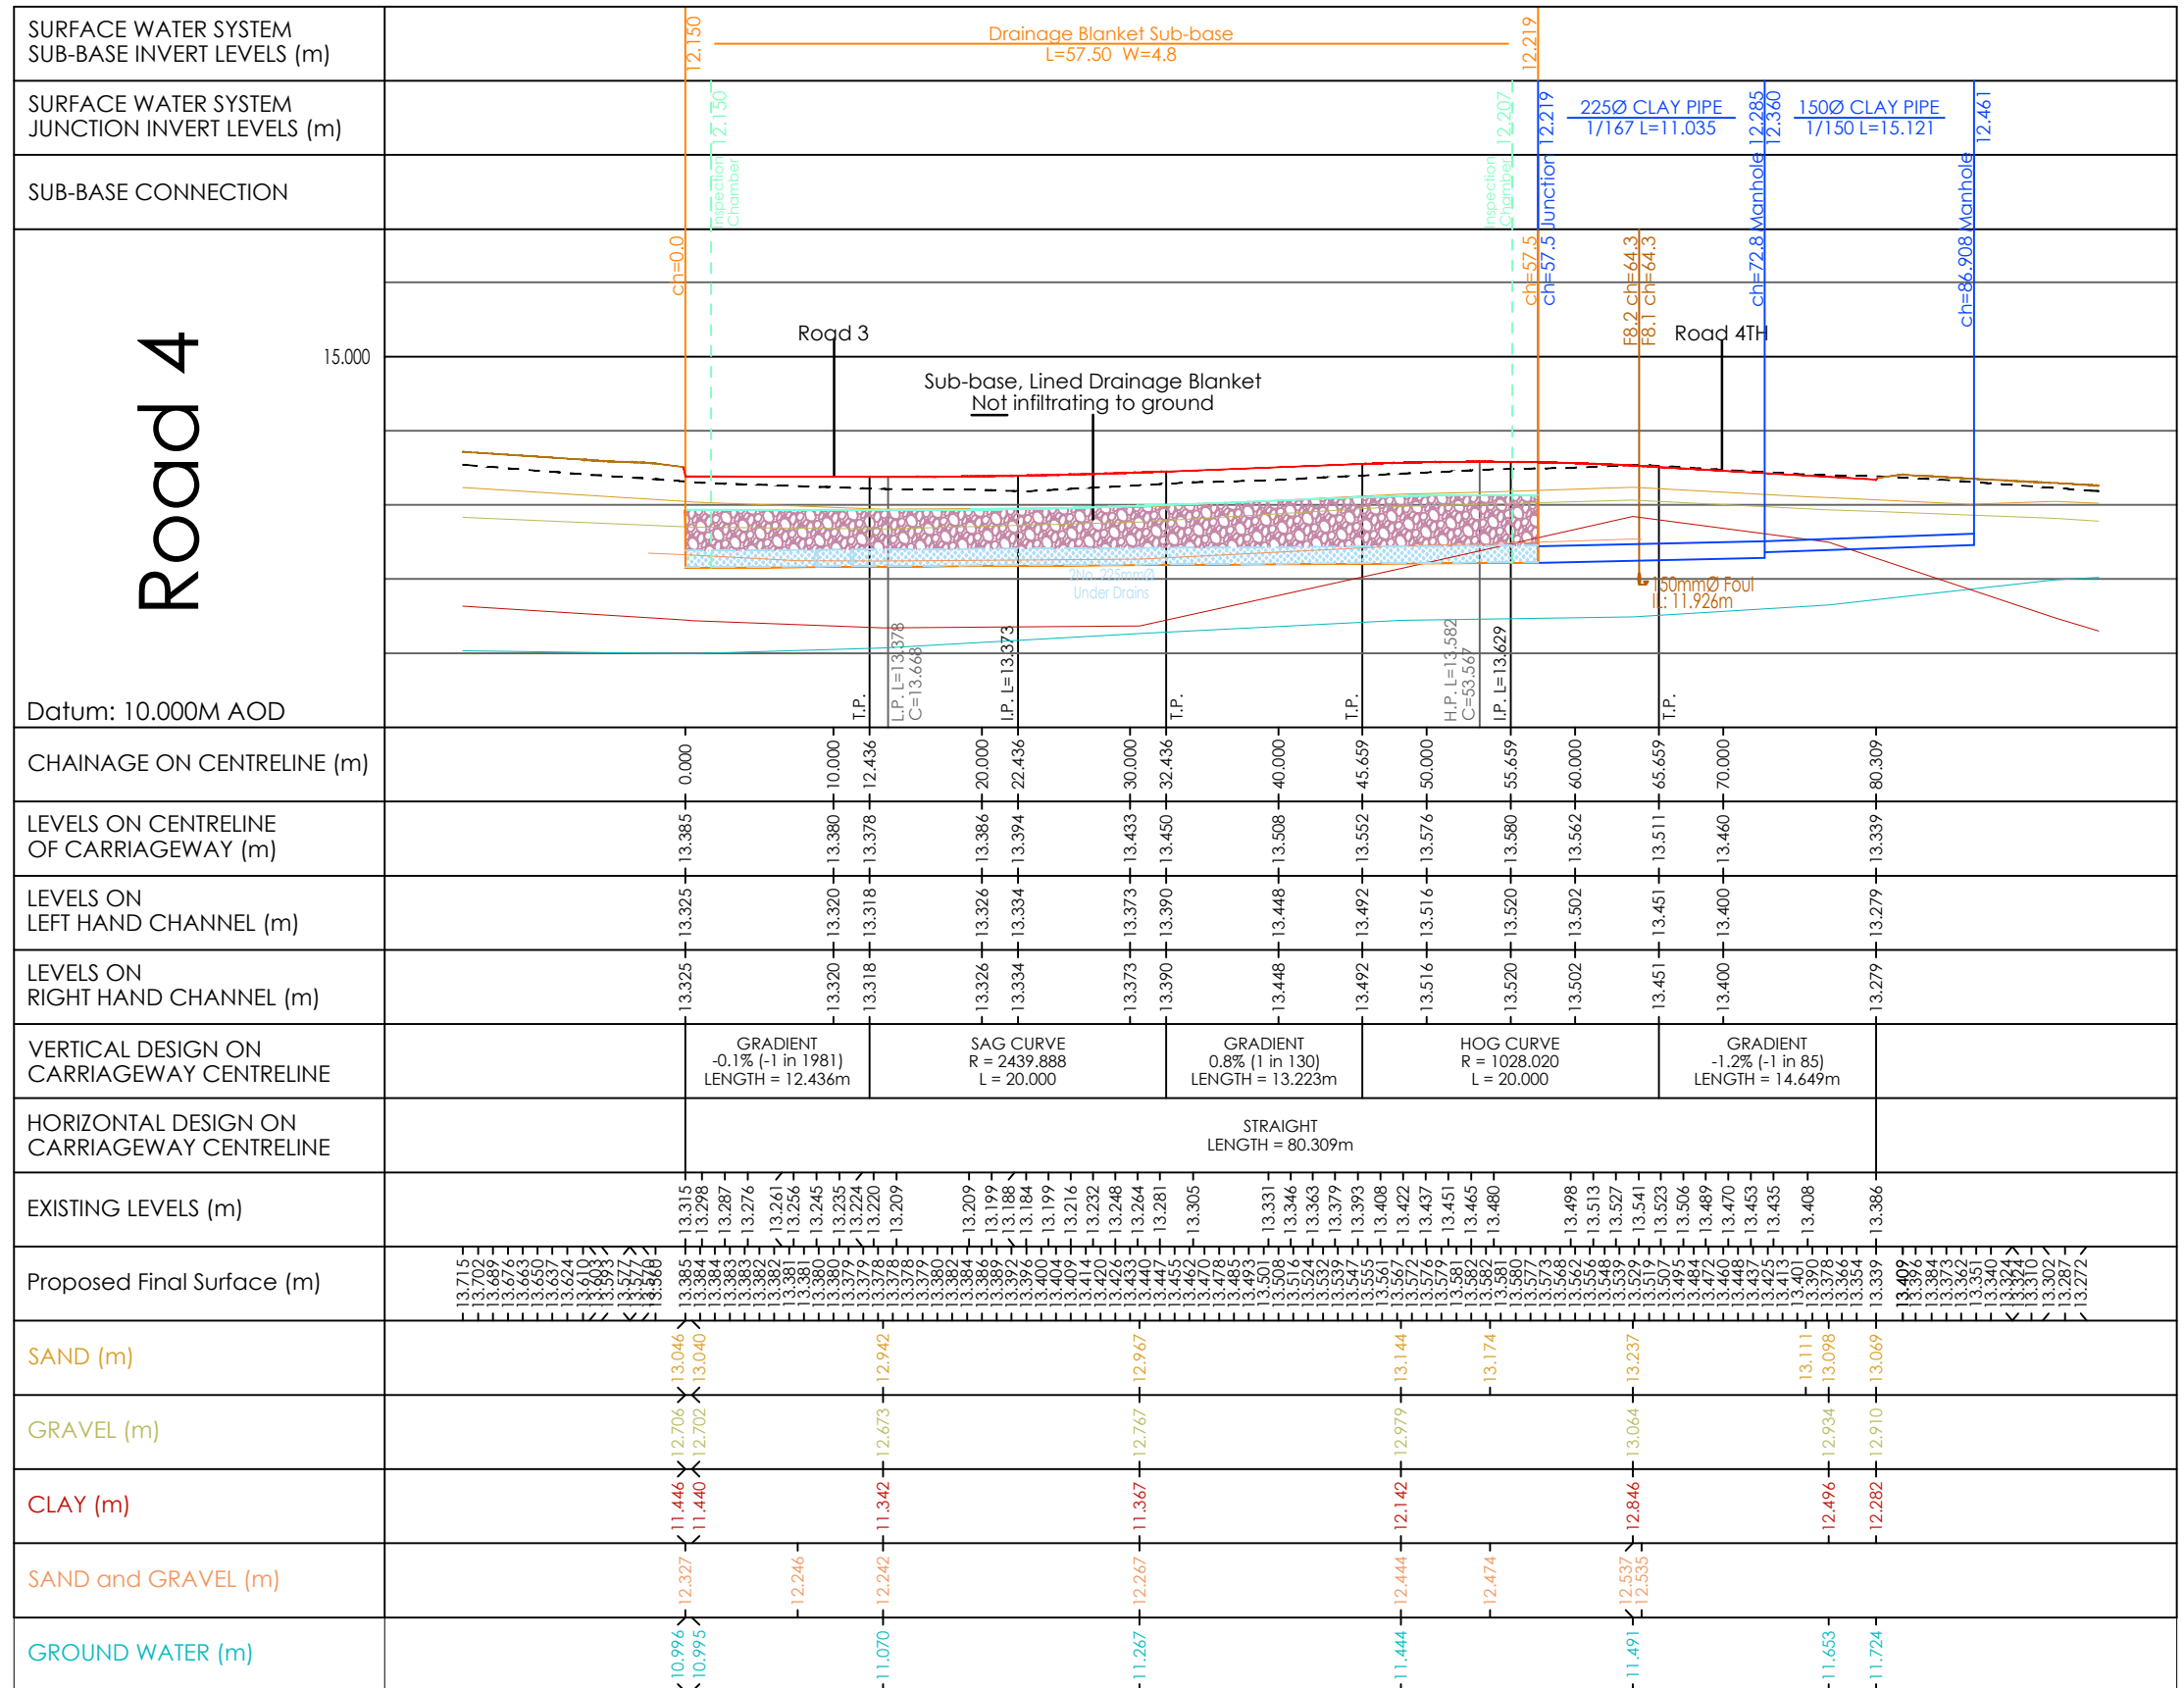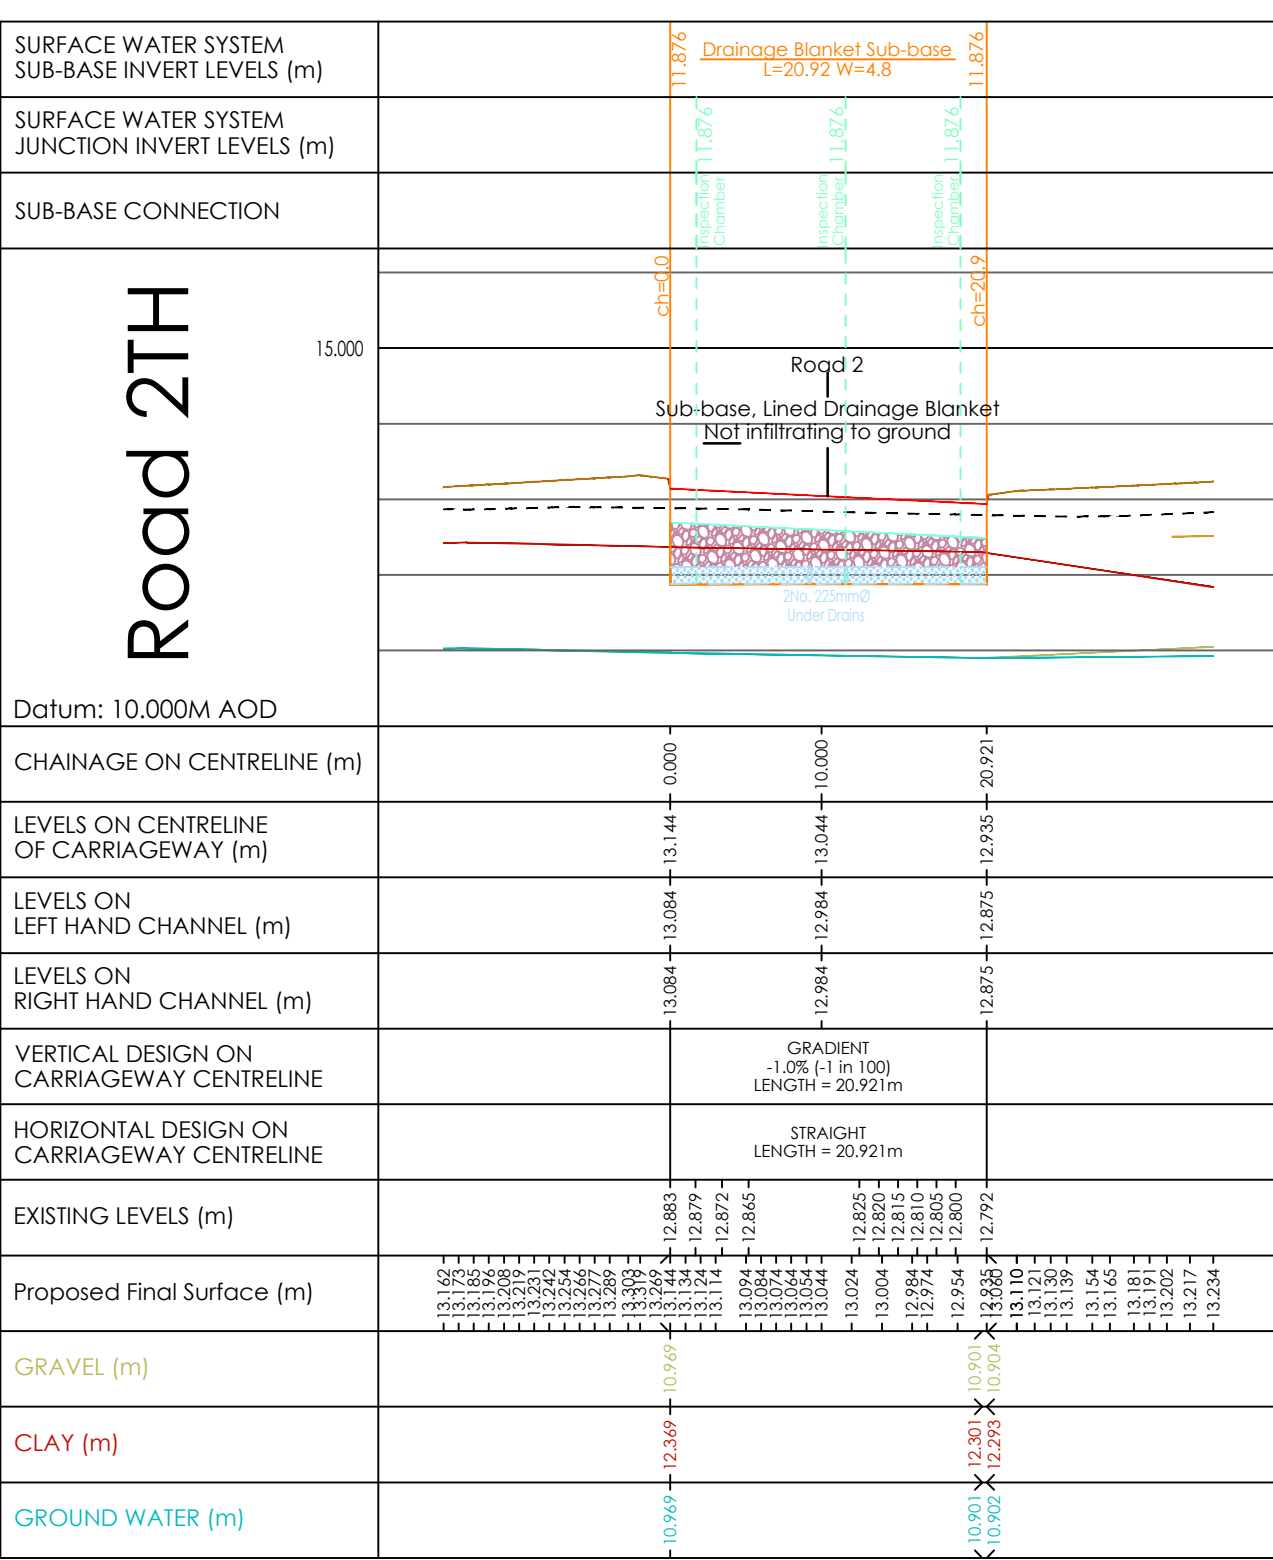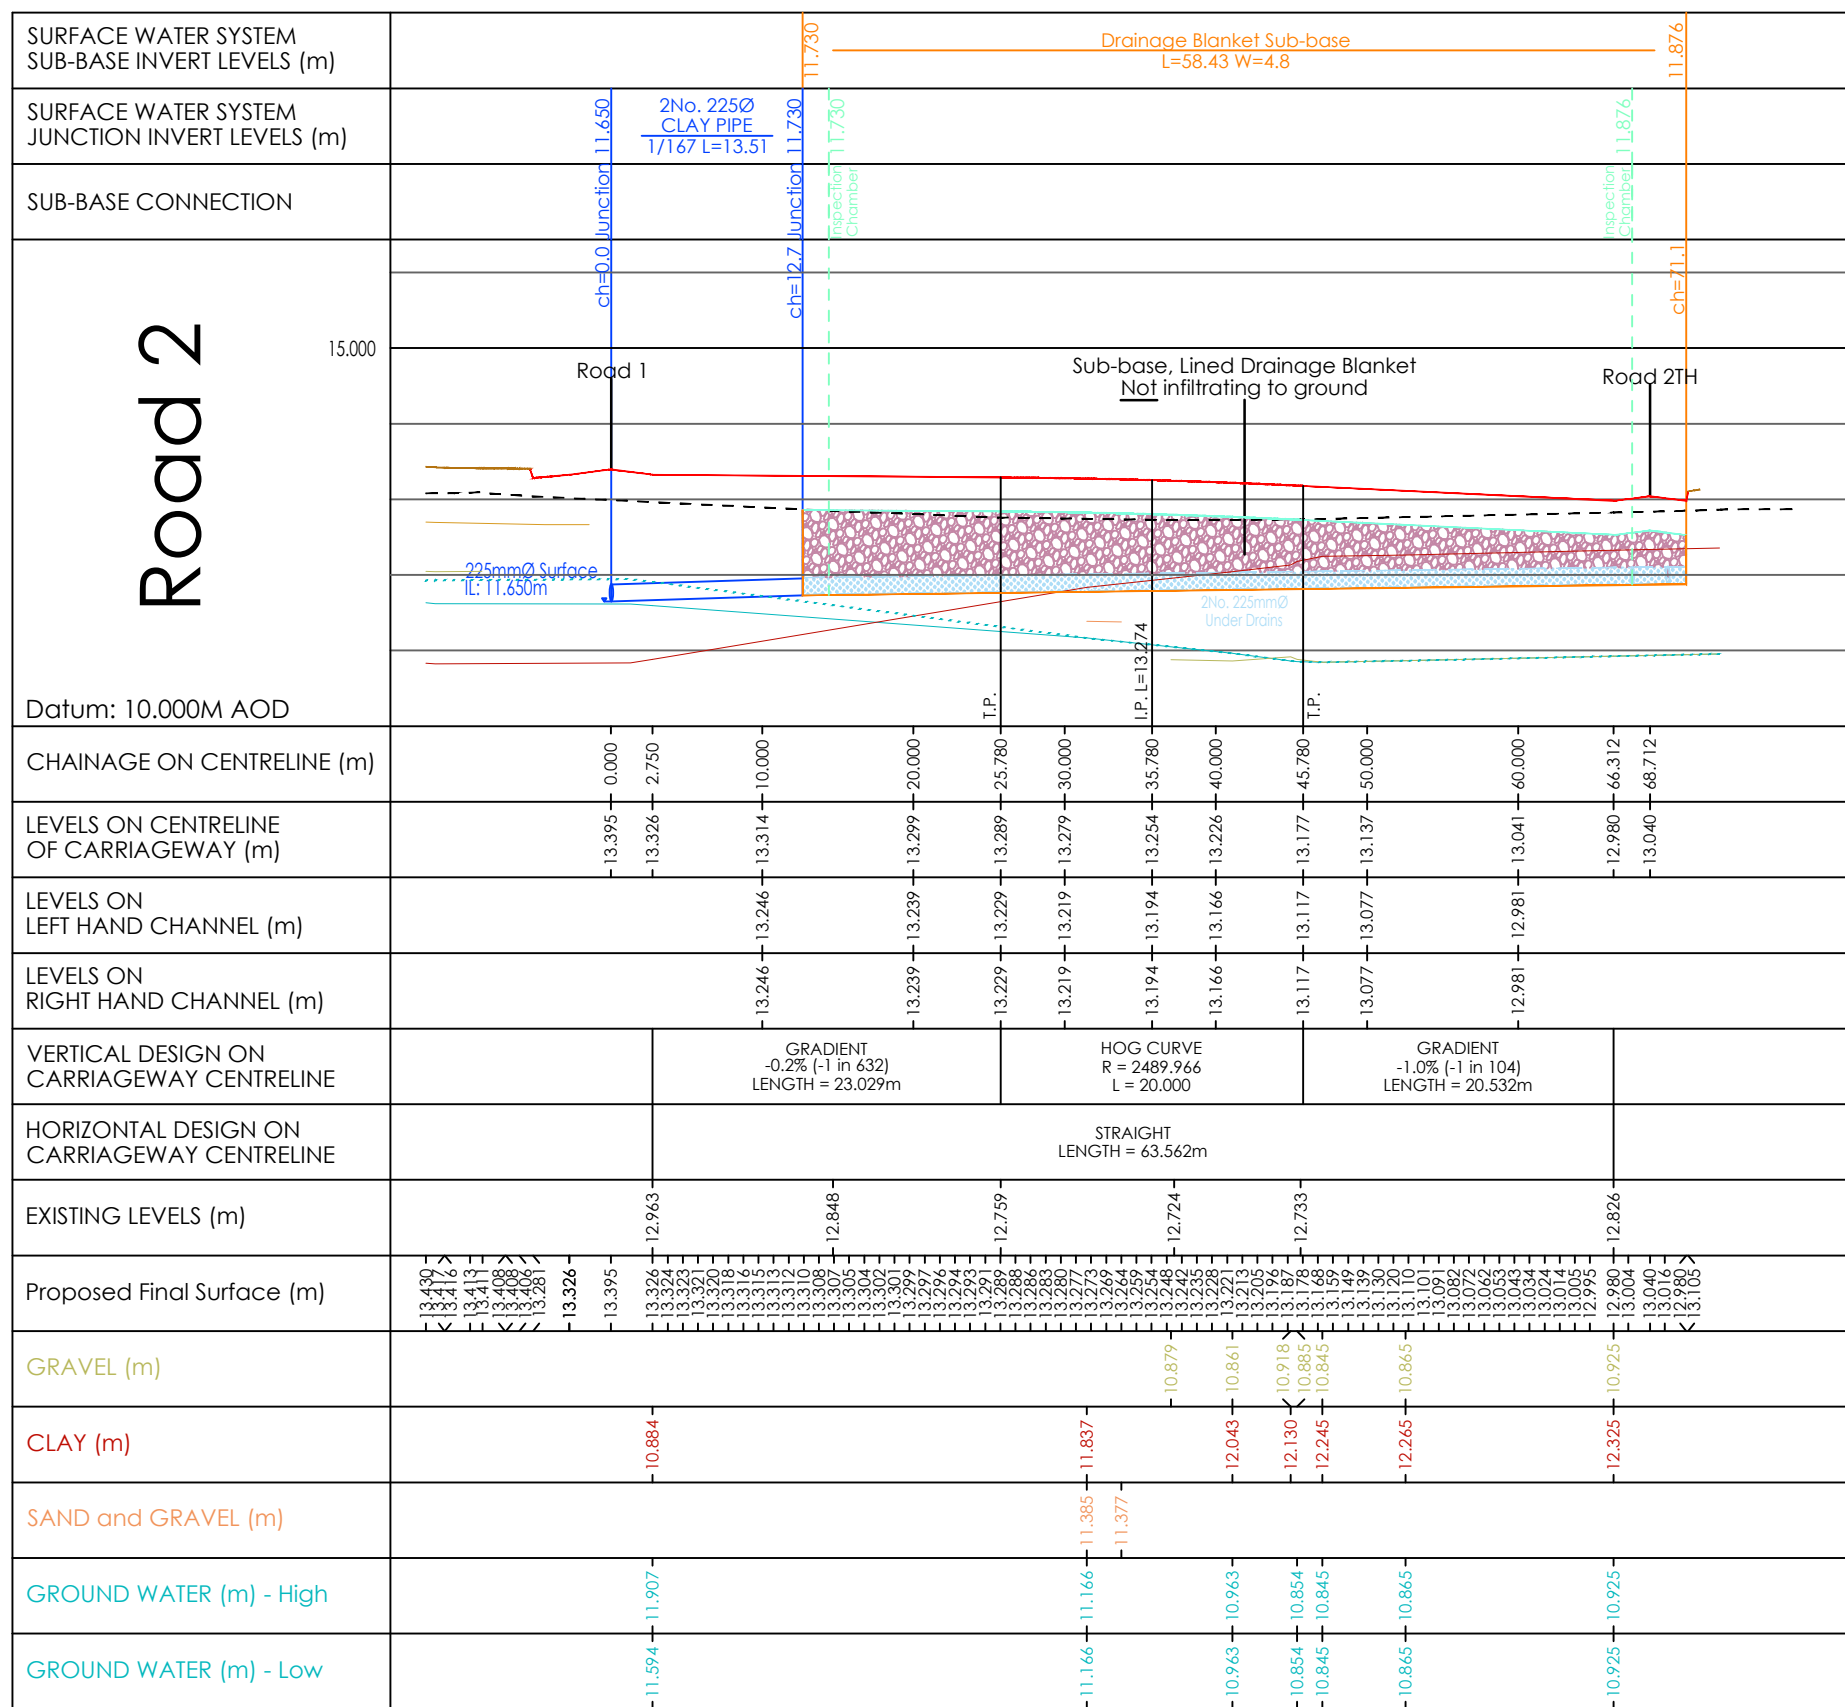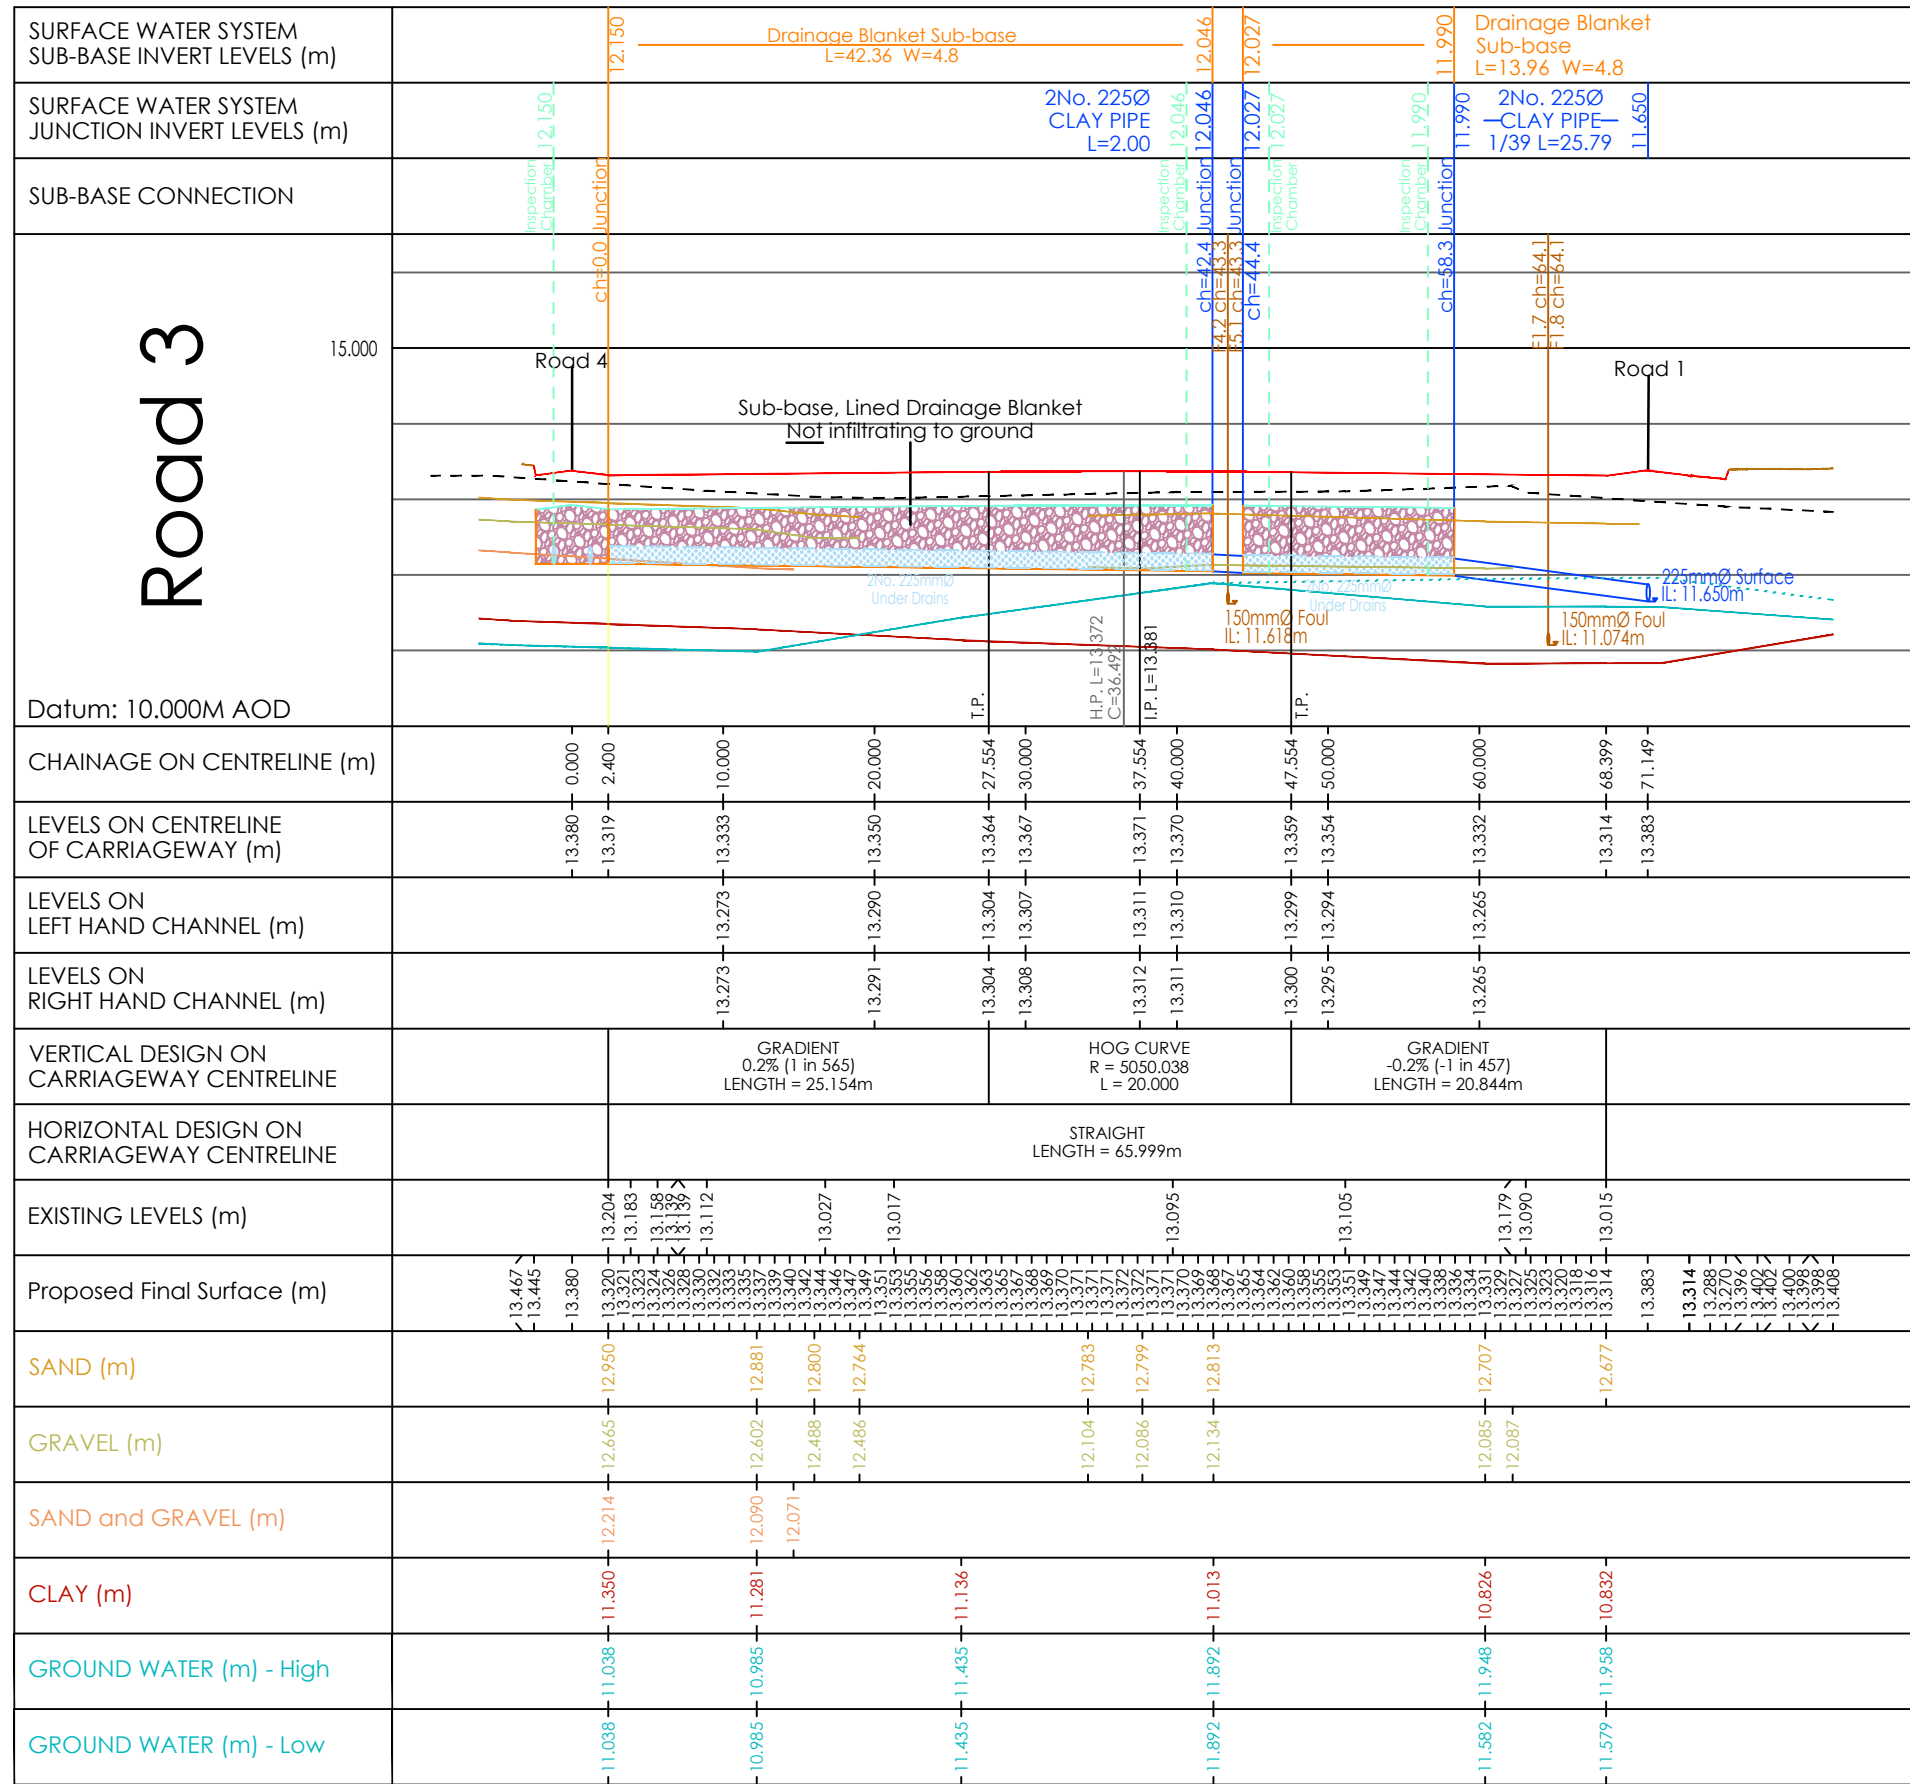

Ground Water Monitoring - Dec 2021 to Dec 2022							
Ref.	Date Well Monitored						
	20/12/2021	06/01/2022	23/02/2022	14/04/2022	23/05/2022	18/07/2022	23/09/2022
WS1	0.500	0.45	0.7	0.75	0.92	1.2 (dry)	1.25 (dry)
WS2	0.600	0.85	1.0	1.05	1.2	1.6 (dry)	1.0
WS3	0.700	0.700	0.850	0.950	1.050	-	-
WS4	(dry)	1.600	1.200	1.200	(dry)	-	1.2 (dry)
WS5	1	1.25	1.45	1.2	-	-	1.2
WS6	1.900	1.1	1.25	1.4	1.6	2.1	1.9

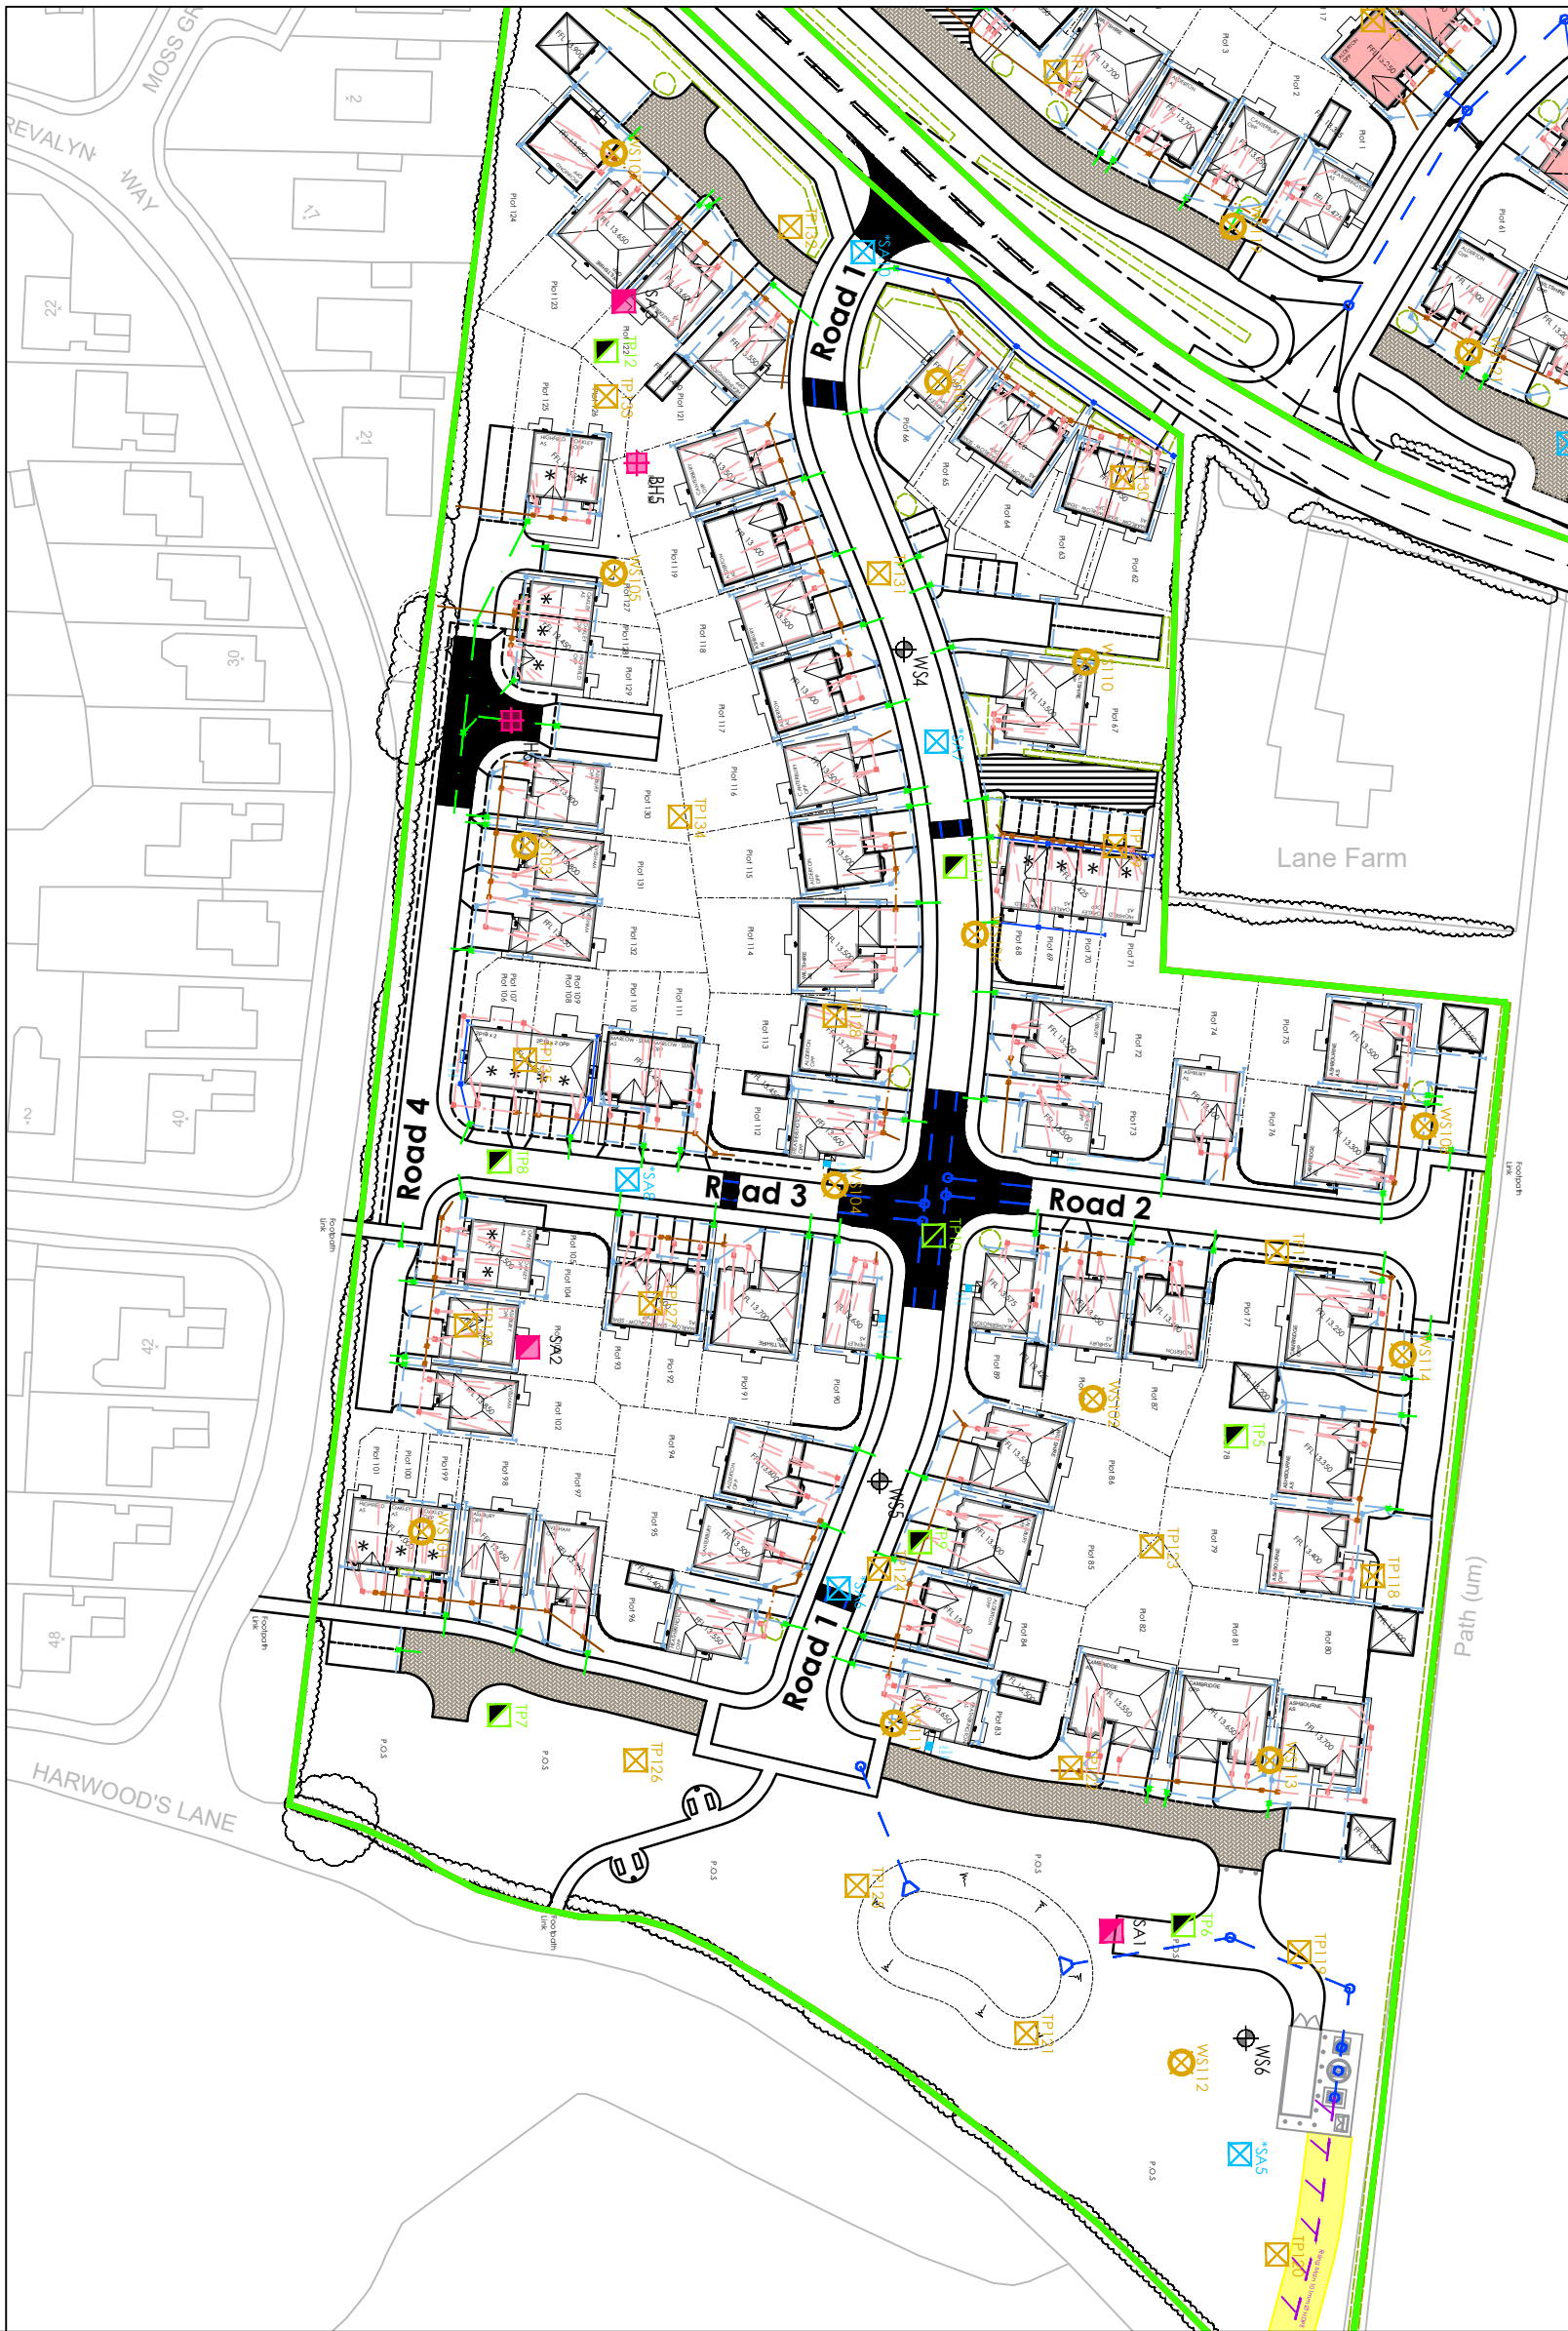

F	28.11.23	Inspection chambers shown at start and end of underdrains, for inspection & maintenance	CP
E	14.08.23	SAB design amended & updated with Layout Rev HCP	CP
D	12.06.23	Sub-Strata & Ground Water levels reviewed	CP
C	15.02.23	Updated for SAB Issue	CP
B	20.08.21	Longsections updated	GW
A	03.08.21	First issue for \$104 review and comment	CP

Mark	Date	Details	By
------	------	---------	----

Revision history	
------------------	--



Client:



Project title:
**Rossett Road,
Rossett**

Drawing title:
**Southern Land Parcel
Road & SuD's Longsections
Sheet 2 of 2**

Scale: 1:500H, 1:50V for the original size of A1

Drawn by: CP | Checked by: RA | Passed by: RA | Date: July 2021

Drawing status: Preliminary

Job No:	Drawing No:	Project	Origin.	Volume	Level	Type	Discip.	Number	Revision:
CAS02	BET						C	114	F

Do not scale this drawing
6-7 Old Marsh Farm Barns, Welsh Road, Sealand, Flintshire, CH5 2LJ
enquiries@betts-associates.co.uk

Chester 01244 288178 | Altrincham 0161 413531 |