


Carter Jonas
Ruabon Park, Wrexham
Phase 2 Preliminary Geoenvironmental Assessment Report

Document Ref: 773135-REP-ENV-002
Revision: 0
Date: 27 November 2015

Prepared: Michael Maynard
Geoenvironmental Engineer



Checked: Hugh Dyer
Senior Geoenvironmental
Engineer



Approved: Jason Monk
Technical Director



Document Control Sheet

Revision No	Date	Status	Changes	Author	Approved
0	27 November 2015	Final	-	M. Maynard	J. Monk



Contents

	Page
Executive Summary	i
Limitations and Exceptions	iii
1 Introduction	1
1.1 General	1
1.2 Terms of Reference	1
1.3 Technical Approach	1
1.4 Proposed Development	1
2 The Site	2
2.1 Location and Description	2
2.2 Geology	2
2.3 Hydrogeology	2
2.4 Hydrology	3
3 Ground Investigation	4
3.1 Site Work	4
3.2 Investigation Rationale	4
3.3 Installations	4
3.4 In Situ Testing	5
3.5 Sampling	5
3.6 Post-Fieldwork Monitoring	5
3.7 Laboratory Analysis	5
4 Ground and Groundwater Conditions	7
4.1 General	7
4.2 Topsoil	7
4.3 Made Ground	7
4.4 Glacial Till	7
4.5 Glacio-fluvial Deposits	8
4.6 Etruria Formation	8
4.7 Groundwater Conditions	8
4.8 Contamination Observations	8
4.9 Ground Gas and Vapour Conditions	8
4.10 Underground Obstructions	9
5 Material Properties	10
5.1 General	10
5.2 Made Ground	10
5.3 Glacial Till	10
5.4 Glacio-fluvial Deposits	10
5.5 Etruria Formation	10
5.6 Summary	11
6 Geotechnical Assessment	12
6.1 General	12
6.2 Existing Buried Construction	12
6.3 Excavations	12
6.4 Foundations	13
6.5 Ground Floor Slabs	14
6.6 Pavement Construction	14
6.7 Below Ground Concrete Design	15
6.8 Soakaway Potential	15
6.9 Reuse of Materials	15

7	Assessment of Soil Chemical Data	16
7.1	Guidelines	16
7.2	Risks to Human Health	16
7.3	Risks to Water Supply	17
7.4	Risks to Plant Life	17
8	Assessment of Soil Leachate and Groundwater Chemical Data	18
8.1	Guidelines	18
8.2	Groundwater	18
9	Assessment of Ground Gas and Organic Vapour Data	19
9.1	Guidelines	19
9.2	Screening Assessment – Ground Gas	19
9.3	Screening Assessment – Organic Vapour	19
9.4	Nature and Distribution of Ground Gas and Organic Vapour Contamination	19
10	Contaminated Land Risk Assessment and Conceptual Site Model	20
10.1	General Approach	20
10.2	Identified Contamination Sources	20
10.3	Potential Exposure Pathways	21
10.4	Phase 2 Updated Conceptual Model	22
11	Remediation and Risk Management	24
11.1	General	24
11.2	Soil Remediation	24
11.3	Groundwater Remediation	24
11.4	Gas and Organic Vapour Protection	24
11.5	Off Site Disposal	24
11.6	Remediation Documentation	25
11.7	Construction Health and Safety	25
11.8	Land Remediation Relief	25
12	Summary and Recommendations	26
12.1	Geotechnical	26
12.2	Contamination	26
12.3	Further Work	27
13	References	28

Figures

Figure 1: Site Location Plan

Drawings

773135-DWG-ENV-001 Exploratory hole location plan

Appendices

- Appendix A: Exploratory Hole Logs
- Appendix B: Gas and Groundwater Monitoring Results
- Appendix C: Geotechnical Test Results
- Appendix D: Results of Chemical Analysis
- Appendix E: Soakaway Test Results
- Appendix F: Generic Assessment Criteria
- Appendix G: Risk Definitions

Executive Summary

Details	Summary of Main Text
Introduction	This report has been prepared on the instructions of Carter Jonas which proposes to market the site on behalf of their client, for mixed industrial and residential purposes. It presents the results of a preliminary ground investigation and geoenvironmental assessment.
Site description	The 24.62 acre site consists of farmland.
Environmental Setting	The site is underlain by Glaciofluvial Sand and Gravel within the north east section of the site and Glacial Till beneath the remaining areas of the site. The majority of the site is underlain by strata of the Etruria Formation with a small section along the western edge of the site underlain by Pennine Coal Measures strata. The site is not within a groundwater source protection zone. A large pond is located in the centre of the site. The site is bordered to the east by James Caravan Park with the A483 and fields beyond this, to the North by the A539 with residential properties beyond, to the West by Clwyd Caravan & Leisure with the B5605 beyond and to the South by farmland.
Ground Investigation	
Ground Conditions Encountered	Topsoil (maximum proven depth 0.50m bgl) Made Ground (maximum proven depth 1.10m bgl) Glacial Till (maximum proven depth 4.50m bgl) Glaciofluvial Deposits (maximum proven depth 3.40m bgl) Etruria Formation (maximum proven depth 5.00m bgl)
Groundwater	Encountered at between 2.30m and 4.50m bgl during the investigation. Recorded post-fieldwork at depths ranging from 1.64m to 3.40m bgl.
Geotechnical Assessment	
Existing Construction	There is a possible section of partially constructed road within the north of the site although this was not noted during the site investigation works. Unless it is to be incorporated within the new development, any old construction encountered should be fully penetrated by all new foundations and broken well away from any new construction.
Excavations	Excavation to proposed founding depth generally should be readily achievable with standard excavation plant.
Foundations	The preliminary investigation indicates that the following foundation options would be suitable for the site, however these would need to be confirmed following further deeper investigations; Strip/trench fill foundations at between 1.0m bgl and 1.5m bgl. Pad foundations at between 1.0m bgl and 1.5m bgl. Net allowable bearing pressure – 100kN/m² (all soils). Deepening of foundations/heave protection is likely to be required to allow for the effects of trees.
Ground Floors	Slab-on-ground or suspended/constructed on granular fill in clay areas due to risk of swelling and shrinkage
Pavements	CBR values should be confirmed by in-situ testing, however a design CBR value of 2% may be assumed within the made ground materials and natural clay soils. A CBR value of 5% is considered appropriate for the sands and gravels.
Soakaways	Soakaway drainage may be suitable within the north east of the site within the sand and gravel materials, however this would need to be confirmed.
Buried Concrete	Design Sulphate Class – DS - 1 and ACEC Class – AC – 1.

Details	Summary of Main Text
Contamination	
Soil Contamination	Soil contamination was not present with respect to human health for the proposed mixed residential and commercial development.
Gas/Vapour Contamination	Slightly elevated levels of carbon dioxide were noted. Based on these isolated elevated levels the site is designated CIRIA Characteristic 2/NHBC Amber 1
Remediation	Possible incorporation of gas protective measures within new construction at the site. Incorporation of radon protective measures within new construction at the site.
Further Work	
	A tree survey is required prior to site clearance, to determine the potential influence of trees on and adjacent to the site. Further gas and groundwater monitoring to better define and delineate the ground gas regime. Further deeper boreholes across the site area to confirm the findings of the site investigation and to determine the characteristics of the deeper ground conditions and to confirm the foundation design for the development.

Limitations and Exceptions

- 1 This report and its findings should be considered in relation to the terms and conditions proposed and scope of works agreed between MLM Consulting Engineers Ltd (MLMCEL) and the client.
- 2 The Executive Summary, Conclusions and Recommendations sections of the report provide an overview and guidance only and should not be specifically relied upon until considered in the context of the whole report and the development, if any, proposed.
- 3 The assessment and interpretation of contamination and associated risks are based on the scope of work agreed with the client and the report may not be sufficient to fully address contaminations or to allow detailed remediation design to proceed without further investigation and analysis.
- 4 Any assessments made in this report are based on the ground conditions as revealed by the exploratory holes and pits, together with the results of any field or laboratory testing undertaken and, where appropriate, other relevant data which may have been obtained for the sites including previous site investigation reports. There may be special conditions appertaining to the site, however, which have not been revealed by the investigation and which have not, therefore, been taken into account in the report. The assessment may be subject to amendment in the light of additional information becoming available.
- 5 Interpretations and recommendations contained in the report represent our professional opinions, which were arrived at in accordance with currently accepted industry practices at the time of reporting and based on current legislation in force at that time.
- 6 Where the data available from previous site investigation reports, supplied by the Client, have been used, it has been assumed that the information is correct. No responsibility can be accepted by MLMCEL for inaccuracies within the data supplied.
- 7 Whilst the report may express an opinion of possible configuration of strata between or beyond exploratory hole or pit locations, or on the possible presence of features based on visual, verbal or published evidence, this is for guidance only and no liability can be accepted for the accuracy.
- 8 Comments on groundwater conditions are based on observations made at the time of the investigation unless otherwise stated. It should be noted that groundwater levels can vary due to seasonal or other effects.
- 9 The copyright in this report and other plans and documents prepared by MLMCEL is owned by them and no such report, plan or document may be reproduced, published or adapted without their written consent. Complete copies of this report may, however, be made and distributed by the Client as an expedient in dealing with matters related to its commission.
- 10 This report is prepared and written in the context of the proposals stated in the introduction to this report and should not be used in a differing context. Furthermore, new information, improved practices and legislation may necessitate an alteration to the report in whole or in part after its submission. Therefore, with any change in circumstances or after the expiry of one year from the date of the report, the report should be referred to us for re-assessment and, if necessary, re-appraisal.

1 Introduction

1.1 General

This report has been prepared by MLM Consulting Engineers Limited (MLMCEL) on the instructions of Carter Jonas (Client), which is proposing to market the site on behalf of their client, for mixed use including residential and commercial development.

The objective of this report is to provide an initial assessment of ground conditions with respect to design of foundations, slabs and infrastructure and gives general recommendations for appropriate solutions. It also includes a preliminary generic quantitative risk assessment (GQRA) of contamination risks to human health and the environment and provides, where necessary, a summary of recommended mitigation or remediation measures.

This report has been prepared to provide details for marketing of the site and to outline potential constraints to development at the site which may require further investigation and assessment prior to development.

1.2 Terms of Reference

The terms of reference for the work were set out in the MLMCEL proposal 773135-FEE-ENV-001 dated 22 July 2015.

1.3 Technical Approach

The work undertaken by MLMCEL follows the Association of Geotechnical and Geoenvironmental Specialists (AGS) *Good Practice Guidelines for Site Investigations*.

The process of contamination assessment adopted in this report generally follows the model procedures for the management of contaminated land described in the Environment Agency Contaminated Land Report 11. It also takes into account the guidance issued in the National Planning Policy Framework (NPPF) and NHBC Standards Chapter 4.1 *Land quality: Managing ground conditions*.

The format of the report is in general accordance with the reporting requirements of BS5930:2015.

1.4 Proposed Development

It is understood that the proposed development will comprise 139,500 sq ft of office space, 50,000 sq ft of warehouse, 20,000 sq ft of retail, 30,000 sq ft of leisure and/or hotel use, and 319 residential units.

2 The Site

2.1 Location and Description

The site is located in Ruabon Park, Wrexham, LL14 3EH. The National Grid Reference for the site is 329736 343226.

It is irregular in shape and covers an area of 24.62 hectares. The site currently consists of farmland. No hardstanding was noted across the fields at the time of the ground investigation works. A large lake is located within the centre of the site with a small brook feeding the lake from the north. Ditches are present along the southern boundary of the site.

Aerial photography indicates a small section of possible road construction within the north of the site, however this was not noted during the walk over survey or site investigation works.

The site is bordered to the East by James Caravan Park with the A483 and fields beyond this, to the North by the A539 with residential properties beyond, to the west by Clwyd Caravan & Leisure with the B5605 beyond and to the south by farmland.

A location plan of the site is presented as Figure 1.

2.2 Geology

Published geology is of Glacio-fluvial deposits within the north east of the site and Glacial Till deposits across the central and south west section of the site overlying the Etruria Formation (mudstone) recorded below the majority of the site, with the Pennine Lower Coal Measures Formation recorded beneath the western edge of the site.

The site is in a known mining area, with one historical mine indicated on site in the Groundsure Report. However, no evidence of mine workings or made ground associated with mine workings were encountered during the site investigation.

The site is in an area affected by radon as between 10% and 30% of properties are above the Action Level. Full radon protective measures are necessary.

The site is shown to lie in an area unaffected by historical landslips.

2.3 Hydrogeology

The Environment Agency website provides the following hydrogeological information:

Table 2.1 Aquifer Properties

Aspect	Designation	Description
Groundwater Source Protection Zone	No SPZ	The site is not within a catchment area where groundwater is discharged to a source.
Superficial Aquifer Designation Glacio-fluvial deposits	Secondary Aquifer (A)	Permeable layers capable of supporting water supplies at a local rather than strategic scale, and in some cases forming an important source of base flow to rivers.
Superficial Aquifer Designation Till	Unproductive Strata	These are deposits with low permeability that have negligible significance for water supply or river base flow.
Bedrock Aquifer Designation Etruria Formation	Secondary Aquifer (A)	Permeable layers capable of supporting water supplies at a local rather than strategic scale, and in some cases forming an important source of base flow to rivers.
Bedrock Aquifer Designation Pennine Lower Coal Measures		

2.4 Hydrology

A large pond is located in the centre of the site. There are no other significant surface water features within the vicinity of the site.

There are no abstractions from surface waters within 500m of the site.

3 Ground Investigation

3.1 Site Work

Site work was carried out between the 21 September and 28 September 2015 and included the following.

Table 3.1 Summary of Exploratory Holes

Type	Ref.	Depth Range (m bgl)
Windowless sampler boreholes	WS01 – WS15	2.00 – 5.00
Trial pits	TP01 – TP50	1.90 – 4.50
Soakaway pits	TP12, TP21, TP32, TP33	1.90 – 2.20

The exploratory holes were set out by an MLMCEL engineer based on the findings of the desk study in locations to maximise the available data, whilst operating within the constraints of the site.

All exploratory holes were logged by a Geoenvironmental engineer in general accordance with BS5930: 2015.

The exploratory hole logs are presented in Appendix A.

3.2 Investigation Rationale

The rationale for the investigation is presented in Tables 3.2 and 3.3 below.

Table 3.2 Rationale for Contamination Sampling and Testing

Target/Area	Potential Contamination	Exploratory Hole(s)
Made ground/Entire site	Ground gas, metals, TPH, PAH, sulphate, pH	All

Table 3.3 Rationale for Geotechnical Sampling and Testing

Target/Area	Potential Geotechnical Feature	Exploratory Hole(s)
Made ground/Entire site	Strength	All
Natural ground/Entire site	Strength	All

The locations of all the exploratory holes are presented on Drawing 773135-DWG-ENV-001.

3.3 Installations

Combined gas and groundwater monitoring standpipes were installed in WS01 to WS04, WS07, WS09, WS11 and WS13 to WS15.

Details of the installations are provided on the relevant borehole logs.

3.4 In Situ Testing

Standard penetration tests (SPTs) were undertaken at regular intervals in the windowless sampler boreholes.

Hand shear vane tests were undertaken at shallow depth (<1.2m) in the trial pits and on samples recovered from depth in trial pits and the windowless sampler boreholes.

In situ test types and depths are recorded on the relevant exploratory hole records.

3.5 Sampling

Continuous soil cores were recovered from the windowless sampler boreholes in clear PVC liners to prevent cross contamination and aid sample recovery.

Disturbed samples were recovered from all exploratory holes: in bulk bags and/or tubs depending on the soil types and proposed laboratory testing.

Contamination samples were recovered in plastic tubs and glass jars, appropriate for the laboratory analysis undertaken.

Sample types and depths are recorded on the relevant exploratory hole records.

3.6 Post-Fieldwork Monitoring

Post-fieldwork monitoring of ground gas/organic vapour concentrations and groundwater levels has been undertaken on one occasion on 7 October 2015. The results are presented in Appendix B.

3.7 Laboratory Analysis

3.7.1 Geotechnical Testing

The following laboratory tests were scheduled on soil samples recovered from the exploratory holes.

Table 3.4 Summary of Geotechnical Testing

Test	No.
Natural moisture content	19
Atterberg limits	7
Particle Size Distribution	3
Sedimentation	1
pH and soluble	5

Geotechnical testing was undertaken by a UKAS-accredited laboratory to BS1377 and the results are presented in Appendix C.

3.7.2 Contamination Analysis

Based on the results of the Phase 1 Contamination Assessment, the following laboratory analysis was scheduled on soil samples recovered from the exploratory holes:

Table 3.5 Summary of Contamination Analysis - Soil

Test	No.
MLM soils suite : Metals (As, Cd, Cr, Cu, Ni, Zn, Pb, Hg, Se), speciated Polycyclic Aromatic Hydrocarbons (PAH USEPA16), Total Petroleum Hydrocarbons (TPH CWG AA-splits), total cyanide, total phenols, sulphur, water soluble sulphate and pH	12
Metals (As, Cd, Cr (total), Cr(vi), Cu, HG, Ni, Pb, Se, Zn)	48
Total sulphate, water soluble sulphate	47
pH	47
Soil Organic Matter	15
Asbestos	7

Table 3.7 Summary of Contamination Analysis – Groundwater

Test	No.
Metals (As, Cd, Cr, Cu, Ni, Zn, Pb, Hg, Se)	10
PAH (speciated USEPA 16)	10
Petroleum hydrocarbons (speciated TPHCWG)	10
Sulphate	10
Hardness	10

Contamination analysis was undertaken by a UKAS-accredited laboratory and the results are presented in Appendix D.

4 Ground and Groundwater Conditions

4.1 General

The following general strata sequence was encountered across the site. Interpolation between exploratory hole positions has been undertaken based on visual observations and laboratory testing.

Table 4.1 Generalised Strata Sequence

Stratum	Depth range (m bgl)		Proven Thickness range (m)
	Top	Base	
Topsoil	GL	0.20 – 0.50	0.20 – 0.50
Made ground	0.30 – 0.50	0.70 – 1.10	0.40 – 0.80
Glacial Till*	0.20 – 1.10	2.00 – 4.50*	0.40 – 3.80*
Glacio-fluvial Deposits*	0.30 – 0.60	1.90 – 3.40*	1.60 – 3.10*
Etruria Formation*	1.80 – 3.40	2.60 – 5.00*	0.10 – 1.70*

* Base of stratum not proven in all holes

Features, structures or certain ground conditions may be present between exploratory hole locations, which are different to those encountered during the investigation but which may impact upon construction.

The findings of the site investigations generally match the published geology for the area.

4.2 Topsoil

For the purposes of this report topsoil is defined as a near surface soil which appears from visual inspection alone to be capable of supporting plant growth. The description of topsoil within this report does not imply compliance with BS3882.

Topsoil was encountered in all the boreholes and trial pits on site. This is considered to represent the ploughed horizon across the agricultural fields and had at the time of the investigation work been harvested.

4.3 Made Ground

Underlying the topsoil, made ground was present in trial pits TP02-TP07, TP10-TP11 and TP45 in the northwest and centre of the site and comprised reworked Glacial Till deposits with occasional fragments of brick and concrete.

4.4 Glacial Till

Underlying the topsoil/made ground in trial pits TP01-TP31, TP38-TP50 and boreholes WS01-WS10 and WS12-15, a mixture of sandy gravelly clays and sand and gravels were encountered with lenses of stiff brown grey clay. These are considered to be Glacial Till deposits. These deposits contained abundant cobbles and large boulders of sandstone and quartzite, which is consistent with their environment. Boreholes WS01-WS10 and trial pits TP01-TP17, TP19-TP21, TP24, TP26-TP28, TP31, TP38, TP41, TP43 and TP49 were terminated within these soils.

4.5 Glacio-fluvial deposits

Underlying the topsoil in TP32-TP37 and WS11 in the northeast of the site sand and gravels were encountered. These are considered to be Glacio-fluvial Deposits. These deposits contained abundant cobbles and large boulders of sandstone and quartzite, which is consistent with their environment. These exploratory holes were terminated within these soils.

4.6 Etruria Formation

Underlying the glacial till in boreholes WS12-WS15 and trial pits TP18, TP22-TP23, TP25, TP29-TP30, TP39-TP40, TP42-TP48 and TP50 in the south and east of the site, stiff to hard slightly sandy gravelly silty clay was encountered. These deposits are considered to be part of the Etruria Formation. Boreholes WS12-WS15 and trial pits TP18, TP22-TP23, TP25, TP29-TP30, TP39-TP40, TP42-TP48 and TP50 were terminated within these soils.

4.7 Groundwater Conditions

Groundwater seepages were encountered during the fieldwork in boreholes WS01-WS02, WS06-WS07, WS09-WS12 and trial pits TP02, TP04, TP10, TP13-TP15, TP17, TP19-TP20, TP24, TP26, TP30, TP34, TP37-TP41, TP43 and TP48-TP50 across the site, at depths ranging from 2.30m bgl to 4.50m bgl.

During post-fieldwork monitoring water levels were recorded at depths ranging from 1.64m bgl to 3.40m bgl.

The groundwater is from the base of the glacial till/glacio-fluvial deposits and is considered to be representative of the groundwater table in the area which is confirmed by the large pond in the centre of the site.

4.8 Contamination Observations

Made ground was present, including fragments of brick, within trial pits TP02-TP07, TP10-TP11 and TP45 in the northwest and centre of the site with concrete and wood (potentially treated) present in trial pits TP02 and TP03 in the northwest of the site.

No other visual or olfactory evidence of contamination was noted at the site.

4.9 Ground Gas and Vapour Conditions

The presence of made ground in the centre and northwest of the site indicates the potential for ground gases to be present. There was no visual or olfactory evidence of hydrocarbon contamination in soil or groundwater to indicate the potential presence of organic vapour.

A summary of the range of readings is presented in table 4.3 below.

Table 4.3 Summary of Gas Monitoring

Date	Methane (%)	Carbon Dioxide (%)	Flow Rate (l/hr)	Barometric Pressure (mb)
07/05/15	<0.10 – 0.50	1.40 – 6.50	<0.10 – 0.50	991 - 995

4.10 Underground Obstructions

It is understood a football ground and tennis courts was located within the southwest corner of the site. Whilst there is a potential for buried construction (e.g. foundations and/or services) in these areas, the risk is considered low given the ongoing farming activities currently being undertaken within this area.

5 Material Properties

5.1 General

The following presents a summary of the properties of the soils encountered, based on field observations, in situ field testing and laboratory test results.

For the purposes of property designation, soils are divided into fine soils (clays and silts) and coarse soils (sands and gravels).

Soil plasticity class for fine soils is based on the classification system of BS5930, adopting modified plasticity index values (based on percentage passing 425 μ m sieve).

Volume change potential of fine soils on change of moisture content has been assessed using guidance provided in NHBC Standards/BRE Digest 240 - Part 1.

Equivalent approximate undrained shear strengths (c_u) and equivalent approximate coefficients of volume compressibility (m_v) have been calculated from recorded SPT N values, adopting f_1 and f_2 values respectively (based on CIRIA 143) appropriate to the recorded plasticity.

The angle of shearing resistance (ϕ) of the coarse soils has been derived from the uncorrected standard penetration resistance N using the relationship published by Hatanaka and Uchida (1996).

5.2 Made Ground

The made ground is inherently variable and as such representative values of geotechnical properties are impracticable to determine. On this basis, no laboratory geotechnical testing has been undertaken on it.

5.3 Glacial Till

Natural moisture contents in the fine fraction of these materials range from 9% to 20% and modified plasticity indices range from 10% to 13%. On this basis these soils are classified as of low plasticity (CL soils) and of low swelling/shrinkage potential on change of moisture content.

In situ SPT N values within the fine fraction of these materials range from 1 to 36, but are generally within the range 9 to 15. Approximate undrained shear strengths based on these results range from 62kN/m² to 103kN/m², adopting an f_1 value of 6.9 (based on an 'average' plasticity of 12%).

5.4 Glacio-fluvial Deposits

In situ SPT N values within the coarse fraction of these materials range from 2 to 39 but are generally within the range 8 to 20, showing them to be of low to medium relative density. Angles of shearing resistance based on these results range from 30° to 34°.

5.5 Etruria Formation

Natural moisture contents in the fine fraction of these materials range from 10% to 30% and modified plasticity indices are between 8% and 21%. On this basis these soils are classified as of low to intermediate plasticity (CL/CI soils) and of low to medium swelling/shrinkage potential on change of moisture content.

In situ SPT N values within the fine fraction of these materials range from 32 to 48. Approximate undrained shear strengths based on these results range from 205kN/m² to 307kN/m², adopting an f_1 value of 6.4 (based on an 'average' plasticity of 15%).

5.6 Summary

In summary the following geotechnical parameters have been recorded and/or calculated:

Table 5.1 Geotechnical Parameters

Stratum	Moisture Content (%)	Plasticity Index* (%)	SPT N Values	Calculated Shear Strength (kN/m³)
Made Ground	4.9 to 5.1	N/A	N/A	N/A
Glacial Till	9.1 to 20	9.7 to 13	1 to 36	62 to 103
Glacio-fluvial Deposits	9.1 to 14	N/A	2 to 39	N/A
Etruria Formation	10 to 30	7.8 to 21	32 to 48	205 to 307

* Modified

6 Geotechnical Assessment

6.1 General

This geotechnical assessment is based on the parameters determined from the field work and laboratory analysis as described in Section 5. It presents a geotechnical assessment of possible foundation solutions and infrastructure design; it does not constitute a detailed design report for the proposed development.

The merits of the available options discussed should be reviewed by the foundation/structural engineers.

It is understood that the proposed development will comprise 139,500 sq ft of office space, 50,000 sq ft of warehouse, 20,000 sq ft of retail, 30,000 sq ft of leisure and/or hotel use, and 319 residential units.

It is anticipated that finished ground levels will be at, or close to, existing ground levels. Should this not be the case then this assessment may need to be reviewed.

6.2 Existing Buried Construction

There is a former development to the southwest corner of the site and it is possible that existing buried construction including foundations and services will be encountered below the site.

Unless it is to be incorporated within the new development, any old construction encountered should be fully penetrated by all new foundations and broken well away from any new construction.

Any soil disturbed by excavation of foundations and services should also be fully penetrated by new foundations.

6.3 Excavations

Excavation to anticipated founding depths should be readily achievable using standard excavation plant.

Instability of excavation faces was noted during excavation of the trial pits. This is prevalent in the natural coarse soils.

Random and sudden falls should be expected from the faces of near vertically sided excavations put down at the site. This situation is likely to be prevalent in the natural coarse soils and is likely to be exacerbated by water inflows.

Temporary trench support, or battering of excavation sides, is likely to be required for all excavations that are to be left open for any length of time, and will definitely be required where man entry is required.

Particular attention should be paid to excavation at, or close to, site boundaries where collapse of excavation faces could have a disproportionate effect.

A risk assessment of the stability of any open excavation should be undertaken by a competent person and appropriate measures adopted to ensure safe working practise in and around open excavations. Further guidance on responsibilities and requirements for working near, and in, excavations can be obtained from the Construction Design and Management Regulations (2015).

Based on site observations, it is considered that sump pumping is likely to be sufficient to deal with anticipated flows. However, it should be recognised that groundwater levels will fluctuate seasonally and the timing of construction may dictate the extent of groundwater control required.

Any water pumped from excavations is likely to need to be passed via settlement tanks before being discharged to the sewer; discharge consents will also be required.

6.4 Foundations

This foundation assessment is based on the information available and is for the purposes of initial site appraisal. The investigation works examined the shallow soils to depths of up to circa 5.0m below ground level across the area of the site. Further investigation works to prove the deeper soil conditions and to determine the nature of the underlying solid strata, together with more detailed laboratory analysis and geotechnical assessment would be required to better quantify the foundation depths and allowable bearing pressures appropriate for the proposed development.

The appropriate foundation solution adopted for the site will depend not only on ground conditions, but also on structural loading, load distribution and the limiting criteria for movement or settlement of the buildings, which may have high specification finishes and unevenly distributed loadings so that settlement, and particularly differential settlement, will need to be maintained within tight tolerances.

The superficial Glacial Till soils are of low swelling/shrinkage potential on change of moisture content.

Trees are noted in the central parts of the site close to the lake and along the southern, western and northern boundaries although they are of unknown size, species or maturity. Plots constructed within influencing distance of these trees (whether on or off site and whether to remain or be removed), should be constructed in accordance with NHBC Standards for residential housing or the recommendations of BRE Digest 240 for commercial and retail buildings.

On the basis of the above, minimum founding depths are likely to be around 1.0m within the firm to stiff clay or medium dense sand and gravel soils. A number of isolated areas of soft / loose ground were identified within particular investigation positions where foundations would need to be deepened to penetrate the low strength soils.

Foundations that are carried deep due to tree influence may be stepped up, in accordance with a suitable specification, such as BS8004:2015, as long as a suitable founding stratum is present at shallower depth.

If trees are to be removed, the roots should be grubbed out and foundations extended to below the zone of disturbance created by this activity.

6.4.1 Strip/Trench Fill Foundations

Traditional strip/trench fill foundations are considered suitable for the proposed residential development and based on the design soil parameters provided in earlier sections of this report, as a guide, an allowable net bearing capacity of 100kN/m² should be available for a 600mm wide strip/trench fill foundation bearing on the natural superficial clay and sand and gravel soils.

Excavation of trench fill foundations to depths in excess of 2.5m bgl is unlikely to be economical and may be impracticable to undertake. Care should be taken to ensure the verticality of deep, narrow foundations to prevent eccentric loading.

6.4.2 Pad Foundations

Pad foundations are considered an appropriate solution for the proposed commercial / retail development and based on the design soil parameters provided in earlier sections of this report, as a guide, an allowable net bearing pressure of 100kN/m² should be available for a pad 1.5m square bearing on the natural superficial clay and sand and gravel soils.

Should enlarging the pads be considered (for example because loads are such that the quoted bearing pressure is inadequate based on the size of foundation identified) this will probably lead to increased settlements and the above recommendations should be reviewed.

6.4.3 Heave Protection

A number of plots across the site are to be constructed within the influencing distance of trees and heave protection will be required on the inside faces of the ground beams.

Consideration should be given to the possible effect of direct root action on foundations or services, and to the continued stability of existing trees, where buildings are constructed very close to existing trees that are to remain.

6.5 Ground Floor Slabs

Ground conditions at the site are such that ground bearing slabs should be acceptable for the residential and commercial/retail development at the site. However, consideration should be given to the swelling and shrinkage potential of the near surface soils, with reference to NHBC and/or BRE Digest 412, which may require ground floor slabs to be suspended over a void or constructed over a layer of granular fill of a thickness based on the anticipated degree of swelling/shrinkage.

6.6 Pavement Construction

Following site preparation/regrading the sub-grade will comprise mainly natural superficial clay, and sand and gravel materials. Made ground materials were noted within the north west of the site and comprise generally re-worked natural material with inclusions of brick and broken concrete.

For the natural clay soils a design CBR value of 2% should be adopted, and for the sands and gravels, a design CBR of 5% is considered appropriate.

The made ground is mixed and variable and it is recommended that, where encountered at formation level, these deposits be excavated to a depth of 0.5m below formation level (or to suitable natural soils, whichever is reached first) and the sub-formation rolled. The excavated material should be sorted to remove any oversize or otherwise unsuitable materials, prior to recompacting the suitable materials in thin layers compatible with the compaction plant employed. Any deficit in material should be made up in suitable imported material suitably compacted as above. Following this treatment an overall design CBR of 2% should be available.

It is recommended that the above design CBR values be confirmed by in situ testing.

6.7 Below Ground Concrete Design

Based on the results of the pH and water soluble sulphate determinations on soil and groundwater samples and in accordance with the categorisation system of BRE Special Digest 1, the soils below the site fall within the classes presented in Table 6.2 below.

Table 6.2 Summary of Concrete Design Class

Soil Type	Design Sulphate Class (DS)	Aggressive Chemical Environment for Concrete (ACEC)
Topsoil	DS - 1	AC - 1 ^d
Made ground	DS - 1	AC - 1 ^d
Till/Glaciofluvial	DS - 1	AC - 1 ^d

6.8 Soakaway Potential

Soakaway testing was undertaken as part of the investigation within TP12, TP21, TP32 and TP33. The results of these tests are presented in Appendix E. Three of the four soakaway tests undertaken (TP12, TP21 and TP32) were not completed in the time allowed due to the slow infiltration rate of the water. Approximated infiltration rates for these three soakaway tests gained by extrapolating the results of the information indicate infiltration rates in the order of 5×10^{-6} m/sec. The soakaway test undertaken within TP33, recorded an infiltration rate of 2.96×10^{-4} m/sec within the glacio-fluvial sand and gravel materials in the north east of the site.

Given the variability of the soils across the site, further testing should be considered once the location of any proposed soakaway drainage scheme is known.

6.9 Reuse of Materials

The made ground below the site should be suitable for re-use as fill at the site below areas of hard-standing or buildings following sorting to remove any deleterious oversize or otherwise unsuitable materials.

Excavated natural fine soils are considered suitable for re-use as fill at the site, in landscaped areas and gardens, but as they will be liable to long term consolidation settlement their use should be limited to areas where long-term settlements would not be an issue. Excavated natural coarse soils are considered suitable for re-use as fill at the site below areas of hard-standing or buildings or in landscaped areas and gardens, following sorting to remove any deleterious, oversize or otherwise unsuitable materials.

7 Assessment of Soil Chemical Data

7.1 Guidelines

This section presents a generic quantitative risk assessment (GQRA) to identify potential sources of contamination for further evaluation in the Contaminated Land Risk Assessment section of the report. GQRA involves a comparison of chemical laboratory test results to soil screening levels that are considered to be appropriate to the context of the intended site use.

Soil screening values used in this human health risk assessment have been drawn from the following publications:

- Suitable for Use Levels (S4ULs) were published in 2015 by Land Quality Management Ltd (LQM) and the Chartered Institute of Environmental Health (CIEH). S4ULs are based on the principles of 'minimal' or 'tolerable' risk and are therefore sufficiently conservative for GQRAs under the planning regime, which need only demonstrate that new development is 'safe' and 'suitable for use'. By reproducing these S4ULs, MLMCEL acknowledges "Copyright Land Quality Management Limited reproduced with permission; Publication Number S4UL3184. All rights reserved".
- Category 4 Screening Levels (C4SLs) were published in 2014 by Defra and have been used for lead, which has no S4UL.
- There is no S4UL for cyanide and, in the absence of UK guidance, a Dutch Intervention Value (DIV) of 50mg/kg has been used.
- Generic Assessment Criteria (GAC) were published jointly in 2009 by the Environmental Industries Commission, Association of Geotechnical and Geoenvironmental Specialists and Contaminated Land: Applications in Real Environments (EIC/AGS/CL:AIRE) for a range of organic and inorganic contaminants not covered by S4ULs.

Risks to water supply pipes have been assessed using guidance published by the United Kingdom Water Industry Research Ltd (UKWIR). The guidance provides threshold concentrations above which organic compounds can permeate water supply pipes, impact on their construction and cause a water quality issue for consumers. For the purposes of this assessment it is assumed that polyethylene water supply pipework will be adopted.

Potential risks to plant life, such as for proposed landscaping, are assessed through BS3882:2007. This standard sets out the threshold values in soil above which phytotoxic effects can occur from the metals copper, nickel and zinc.

A full list of screening levels used in the assessment is included in Appendix F.

Appropriately sensitive testing methods have been adopted throughout and on this basis, where contaminants are recorded at less than detection limits, they are considered to be 'not present'.

7.2 Risks to Human Health

The development proposals are for mixed residential and commercial and for the purpose of this human health risk assessment the intended land use scenario is considered to be residential with homegrown produce (RWHP)

Soil organic matter tests in samples of soil gave values of between 0.62% and 7.6% with a mean of 1.76%, therefore a generic SOM of 2% has been used for selecting appropriate screening levels.

None of the measured contaminant concentrations are above screening levels and therefore further assessment of these contaminants in relation to risks to human health is not considered to be necessary.

Asbestos fibres were not identified in any of the seven soil samples tested.

7.3 Risks to Water Supply

None of the measured concentrations are above UKWIR threshold levels and therefore further assessment of these contaminants in relation to risks to new water supplies is not considered to be necessary.

7.4 Risks to Plant Life

Recorded concentrations of copper, nickel and zinc are below BS3882:2007 threshold values.

8 Assessment of Soil Leachate and Groundwater Chemical Data

This section presents a GQRA to identify potential sources of soil leachate and groundwater contamination that could impact on controlled waters.

8.1 Guidelines

The site is underlain by a Secondary 'A' Aquifer and therefore the results of the analyses have been compared to the UK Drinking Water Standards (DWS).

The site is close to a surface water body and therefore the results of the analyses have been compared to Environmental Quality Standards (EQS). Where there are no EQS for a contaminants of concern reference will be made to appropriate alternatives.

EQS for some metals are banded according to water hardness. Water hardness values ranging from 320 to 670 CaCO₃/l have been recorded and for the purposes of this assessment the EQS values for the >250 mg CaCO₃/l range have been adopted.

8.2 Groundwater

None of the contaminant concentrations are recorded above DWS and/or EQS and therefore further assessment of these contaminants in relation to groundwater risks is not considered to be necessary.

9 Assessment of Ground Gas and Organic Vapour Data

This section presents a GQRA to identify potential sources of gas and organic vapour in the ground that could impact on human health.

9.1 Guidelines

The proposed development is mixed low-rise residential and commercial and the potential impact of ground gas on development is assessed through the British Standard BS8485:2007 and the Traffic Light designations published by the National House Building Council and the Characteristic Situations published by CIRIA.

A generic quantitative risk assessment for organic vapour (v-GQRA) has been undertaken in accordance with the CIRIA VOC Handbook C682 to assess the potential impact on human health from the indoor inhalation of vapour generated by organic compounds in soil. For TPH, the LQM S4ULs are considered to be protective of human health from the indoor inhalation of hydrocarbon vapour.

9.2 Screening Assessment – Ground Gas

One visit to site has been made following site work. A summary of site maximum monitoring results are presented in Table 9.1 below from which Gas Screening Values (GSVs) have been calculated.

Table 9.1 Site Maximum Gas Concentrations and Flow Rate

Parameter	Site Maximum	GSV
Methane	0.50%	0.0025 l/hr
Carbon dioxide	6.50%	0.035 l/hr
Flow rate	0.50l/hr	

The screening assessment places the site in a CIRIA Characteristic Situation 2 / NHBC Traffic Light Amber 1 for carbon dioxide.

9.3 Screening Assessment – Organic Vapour

Based on soil test results, S4ULs for TPH compounds in soil are not exceeded, which indicates that there is no potential risk to human health for the inhalation of vapour generated by organic compounds in soil.

9.4 Nature and Distribution of Ground Gas and Organic Vapour Contamination

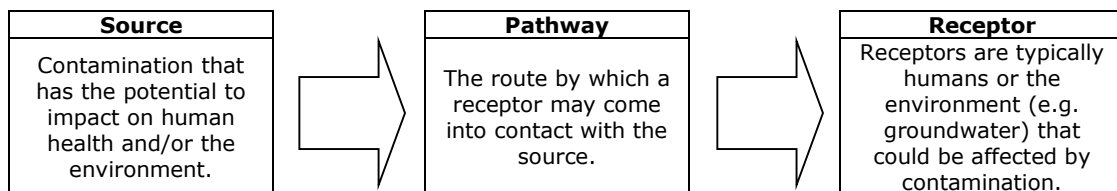
The assessment of the gas regime at the site is based on the results of one monitoring round and will need to be updated following further monitoring undertaken. The monitoring indicates generally low levels of carbon dioxide across the majority of the site with methane generally below the detection limit of the gas monitoring equipment. An isolated elevated level of 6.5% carbon dioxide and 0.5% methane was noted within WS02 to the west of the existing lake.

The Phase 1 Contamination Assessment report concluded that the site is within an area where full radon protective measures are likely to be necessary within new buildings.

10 Contaminated Land Risk Assessment and Conceptual Site Model

10.1 General Approach

The assessment of risk from contamination follows the source-pathway-receptor (SPR) approach. Each of these elements is described as follows.



Without a source-pathway-receptor linkage in place, it is considered that there is no risk of harm and remediation is unlikely to be required. If, however, there is a linkage between source and receptor then a risk-based approach is used to assess the significance or potential impact of the SPR-linkage to determine if remediation is required.

Such an assessment involves Quantitative Risk Assessment (QRA). The QRA process involves the identification of sources based on site investigation findings (eg compound concentration exceeding S4UL) together with identification of the exposure pathway and sensitive receptor. A Conceptual Site Model (CSM) is then developed and presented that shows the possible pollution linkages.

In terms of identifying *significant* pollution linkages (i.e. those that require remediation), a level of risk (ranging from Very Low to Very High) is assigned to each. Where the level of risk is 'Moderate' or greater, then the pollution linkage is considered to be 'significant' and remediation is required. Risk definitions are provided in Appendix G.

10.2 Identified Contamination Sources

Based on the GQRA presented in the previous sections, sources of contamination that could impact on receptors have been identified and are summarised in Table 11.1 below.

Table 10.1 Identified Sources of Contamination

Receptor type	Source
Human health	Carbon dioxide in superficial soils
Human Health	Radon contamination from underlying geology.

10.3 Potential Exposure Pathways

Table 10.2 below presents a review of potential pathways and receptors for the site.

Table 10.2 Potential Exposure Pathways and Receptors

Receptor	Pathway	Notes	SPR Link
Human Health			
Future site users	Dermal contact, ingestion or inhalation of soil and soil dust	No soil contamination identified above screening levels.	✗
	Migration in permeable strata and inhalation of gas/organic vapour	Ground gas including radon could enter new buildings and accumulate. Gas monitoring has recorded elevated concentrations of carbon dioxide albeit with low flow.	✓
	Migration in permeable strata, accumulation and risk of explosion	Gas monitoring has not recorded elevated concentrations of methane.	✗
Adjacent site users	Ingestion/inhalation of windblown dust	No soil contamination identified above screening levels.	✗
	Migration in groundwater and direct contact	Off site residents are unlikely to come into contact with groundwater.	✗
	Migration in groundwater and inhalation of organic vapour	However no soil contamination above screening levels was identified.	✗
Construction workers and services maintenance staff	Dermal contact, ingestion or inhalation of soil and soil dust	No soil contamination identified above screening levels.	✗
Development			
Future plant life	Plant uptake in garden or landscape area	No soil contamination identified above screening levels.	✗
Water supply pipes	Contact with contaminated material	No soil contamination identified above screening levels.	✗
Environment			
Surface water: Lake within centre of site	Surface runoff	No soil contamination identified above screening levels.	✗
	Groundwater movement	No soil contamination identified above screening levels.	✗
Groundwater: Superficial Secondary 'A' aquifer (Glaciofluvial deposits)	Leaching from soil and vertical fluid movement	No soil or groundwater contamination identified above screening levels.	✗
Groundwater: Superficial aquifer (Glacial Till)	Leaching from soil and vertical fluid movement	Superficial aquifer materials are unproductive strata. No soil or groundwater contamination identified above screening levels.	✗
Groundwater: Bedrock Secondary 'A' aquifer	Leaching from soil and vertical fluid movement	No soil or groundwater contamination identified above screening levels.	✗

Potentially complete SPR linkages are carried forward for further assessment in Table 10.3.

10.4 Phase 2 Updated Conceptual Model

Based on the sources, pathways and receptors identified above, Table 10.3 below summarises all complete pollutant linkages for the site and identifies the level of risk from each.

Table 10.3 Phase 2 Updated Conceptual Site Model

Source	Area Affected	Contaminants	Pathway	Receptor	Likelihood	Potential Magnitude	Overall Risk	Notes
Superficial Materials / Made Ground	North west area of site	Ground gas (carbon dioxide)	Inhalation	Site users	Likely	Severe	High	The site is designated NHBC traffic light Amber 1 for carbon dioxide. Low flow measured during monitoring.
				Site construction/maintenance workers	Low Likelihood	Severe	Moderate	Carbon dioxide was present in excess of 5% and could accumulate in deep excavations and services voids.

11 Remediation and Risk Management

11.1 General

This assessment has identified potential hazards at the site with possible SPR-linkages, which could represent potentially unacceptable risks to identified receptors.

Mitigation of the SPR-linkages summarised in Table 10.3 is recommended to reduce the impact of contamination on site occupants.

The following is for guidance only and does not represent final design of a remediation scheme. Remediation schemes can require the submission of a remediation strategy and verification plan to the Local Authority and/or Environment Agency.

11.2 Soil Remediation

Based on the GQRA and CSM, soil remediation is not considered to be required.

11.3 Groundwater Remediation

DWS and EQS are not exceeded and remediation for the protection of groundwater is not considered to be necessary.

11.4 Gas and Organic Vapour Protection

Further monitoring of ground gas levels will be required across the site to better determine the ground gas regime at the site. The further monitoring would also look to delineate the area of elevated carbon dioxide within the north west of the site area around WS02.

Hydrocarbon vapour protection is not considered to be required for new buildings.

11.5 Off Site Disposal

All waste soils which are to be removed from site (e.g. foundation arisings) need to be classified in terms of waste disposal prior to export.

The waste classification and ability to accept the waste soils can be confirmed by the proposed receiving landfill site, who should be provided with a copy of the laboratory test results in Appendix D.

Some additional testing may be necessary for the receiving landfill site to confirm its ability to accept the waste.

Natural soils from an uncontaminated site (excluding peat and topsoil) would normally be classified as Inert for off-site disposal without the need for further testing.

Non-hazardous soils require pre-treatment prior to disposal. Effective pre-treatment, involving separation, sorting and screening can offer cost reductions. Costs for disposal of non-hazardous and hazardous soils are significant compared to disposal of inert material.

11.6 Remediation Documentation

Based on the findings of this report, remediation for soils and groundwater contamination is not considered to be required and under the conditions of planning, a remediation strategy document will not need to be submitted to the planning authority.

11.7 Construction Health and Safety

It is recommended that construction workers at the site adopt appropriate personal hygiene precautions at the site and use personal protective equipment as required, particularly provision of washing facilities, wearing of gloves and avoidance of hand to mouth contact (e.g. eating or smoking), especially when dealing with made ground.

Handling of soil and water should be minimised and dust suppression measures should be implemented, particularly during any excavation through the made ground. Soils should be dampened during excavation and handling to limit dust, and lorries suitably sheeted. Surface run-off from vehicle washing, dust suppression or storms, during construction, should be controlled to prevent entry into watercourses and off-site drainage systems.

Gas and vapour monitoring should be carried out before entry into deep excavations or confined spaces.

These precautions are considered to be industry standard when developing sites of this nature, and reference can be made to the HSE document HSG66 *Protection of workers and the general public during development of contaminated land* for further information.

11.8 Land Remediation Relief

At the time of writing, Land Remediation Relief (LRR) is a 150% credit on corporation tax claimable by certain corporate bodies against qualifying expenditure when undertaking investigation and remediation of potentially contaminated or derelict sites.

12 Summary and Recommendations

Published geology is Glacio-fluvial deposits within the north east of the site and Glacial Till deposits across the central and south west section of the site overlying the Etruria Formation mudstone recorded below the majority of the site, with the Pennine Lower Coal Measures Formation recorded beneath the western edge of the site.

Existing construction including foundations and services, may possibly be present as a result of the previous development of the site.

12.1 Geotechnical

Strip and or trench fill foundations are considered appropriate for the residential development across the site. It is considered that where the commercial and retail units are constructed as concrete or steel frame units, pad foundations would be considered suitable.

The infiltration capacity for soakaway drainage is variable across the site with adequate capacity more likely within the north east of the site. The local conditions should be confirmed once the drainage strategy for the site has been confirmed.

Excavated natural soils should be suitable for re-use at the site.

The natural superficial clay and sand and gravel should be suitable as a founding stratum and an allowable net bearing capacity of 100kN/m² should be available for a strip/trench fill foundation 600mm wide or a 1.5m square pad foundation. These values should result in settlements of not more than 20mm and 25mm respectively, keeping differential settlements within acceptable limits.

Heave protection is likely to be required where foundations are within the influencing distance of trees.

Ground floors may be constructed as ground bearing slabs. Buried construction should be broken away from the slab to avoid interaction. Heave protection, such as suspended over void, or constructed on a granular fill maybe required locally due to swelling and shrinkage of clay soils.

The soils at the site fall within Design Sulphate Class DS-1 with a corresponding ACEC Class of AC-1^d.

12.2 Contamination

Soil contamination above human health screening levels is absent.

Soil contamination above BS3882:2007 threshold levels is absent.

Soil contamination above UKWIR threshold levels is absent.

Ground gas monitoring identified an isolated elevated level of carbon dioxide above the generic assessment level. The site is therefore classified as Amber 1 in accordance with the NHBC and CIRIA Characteristic Situation 2.

Groundwater contamination above DWS and EQS is absent.

Levels of carbon dioxide noted within one location at the site exceeded the guidance value classifying the site as Amber 1 / Characteristic Situation 2. In addition, the BGS records the site to be within an area where full radon protective measures would be required within new buildings across the site.

12.3 Further Work

A current tree survey is required to determine the potential influence of trees on and adjacent to the site, to the proposed foundation solution.

Further monitoring and assessment would be required to determine whether gas protection measures would be required to be incorporated into the design of structures at the site.

Further investigation of the deeper ground conditions should be undertaken to confirm the foundation depths and bearing capacities across the site area.

13 References

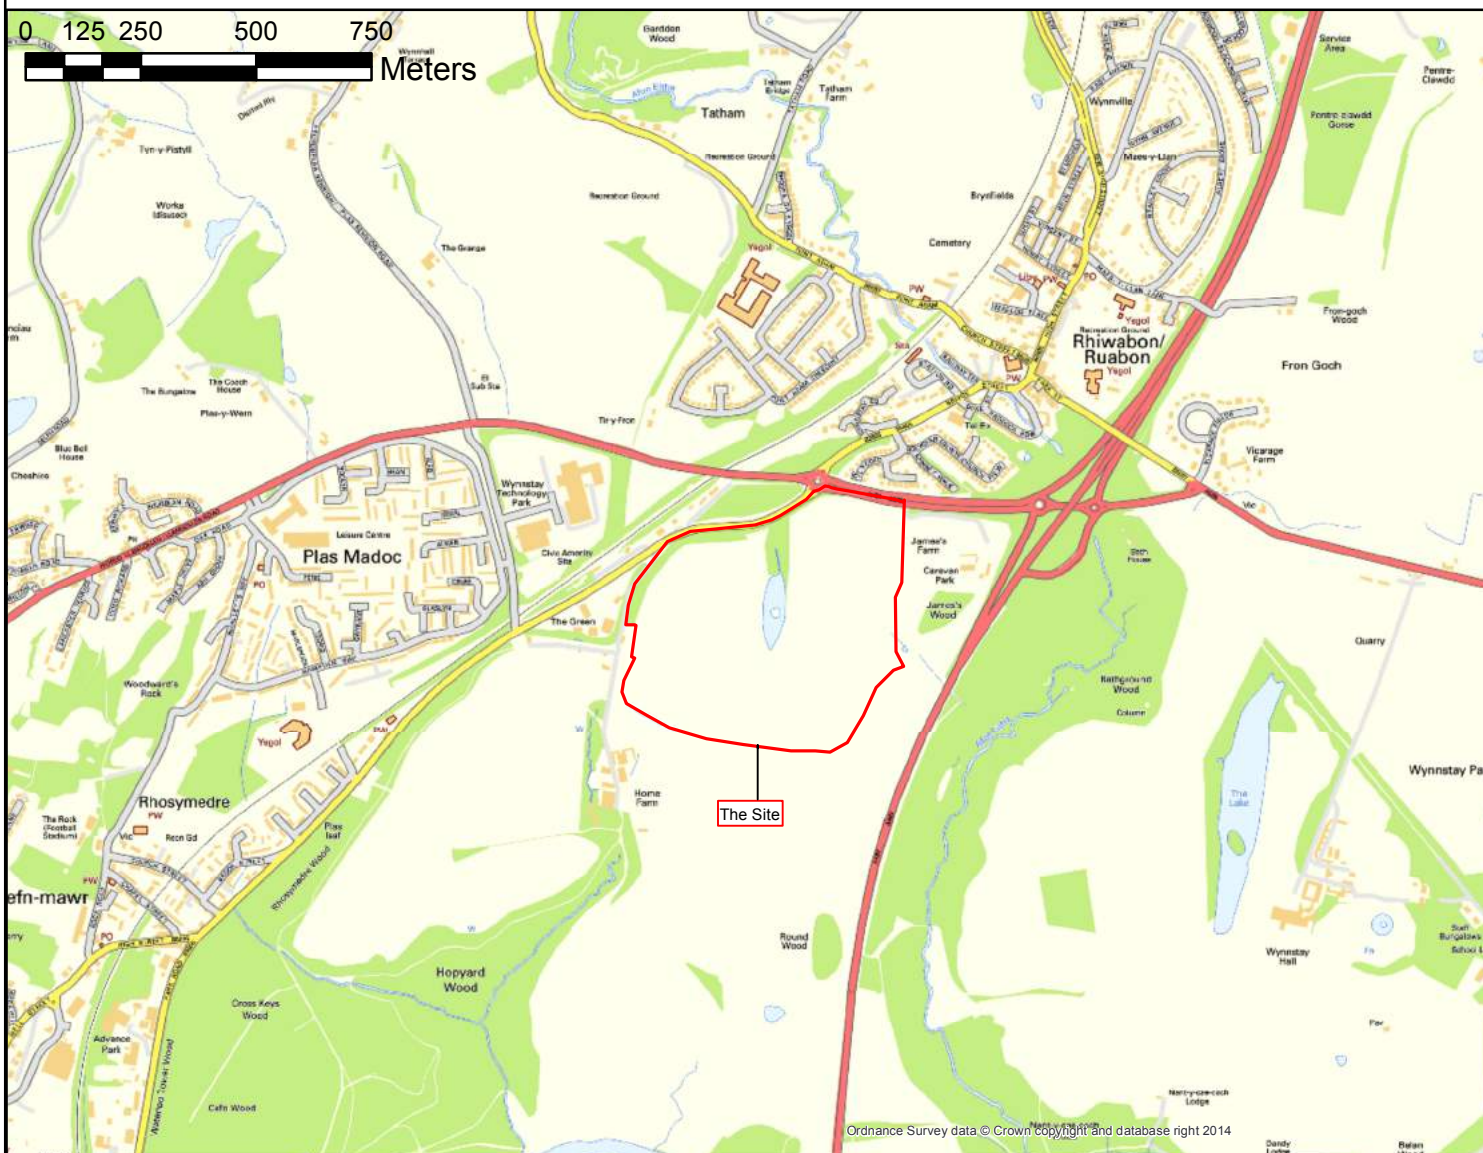
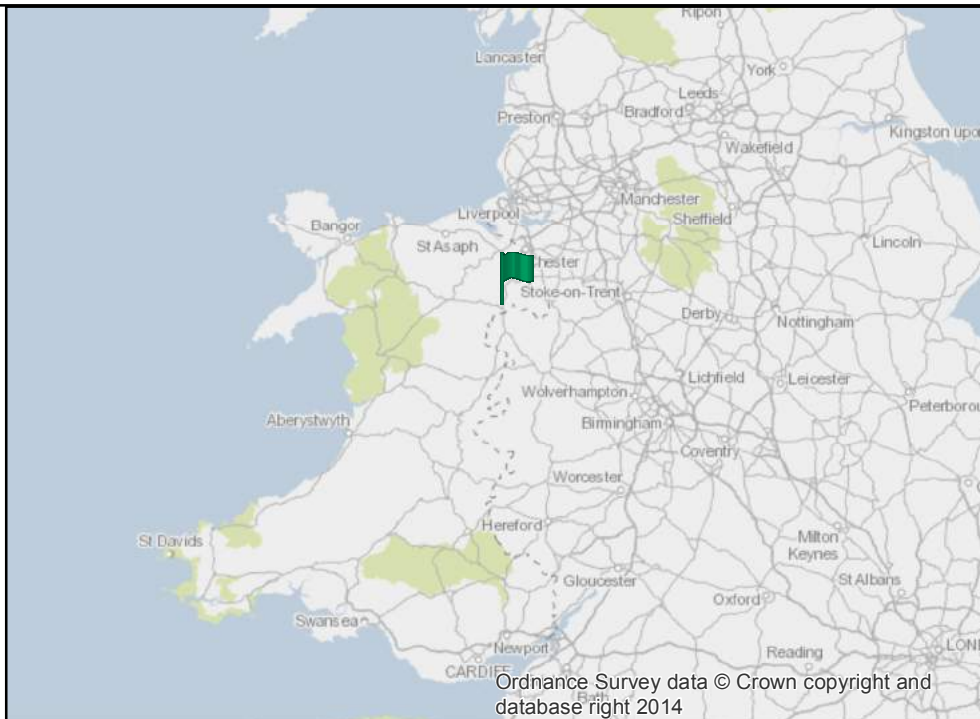
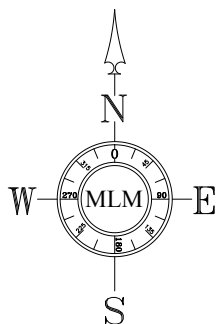
1. Association of Geotechnical and Geoenvironmental Specialists (2004) A clients guide to site investigations.
2. Association of Geotechnical and Geoenvironmental Specialists (2006) AGS guidelines for good practise in site investigations.
3. Association of Geotechnical and Geoenvironmental Specialists (1999) Code of conduct for site investigations.
4. Association of Geotechnical and Geoenvironmental Specialists (2005) Management of risk associated with the preparation of ground reports.
5. Association of Geotechnical and Geoenvironmental Specialists (2005) Guidelines for the preparation of the ground report.
6. Association of Geotechnical and Geoenvironmental Specialists (2000) Guidelines for combined geoenvironmental and geotechnical investigations.
7. British Standards Institution (2011) Investigation of potentially contaminated sites - code of practice. BS10175:2011.
8. British Standards Institution (2015) Code of practice for site investigation. BS5930:2015.
9. British Standards Institution (1990) Methods of test for civil engineering purposes. BS1377:1990.
10. British Standards Institution (2015) Specification for topsoil. BS3882:2015.
11. British Standards Institution (1986) Code of practice for foundations. BS8004:2015.
12. British Standards Institution (2007) Code of practice for the characterization and remediation from ground gas in affected developments. BS8485:2007.
13. British Geological Survey (1993) Sheet 121 Wrexham 1:50,000 scale Geology Map, Solid and Drift Edition.
14. Building Research Establishment (1993) Building on shrinkable clay. BRE Digest 240 - Part 1.
15. Building Research Establishment (1993) Low rise buildings: the influence of trees in clay soils. BRE Digest 298.
16. Building Research Establishment (1996) Desiccation in clay soils. BRE Digest 412.
17. Building Research Establishment (2005) Concrete in aggressive ground. BRE Special Digest 1.
18. Building Research Establishment (2003) Soakaway Design. BRE Digest 365.
19. CIRIA (1995) The standard penetration test (SPT). Methods and use. CIRIA Report C143.

20. CIRIA (2007) Assessing risks posed by hazardous ground gases to buildings. CIRIA Report C665.
21. CIRIA (2009) The VOCs Handbook: Investigating, assessing and managing risks from inhalation of VOCs at land affected by contamination. CIRIA Report C682.
22. DEFRA & Environment Agency (2004) Model procedures for the management of contaminated land. Contaminated Land Report 11.
23. Dutch Reference Framework (2001) Circular on target values and intervention values for soil remediation.
24. Environment Industries Commission, Association of Geotechnical and Geoenvironmental Specialists and Contaminated Land: Applications in Real Environments (2009) The soil generic assessment criteria for human health risk assessment.
25. European Community (1976) Environmental quality standards for List 1 and List 2 dangerous substances (EC Directive 76/464/EEC).
26. Hatanaka M and Uchida A (1996) Empirical correlation between penetration resistance and effective friction of sandy soil. Soils and Foundations, Vol 36 (4), 1-9.
27. Hansen J and Brinch A (1961) General formula for bearing capacity. Danish Geotechnical Institute Bulletin No. 11.
28. Hansen J and Brinch A (1968) A revised extended formula for bearing capacity. Danish Geotechnical Institute Bulletin No. 28.
29. Hansen J and Brinch A (1978) A code of practise for foundation engineering. Danish Geotechnical Institute Bulletin No. 32.
30. Health and Safety Executive (1991) Protection of workers and the general public during the development of contaminated land.
31. Highways Agency (2009) Interim Advice Note 73/06 - Revision 1 - Design guidance for road pavement foundations.
32. Land Quality Management Ltd (2015) The LQM/CIEH S4ULs for human health risk assessment.
33. National House Building Council (2007) Guidance on evaluation of development proposals on sites where methane and carbon dioxide are present.
34. National House Building Council (2011) NHBC Standards - Chapter 4.1 Land quality: Managing ground conditions.
35. National House Building Council (2011) NHBC Standards - Chapter 4.2. Building near trees.
36. Department for Communities and Local Government (2012) National Planning Policy Framework.
37. Peck RB, Hanson WE and Thornburn TH (1967) Foundation engineering 2nd Edition. John Wiley, New York.

38. Skempton AW (1951) The bearing capacity of clays. Building Research Congress, Div. I, 180.
39. UK Water Industry Research (UKWIR) (2011) Guidance for the selection of water supply pipes to be used in brownfield sites.
40. Water Supply (Water Quality) Regulations (2000)

Figures

Figure 1: Site Location Plan



MLM

www.mlm.uk.com

Project
Ruabon Park Wrexham

Site Location Plan

Job No.
773135

Figure No.


1

Drawings

773135-DWG-ENV-001 Exploratory Hole Location Plan

NOTES

1. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ENGINEER'S, ARCHITECT'S AND SPECIALIST'S DRAWINGS AND THE SPECIFICATION.
2. DO NOT SCALE FROM THIS DRAWING MANUALLY OR ELECTRONICALLY. WRITTEN PERMISSION MUST BE OBTAINED FROM MLM PRIOR TO SCALING ELECTRONICALLY OR USING THIS ELECTRONIC FILE.



LEGEND

TP1

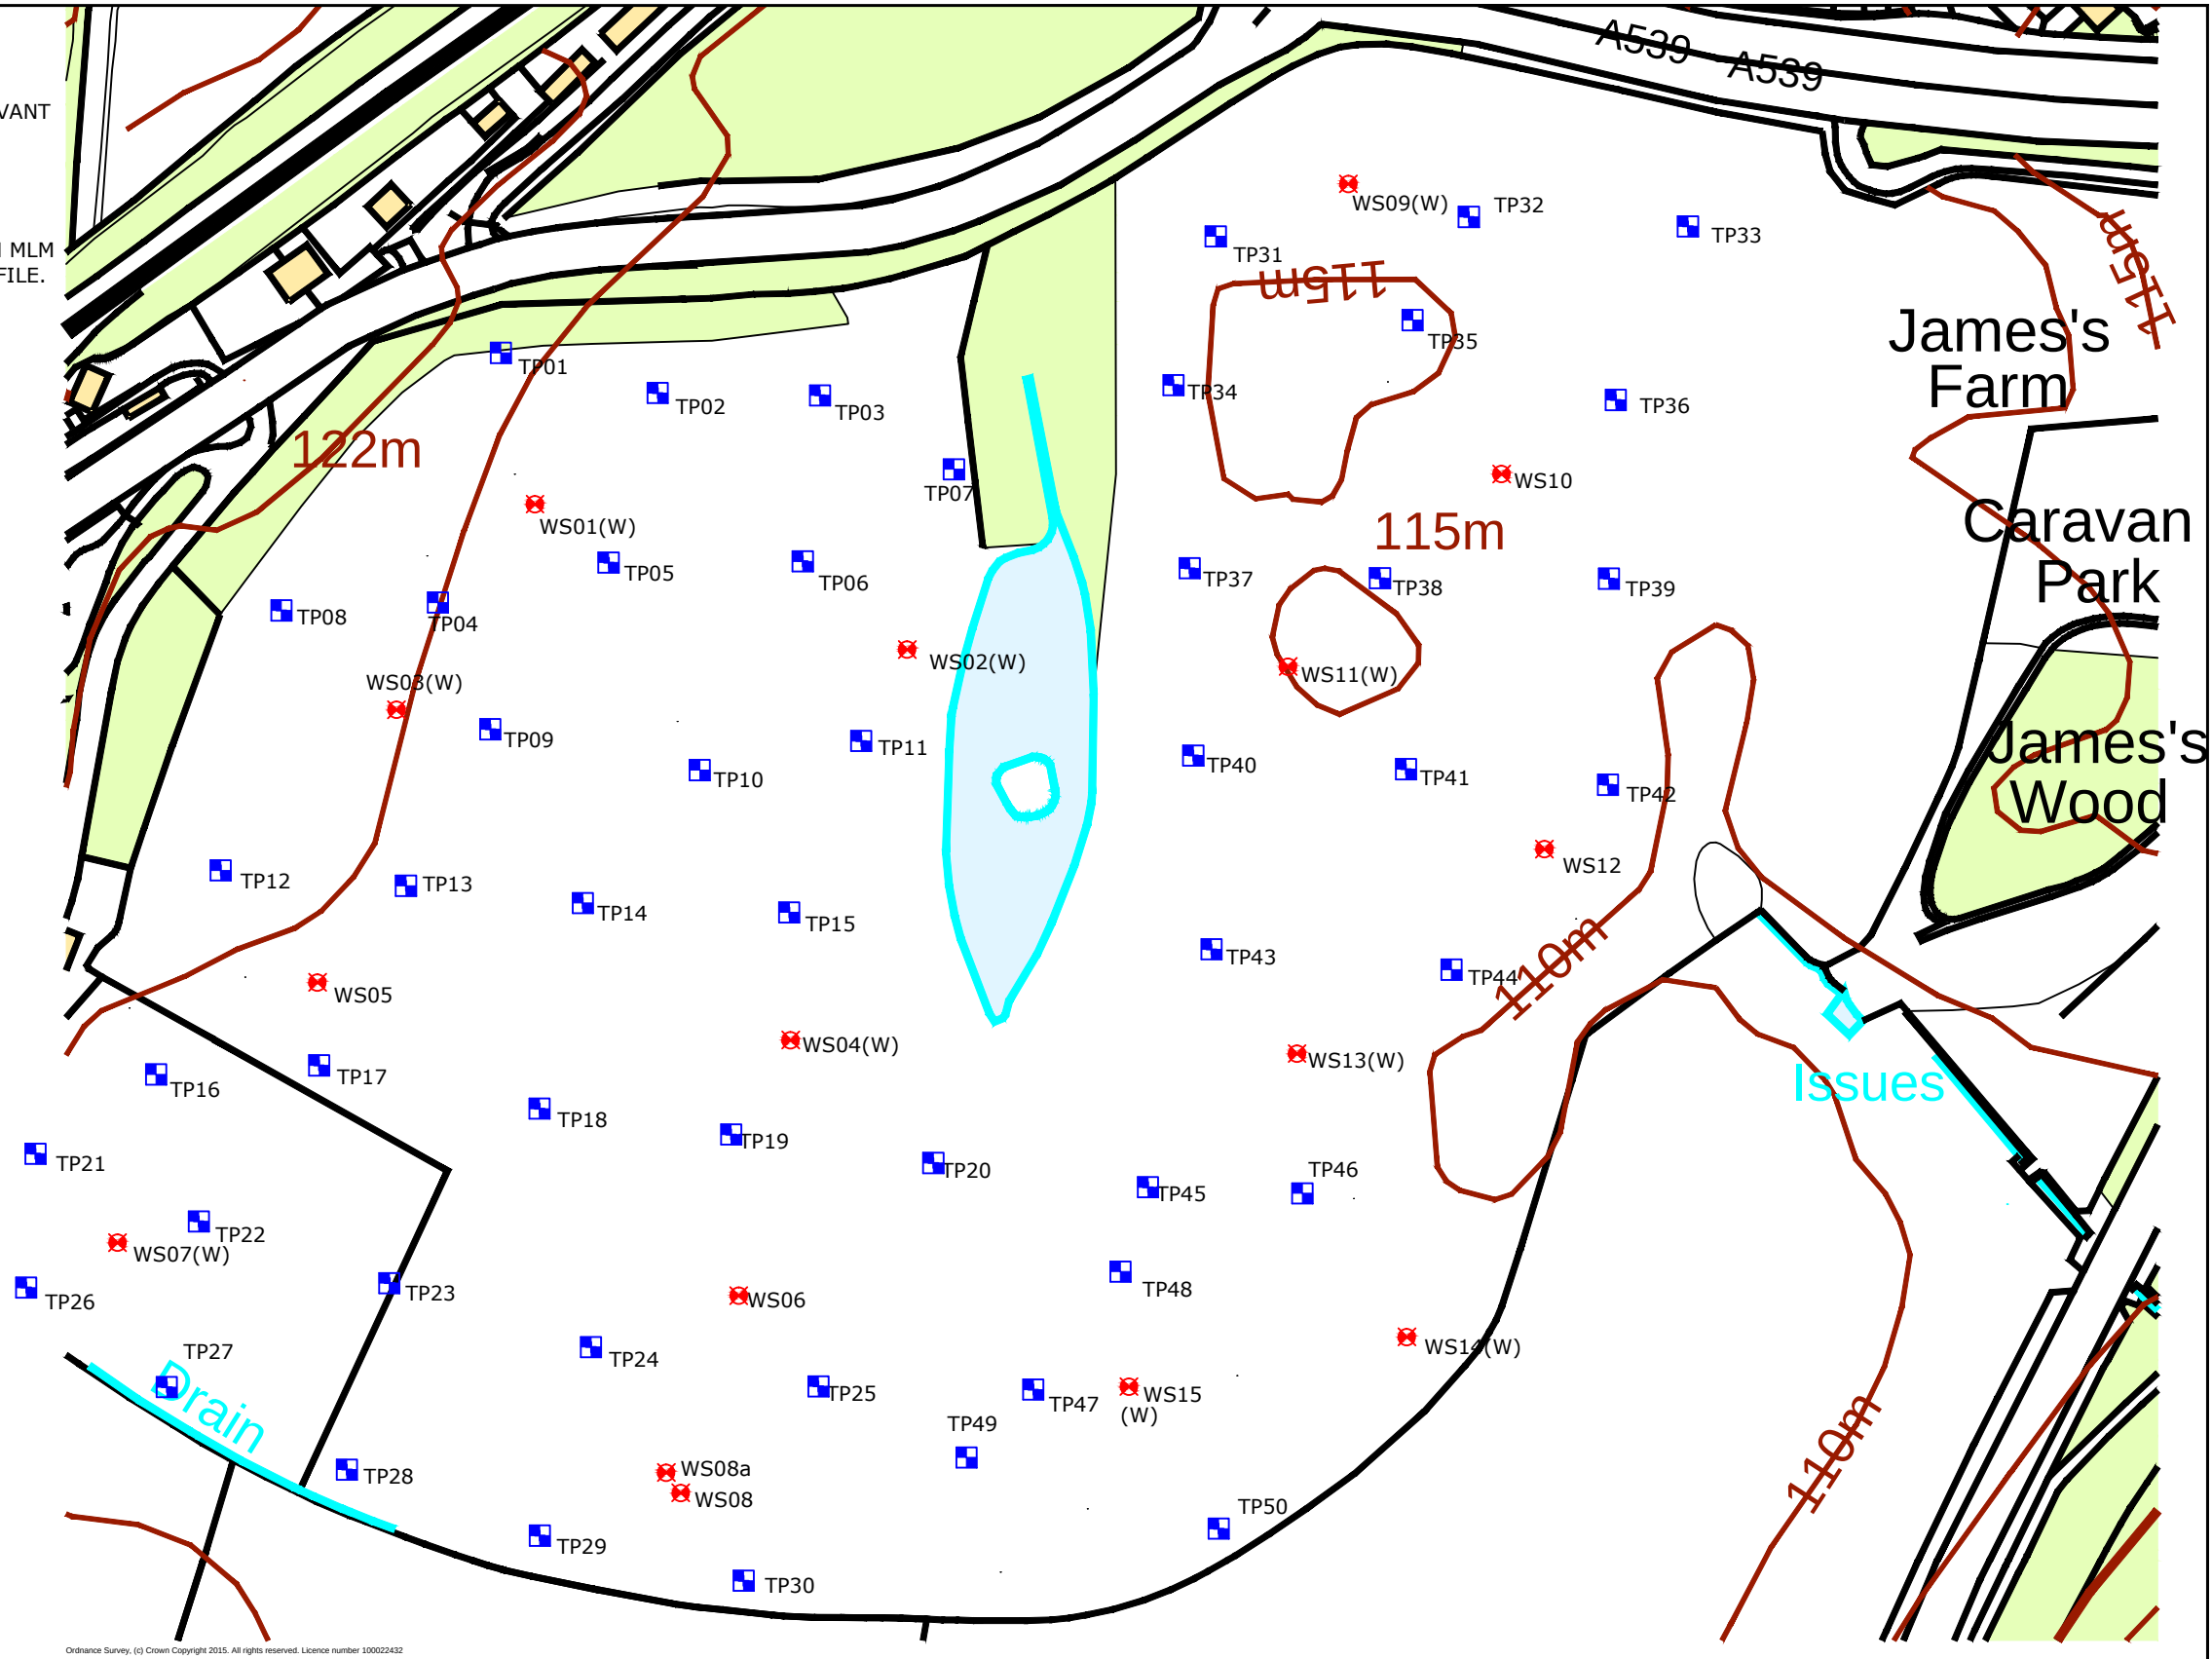
WS1

(W)

TRIAL PIT LOCATION

WINDOWLESS SAMPLER BOREHOLE LOCATION

MONITORING WELL LOCATION



Ordnance Survey, (c) Crown Copyright 2015. All rights reserved. Licence number 100022432

COPYRIGHT © MLM CONSULTING ENGINEERS LTD

					MLM MLM Environmental		Drawing Status: FINAL ISSUE		Drawing Title: EXPLORATORY HOLE LOCATION PLAN					
					Client: CARTER JONAS		Drawn/Design		ER	Date	OCT 2015	Scales	NTS	@ A1
							Checked		HD	Approved	DG	1:2500 @ A3		
Project: RUABON PARK, WREXHAM		Drawing No. 773135-DWG-ENV-001					Rev .							
Rev	Date	Description			Made	Ckd								

Building 7200, Cambridge Research Park, Cambridge, CB25 9TL
Tel: 01223 632800 Fax: 01223 815630
Website: www.mlm.uk.com



Appendices


Appendix A:	Exploratory Hole Logs
Appendix B:	Gas and Groundwater Monitoring Results
Appendix C:	Geotechnical Test Results
Appendix D:	Results of Chemical Analysis
Appendix E:	Soakaway Test Results
Appendix F:	Generic Assessment Criteria
Appendix G:	Defining Risk


Appendix A

Exploratory Hole Logs

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP01
	Project ID:	773135	Start:	21/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:25
Project Engineer:	Hugh Dyer	Co-ordinates:	329592.14E - 343398.13N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.30	D1			0.50		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.50	
1.00	B1			1		Orange brown slightly clayey SAND and GRAVEL, becoming less clayey with depth. Gravel of fine to coarse angular to sub-rounded quartzite, sandstone and quartz. Cobbles of sandstone and quartzite.	1.50	
1.00	D2			2 2.00		Firm grey to brown gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and quartz.	1.00	
3.50		120		3 3.00		Stiff grey to brown sandy CLAY.	1.00	
4.00		125		4 4.00		End of trial pit at 4.00 m		

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.50m	Dimensions:  Stability: Stable
--	---

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP02	
			Project ID: 773135			Start: 21/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329638.26E - 343398.90N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.80	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.70		MADE GROUND: Light brown to brown sand and gravel. Gravel of fine to coarse angular to sub-rounded, sandstone, concrete, quartzite, quartz, wood and brick.	0.40		
				1.00		Firm grey gravelly very sandy CLAY. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.40		
2.20	D2			2.10		Brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.90		
				3.00		Firm grey gravelly very sandy CLAY. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.50		
				3.50		Firm to stiff grey to brown silty CLAY.	1.00		
4.00		70		4.00					
4.50		105		4.50					
						End of trial pit at 4.50 m			
Notes:						Dimensions:			
Shear strengths recorded using Pilicon Hand Shear Vane									
Remarks						Stability: Stable			
Live roots to 0.30m. Slow GW seepage at 4.50m									

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP03	
			Project ID: 773135			Start: 21/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329693.72E - 343398.09N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.20	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				1.10		MADE GROUND: Light brown to brown sand and gravel. Gravel of fine to coarse angular to sub-rounded, sandstone, quartzite, quartz, concrete and brick. Cobbles of sandstone, quartzite and brick.	0.80		
1.20	D2			2.30		Firm brown to dark brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded quartzite and sandstone. Cobbles and boulders of sandstone and quartzite.	2.30		
3.50	D3	70		3.40		Firm grey to brown silty CLAY. Decayed roots.	0.10		
3.50				3.50		End of trial pit at 3.50 m			

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m



Dimensions:


0.80m

2.80m


Stability: Stable


 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP04
	Project ID:	773135	Start:	21/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):	1:25	
Project Engineer:	Hugh Dyer	Co-ordinates:	329559.64E - 343343.27N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING				STRATA				
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
1.00	D1			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40	
				1.10		MADE GROUND: Light brown to brown silty sand and gravel. Gravel of fine to coarse sub-angular to rounded sandstone, quartzite and brick, Cobbles of sandstone and quartzite.	0.70	
				2.50		Soft grey gravelly very sandy CLAY. Gravel of fine to coarse sandstone and quartzite. Cobbles of sandstone and quartzite.	1.40	
2.00	D2			4.50		Grey gravelly SAND. Gravel of fine to medium sub-angular to rounded sandstone and quartzite.	2.00	
4.50	D3			4.50		End of trial pit at 4.50 m		

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.50m. Partial pit collapse at 4.50m. Slow GW seepage at 3.00m	Dimensions:  Stability: Unstable
---	---

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP05
	Project ID:	773135	Start:	21/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:25
Project Engineer:	Hugh Dyer	Co-ordinates:	329621.56E - 343340.93N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.30	D1			0.50		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.50	
				0.90		MADE GROUND: Brown sand and gravel. Gravel of fine to coarse sub-angular to rounded sandstone, quartzite, quartz and rare brick. Cobbles and boulders of sandstone and quartzite.	0.40	
				1.90		Brown SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone, quartzite and quartz. Cobbles and boulders of sandstone and quartzite.	1.00	
2.00		95		3.00		Very stiff grey to brown silty CLAY.	1.10	
3.00	D2	140		3.00	End of trial pit at 3.00 m			
3.00								

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.50m. Concrete pipe at 1.20m	Dimensions:  Stability: Stable
--	---

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP06	
			Project ID: 773135			Start: 21/09/2015			
			Location: Wrexham			Finish:		Level (mOD):	
			Client: Carter Jonas			Co-ordinates: 329687.85E - 343341.40N		1:25	
Project Engineer: Hugh Dyer					Sheet 1 of 1		Logged by: MM		
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.50	D1			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				1.10		MADE GROUND: Light brown to brown sand and gravel. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and brick. Cobbles and boulders of sandstone and quartzite.	0.70		
1.50	D2			2.70		Firm grey sandy gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite.	1.60		
3.00	D3	82		3.00		Stiff grey to brown sandy CLAY.	0.30		
3.00				End of trial pit at 3.00 m					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m

Dimensions:

0.80m

2.80m


Stability: Stable

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP07	
			Project ID: 773135			Start: 21/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329733.22E - 343340.01N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.80	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.80		MADE GROUND: Dark brown to brown sand and gravel. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and brick. Cobbles and boulders of sandstone.	0.50		
				1.40		Brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone.	0.60		
2.00	D2 B1			2.00		Grey gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone.	1.80		
2.00									
3.50	D3	140		3.20		Stiff grey to brown sandy CLAY.	0.50		
3.70									
				3.70	End of trial pit at 3.70 m				
				4.00					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane

Remarks
Live roots to 0.40m

Dimensions:



Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP08			
			Project ID: 773135			Start: 21/09/2015					
			Location: Wrexham			Finish:		Level (mOD):		1:25	
			Client: Carter Jonas			Co-ordinates: 329519.94E - 343289.23N		Sheet 1 of 1			
Project Engineer: Hugh Dyer					Logged by: MM						
INSITU TEST/SAMPLING			STRATA								
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)			
				0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30				
0.50	B1					Brown to light brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80				
1.00	D1			1.10		Grey to brown sandy gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.70				
				2.80		Grey gravelly very sandy clay. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone.	0.70				
3.50	D2			3.50	End of trial pit at 3.50 m						

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m. Partial pit collapse at 3.50m

Dimensions:

0.80m

2.80m

Stability: Unstable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham Client: Carter Jonas Project Engineer: Hugh Dyer			Method: TP Start: 21/09/2015 Finish: Level (mOD): Co-ordinates: 329581.11E - 343284.02N		TP09 1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.20	D1			0.20		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				0.40		Red brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.20		
				0.60		Brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80		
1.50	D2			1.40		Firm brown gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.60		
				2.00		Firm grey to dark grey gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.50		
3.50	D3			3.50	End of trial pit at 3.50 m				

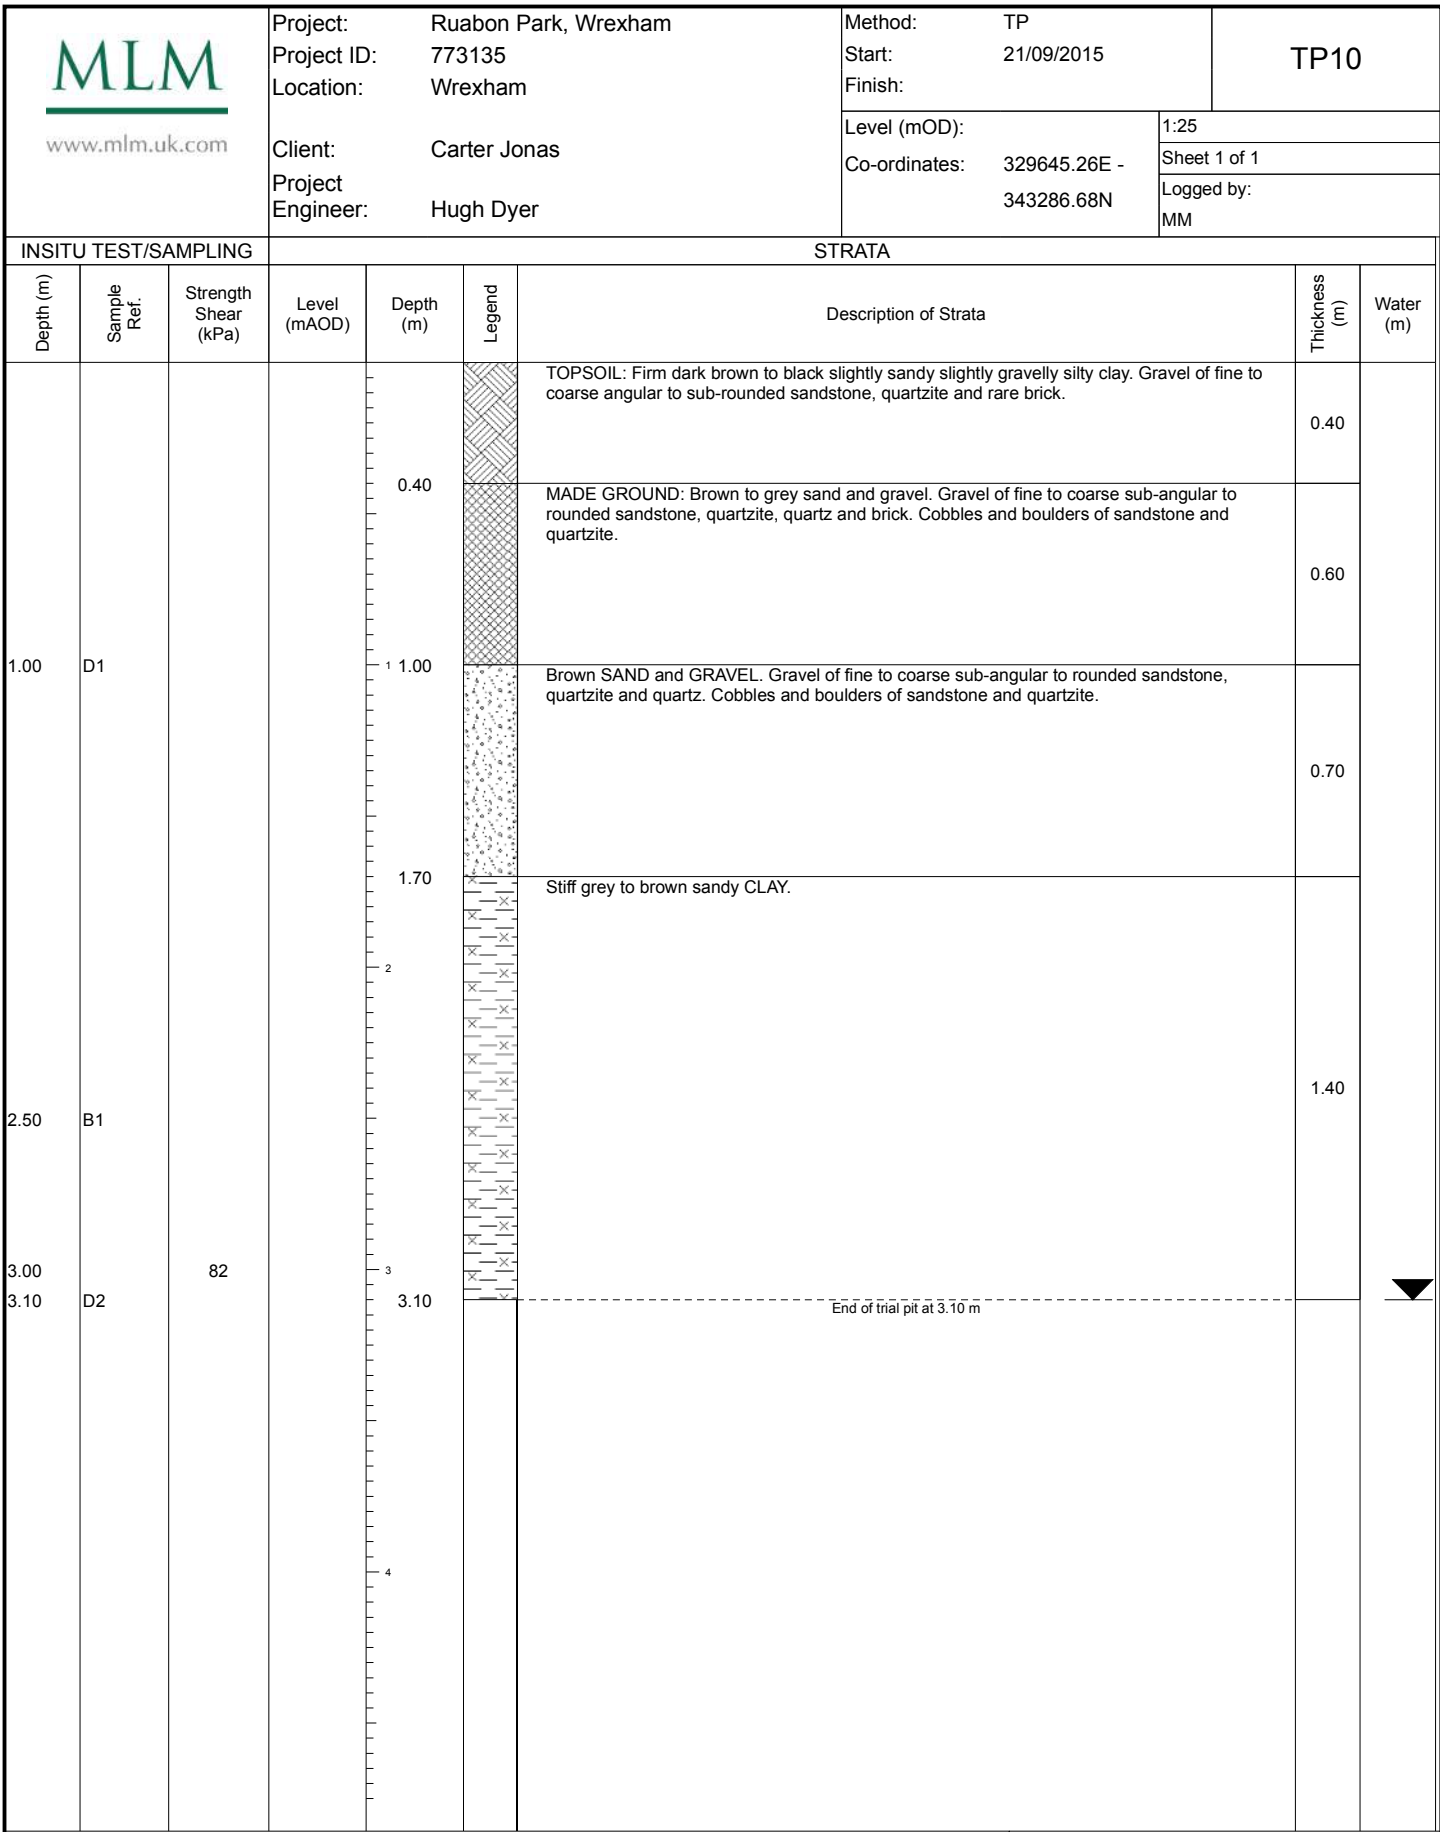
Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.50m. Partial pit collapse at 3.50m

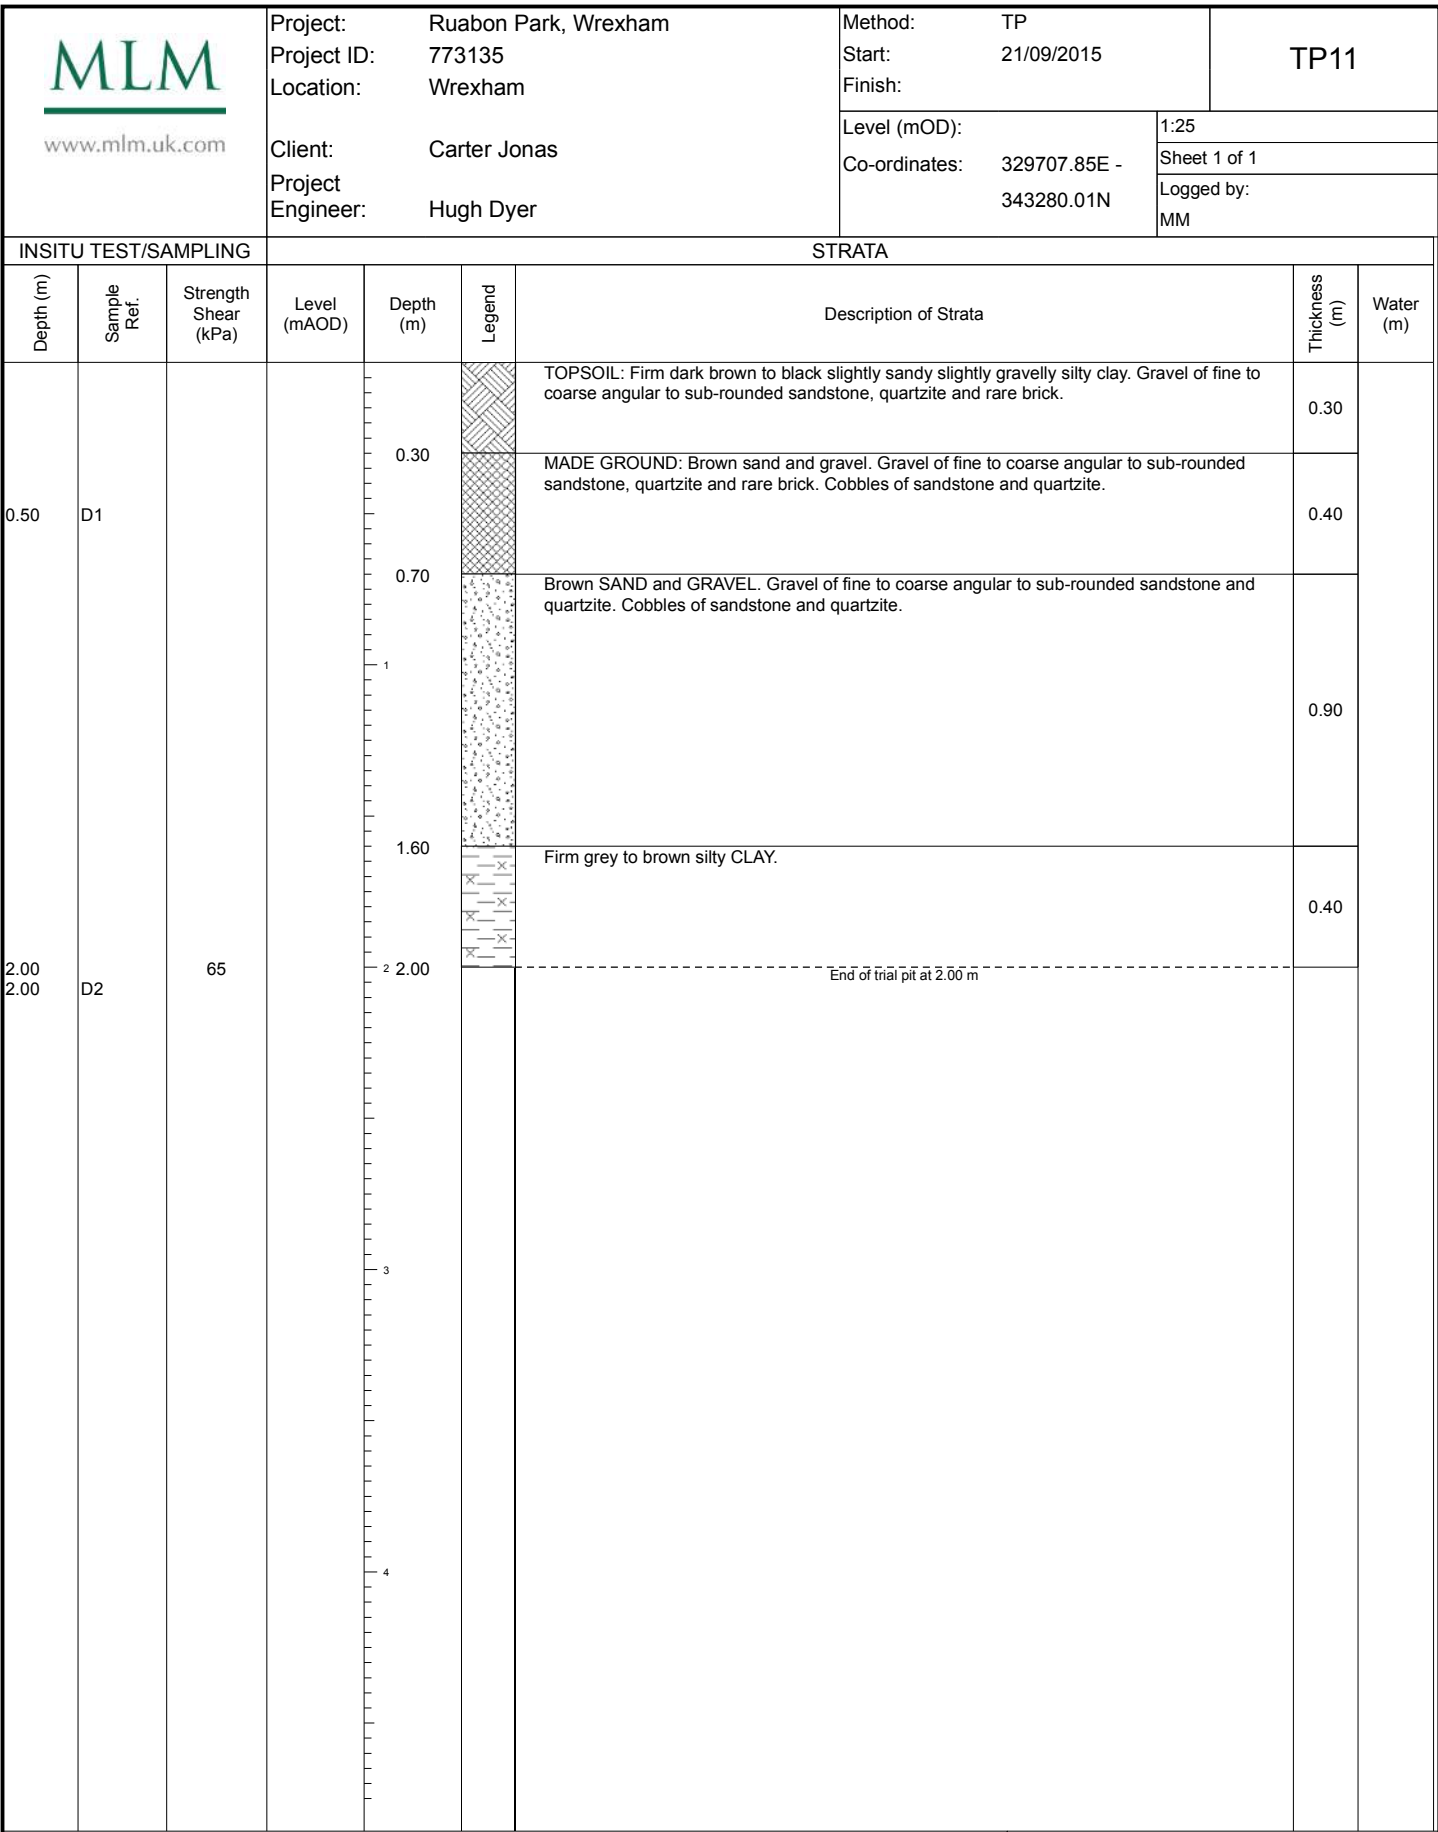
Dimensions:

0.80m

2.80m

Stability: Unstable





MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham			Method: TP Start: 24/09/2015 Finish:		TP12	
			Client: Carter Jonas Project Engineer: Hugh Dyer			Level (mOD): Co-ordinates: 329488.90E - 343235.78N		1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.00	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				1.00		Brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.90		
				1.20		Brown clayey gravelly SAND. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80		
				2.00	End of trial pit at 2.00 m				
				3					
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m

Dimensions:

0.80m

2.80m

Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP13	
			Project ID: 773135			Start: 21/09/2015			
			Location: Wrexham			Finish:		Level (mOD):	
			Client: Carter Jonas			Co-ordinates: 329552.22E - 343230.54N		1:25	
Project Engineer: Hugh Dyer					Sheet 1 of 1		Logged by: MM		
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.00	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				1.10		Brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80		
1.50	D2			2		Soft to firm grey to dark grey sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	2.70		
3.50	D3			3					
				3.80		End of trial pit at 3.80 m			
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m. Partial pit collapse at 3.80m. Slow GW seepage at 3.80m

Dimensions:

0.80m

2.80m

Stability: Unstable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham Client: Carter Jonas Project Engineer: Hugh Dyer			Method: TP Start: 21/09/2015 Finish:		TP14	
						Level (mOD): Co-ordinates: 329612.66E - 343224.63N		1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.30	D1	85		0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
1.50	B1			1.10		Firm brown to grey silty CLAY. Root traces throughout.	0.70		
				1.10		Stiff grey to brown silty CLAY. Root traces throughout	1.30		
				2.00					
2.00	D2			2.40			End of trial pit at 2.40 m		

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.40m. Slow GW seepage at 2.40m


Dimensions:


0.80m



2.80m


Stability: Stable

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP15
	Project ID:	773135	Start:	22/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:25
Project Engineer:	Hugh Dyer	Co-ordinates:	329683.22E - 343221.44N	Sheet 1 of 1	
				Logged by:	
				MM	

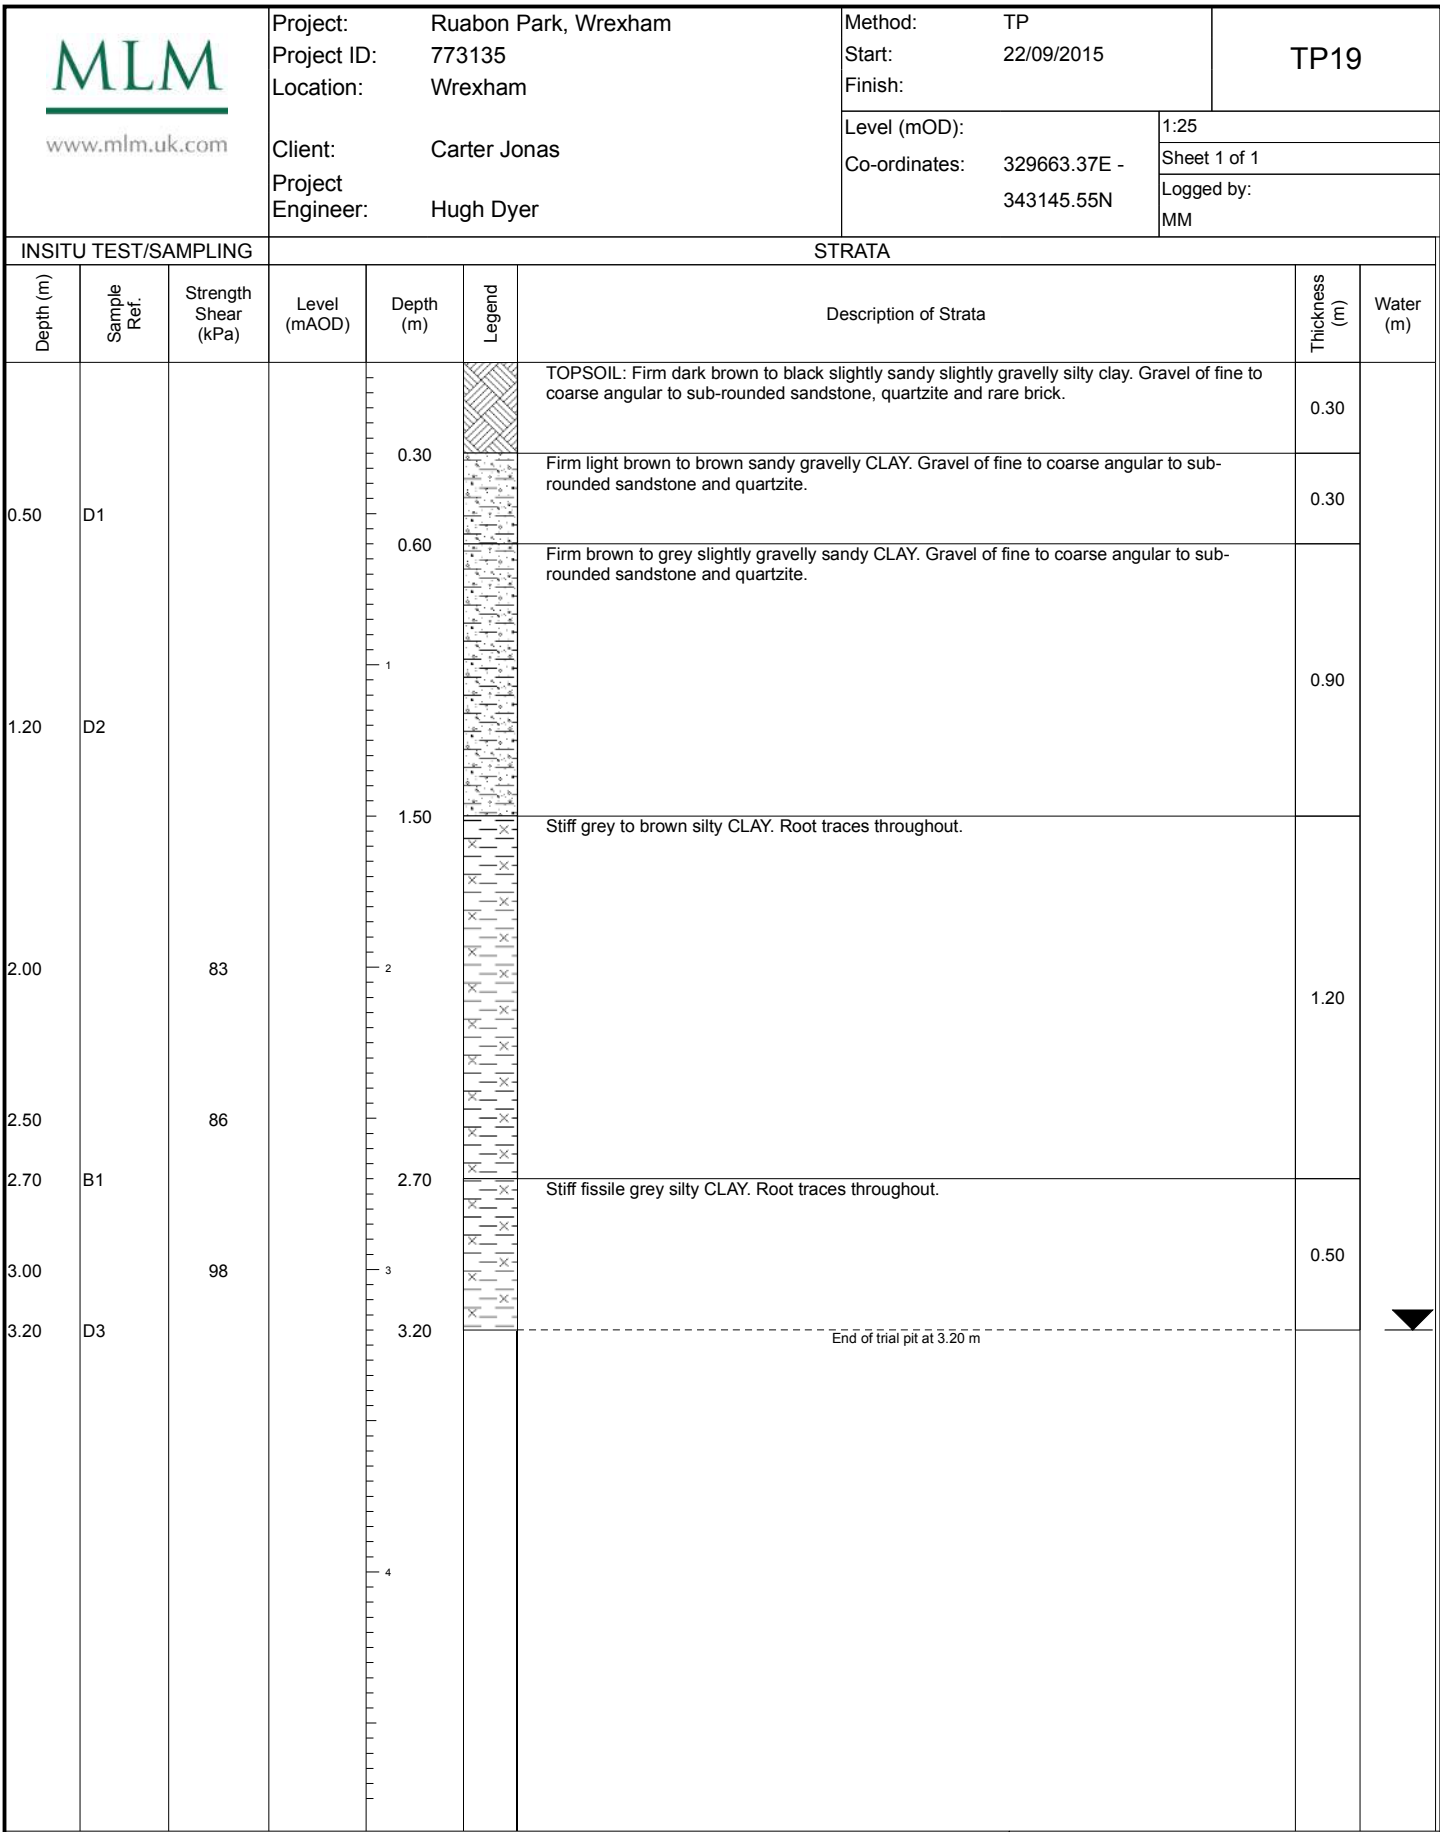
INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.50	D1			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40	
				0.80		Brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40	
1.00		62		1		Firm to stiff brown to grey silty CLAY.	1.20	
1.50		78		2	2.00	Brown silty fine to coarse SAND.	0.30	
				2.30		Firm grey to brown sandy silty CLAY.	0.40	
3.00		90		3	2.70	Stiff to very stiff fissile grey silty CLAY.	1.40	
3.50		98						
4.00		92		4				
4.10	D2			4.10		End of trial pit at 4.10 m		

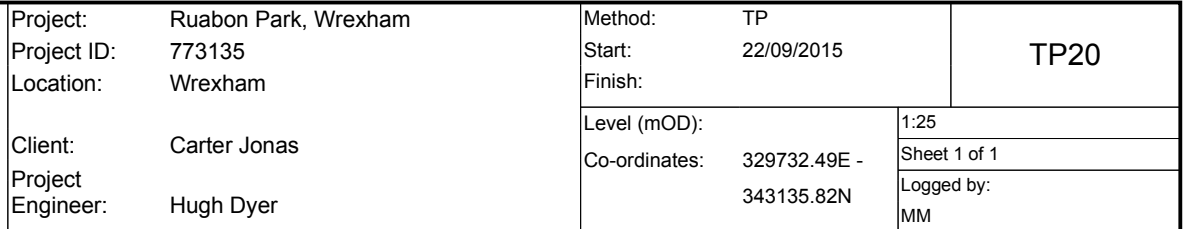
Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.40m. Slow GW seepage at 4.10m	Dimensions:  Stability: Stable
--	---

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP16	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329457.95E - 343188.80N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.50	D1			0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
				1		Brown to light brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.05		
2.00	B1			1.40		Firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	1.20		
				2.60		Firm to stiff grey gravelly sandy CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.30		
3.90	D2			3.90		End of trial pit at 3.90 m			
Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.35m									
Dimensions:  2.80m 0.80m Stability: Stable									

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP17	
			Project ID: 773135			Start: 22/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329522.51E - 343169.17N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.20	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.90		Brown to light brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.60		
1.50	D2			1.60		Brown very clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite	0.70		
				2.60		Firm brown slightly gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	1.00		
				3.30		Brown to grey clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.70		
3.50	D3			3.50		Brown to grey gravelly very sandy CLAY. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.20		
End of trial pit at 3.50 m 									
Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m. Slow GW seepage at 3.50m						Dimensions:  Stability: Stable			

Notes: Shear strengths recorded using Pilicon Hand Shear Vane	Dimensions:
Remarks Live roots to 0.30m	
	Stability: Stable





INSITU TEST/SAMPLING				STRATA				
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.10	D1			0.20		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.20	
				0.50		Light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.30	
0.60		85		1.00		Stiff to very stiff grey to brown silty CLAY.	0.70	
1.10	D2	140		1.20		Stiff to very stiff grey silty CLAY.	0.60	
1.50		140		1.80		Firm brown sandy gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40	
				2.20		Brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone.	0.70	
2.50	D3			2.90		End of trial pit at 2.90 m		
				3.00				
				4.00				


Dimensions:



2.80m

0.80m

Stability: Unstable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham			Method: TP Start: 24/09/2015 Finish:		TP21	
Client: Carter Jonas Project Engineer: Hugh Dyer			Level (mOD): Co-ordinates: 329425.52E - 343138.97N			1:25			
						Sheet 1 of 1			
						Logged by: MM			
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.20	D1			0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
				1.00		Brown to light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.65		
				2.20		Brown SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.20		
2.00	D2			2.20	End of trial pit at 2.20 m				
				3					
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.35m

Dimensions:

0.80m

2.80m

Stability: Stable

 www.mlm.uk.com		Project: Ruabon Park, Wrexham		Method: TP		TP22	
		Project ID: 773135		Start: 22/09/2015			
		Location: Wrexham		Finish:			
		Client: Carter Jonas		Level (mOD):		1:25	
Project Engineer: Hugh Dyer		Co-ordinates: 329481.38E - 343115.87N		Sheet 1 of 1			
				Logged by: MM			

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.20	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				0.70		Light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.40	
				1.10		Firm light brown to grey slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40	
2.00	D2			2.80		Firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	1.70	
3.00		85		4.10		Stiff to hard dark grey to purplish grey slightly gravelly slightly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.30	
4.00	D3	140		4.10		End of trial pit at 4.10 m		




Notes:
Shear strengths recorded using Pilcon Hand Shear Vane


Remarks
Live roots to 0.30m. Partial pit collapse at 4.10m

Dimensions:



Stability: Unstable


 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP23
	Project ID:	773135	Start:	22/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):	1:25	
Project Engineer:	Hugh Dyer	Co-ordinates:	329546.63E - 343094.79N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
1.00	D1			0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35	
				1.00		Light brown clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.85	
				1.20		Soft to firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	1.80	
2.80	D2			3.00		Stiff to hard dark grey to purplish grey slightly gravelly slightly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.50	
3.50		140		3.50	End of trial pit at 3.50 m			
				4.00				

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.40m. Partial pit collapse at 3.50m	Dimensions:  Stability: Unstable
---	---

 www.mlm.uk.com	Project: Ruabon Park, Wrexham	Method: TP	TP24
	Project ID: 773135	Start: 22/09/2015	
	Location: Wrexham	Finish:	
	Client: Carter Jonas	Level (mOD):	1:25
Project Engineer: Hugh Dyer	Co-ordinates: 329615.48E - 343072.94N	Sheet 1 of 1	
		Logged by: MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.20	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
						Firm brown to grey sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.80	
1.00	D2			1.10		Firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	0.50	
1.20	B1			1.60		Soft to firm grey gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	1.90	
				3.50		End of trial pit at 3.50 m		
				4				

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m. Slow GW seepage at 3.30m	Dimensions:  Stability: Stable
--	---


 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP25	
			Project ID: 773135			Start: 22/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329693.19E - 343059.49N		Sheet 1 of 1				
					Logged by: MM				

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
				0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				0.70		Light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40	
1.00	D1			1		Firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.90	
1.50	B1			2				
				2.60				
3.00		80		3		Firm to stiff grey to dark grey to purplish grey slightly sandy slightly gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	1.20	
3.50		94						
3.80	D2			3.80		End of trial pit at 3.80 m		
				4				

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane

Remarks
Live roots to 0.30m


Dimensions:




Stability: Stable

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP26
	Project ID:	773135	Start:	22/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):	1:25	
Project Engineer:	Hugh Dyer	Co-ordinates:	329422.42E - 343093.29N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
1.00	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				0.70		Light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.40	
				1.50		Light brown to grey sandy very gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80	
				3.70		Firm brown slightly gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	2.20	
3.70	D2			3.70		End of trial pit at 3.70 m		


Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m. Partial pit collapse at 3.70m. Slow GW seepage at 3.70m	Dimensions:  Stability: Unstable
---	---

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP27	
			Project ID: 773135			Start: 22/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329470.46E - 343059.25N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.50	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				1.20		Light brown firm gravelly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.90		
				2.40		Soft red brown to brown sandy gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone, quartzite and quartz. Cobbles and boulders of sandstone and quartzite.	1.20		
				3.80		Soft to firm grey sandy gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	1.40		
3.00	D2			3.80	End of trial pit at 3.80 m				
Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m									
Dimensions:  2.80m 0.80m Stability: Stable									

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP28	
			Project ID: 773135			Start: 22/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329532.01E - 343031.04N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.50 0.50	D1 B1			0.20		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.20		
				1.10		Firm brown slightly sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.90		
				2.80		Soft to firm brown to grey sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	1.70		
3.70	D2			3.80		Firm to stiff grey slightly gravelly slightly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.00		
				3.80	End of trial pit at 3.80 m				
				</					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane

Remarks
Live roots to 0.30m

Dimensions:


Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham			Method: TP Start: 22/09/2015 Finish:		TP29	
			Client: Carter Jonas Project Engineer: Hugh Dyer			Level (mOD): Co-ordinates: 329597.97E - 343008.51N		1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
				0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.70		Stiff light brown to grey slightly gravelly slightly sandy silty clay. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40		
1.50	D1			1		Firm brown to grey sandy very gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	2.00		
2.00	B1			2					
3.00		87		3		Stiff to hard grey to dark grey slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone, quartzite and claystone.	1.00		
3.50 3.50	D2	140		3.70					
						End of trial pit at 3.70 m			
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m

Dimensions:


0.80m

2.80m

Stability: Stable

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP30
	Project ID:	773135	Start:	22/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:25
Project Engineer:	Hugh Dyer	Co-ordinates:	329667.63E - 342993.11N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
1.00	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				0.70		Light brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40	
				1.80		Firm brown sandy gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.10	
2.00 2.00	D2	79		2		Stiff to hard dark grey to purplish grey slightly gravelly slightly gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.70	
3.00		140		3				
3.50 3.50	D3	140		3.50		End of trial pit at 3.50 m		
				4				

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m. Slow GW seepage at 3.30m	Dimensions:  Stability: Stable
--	---

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham			Method: TP Start: 24/09/2015 Finish:		TP31	
			Client: Carter Jonas Project Engineer: Hugh Dyer			Level (mOD): Co-ordinates: 329844.97E - 343462.98N		1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.30	D1			0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
1.00	D2			1		Brown to light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.05		
				1.40		Firm red brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.30		
				1.70		Brown silty SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.70		
3.40	D3			3.40	End of trial pit at 3.40 m				
				4					

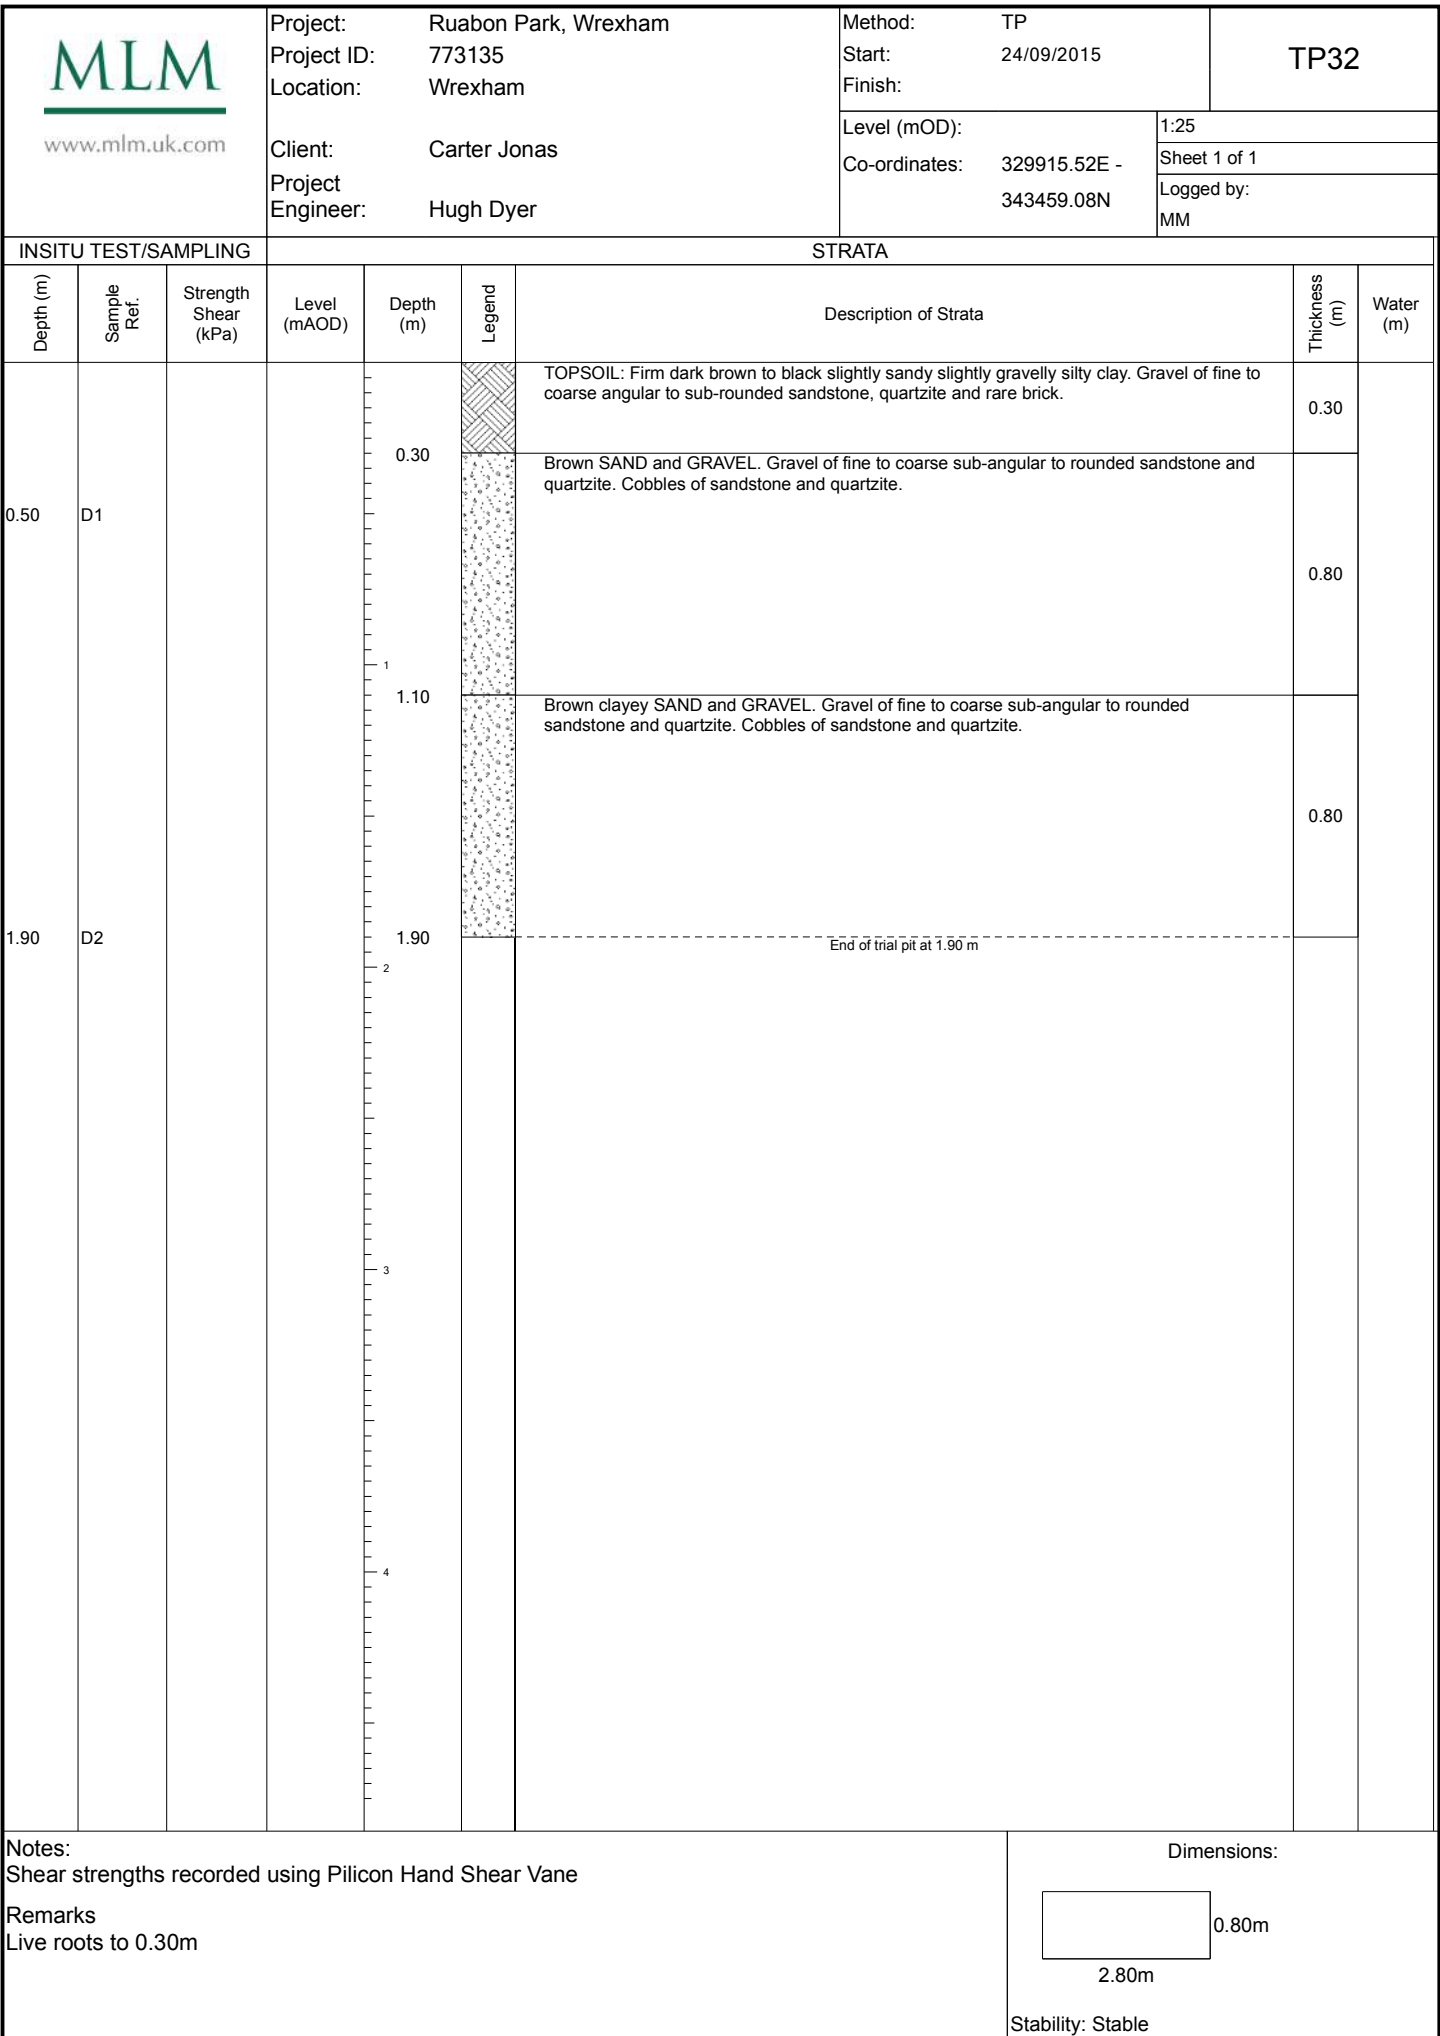
Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.35m. Partial pit collapse at 3.40m


Dimensions:

0.80m

2.80m

Stability: Unstable



MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP33	
			Project ID: 773135			Start: 24/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329990.39E - 343455.83N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.50	D1			0.45		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.45		
				0.90		Light brown to grey silty SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.45		
1.90	D2			1.90		Brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.00		
				End of trial pit at 1.90 m					


Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.45m

Dimensions:

0.80m

2.80m

Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham			Method: TP Start: 24/09/2015 Finish:		TP34	
			Client: Carter Jonas Project Engineer: Hugh Dyer			Level (mOD): Co-ordinates: 329814.54E - 343401.62N		1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.60	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.90		Dark brown to brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.60		
2.20	B1			1		Brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.30		
				2		Brown to green brown very clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.20		
				2.40		Brown SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.00		
3.40	D2			3.40		End of trial pit at 3.40 m			
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane

Remarks
Live roots to 0.30m. Slow GW seepage at 3.30m

0.80m

2.80m

Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP35	
			Project ID: 773135			Start: 24/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329888.04E - 343402.70N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.20	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.70		Brown to light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40		
				2.90		Light brown to orange brown SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	2.20		
2.90	D2			2.90		End of trial pit at 2.90 m			
				</					


Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.30m. Partial pit collapse at 2.90m

Dimensions:

0.80m

2.80m

Stability: Unstable

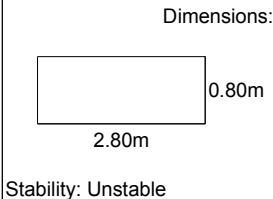
MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP36	
			Project ID: 773135			Start: 24/09/2015			
			Location: Wrexham			Finish:		1:25	
			Client: Carter Jonas			Level (mOD):		Sheet 1 of 1	
Project Engineer: Hugh Dyer			Co-ordinates: 329965.76E - 343396.54N		Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
						TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.50		
0.70	D1			0.50		Brown to orange brown silty SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40		
0.80	B1			0.90		Brown to orange brown SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.60		
				1.50		Brown to orange brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.40		
2.00	D2			2.90		End of trial pit at 2.90 m			
2.90	D3								




Notes:

Shear strengths recorded using Pilicon Hand Shear Vane


Remarks


Live roots to 0.50m. Partial pit collapse at 2.90m




 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP37	
			Project ID: 773135			Start: 24/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329820.11E - 343339.01N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.00	D1			0.60		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.60		
				1.80		Light brown to brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	1.20		
2.00	B1			2.60		Brown to red brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80		
				3.00		Brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40		
3.00	D2			3.00	End of trial pit at 3.00 m				
Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m. Partial pit collapse at 3.00m. Slow GW seepage at 2.75m									
Dimensions:  Stability: Unstable									

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP38
	Project ID:	773135	Start:	23/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):	1:25	
Project Engineer:	Hugh Dyer	Co-ordinates:	329885.17E - 343335.64N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
1.00	D1			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40	
				1.10		Light brown to brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.70	
				2.30		Firm brown to grey gravelly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	1.20	
2.00	D2			3.70		Brown silty SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.40	
3.70	D3			3.70	End of trial pit at 3.70 m			



Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.40m. Partial pit collapse at 3.70m. Slow GW seepage at 3.70m	Dimensions:  Stability: Unstable
---	---


 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP39
	Project ID:	773135	Start:	23/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:25
Project Engineer:	Hugh Dyer	Co-ordinates:	329963.43E - 343335.49N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
				0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35	
				1.10		Brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.75	
1.00	D1			1.10		Stiff to very stiff grey silty CLAY. Becoming sandy with depth.	1.30	
1.50		93		2.40		Brown to grey gravelly SAND. Gravel of fine to medium sub-rounded to rounded sandstone and quartzite.	0.90	
1.50	B1			3.30		Stiff red brown to purplish brown gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.30	
2.00		140		3.60	End of trial pit at 3.60 m			
3.50		86						
3.60	D2							

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.35. Slow GW seepage at 3.30m	Dimensions:  Stability: Stable
---	--

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	TP	TP40
	Project ID:	773135	Start:	23/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:25
Project Engineer:	Hugh Dyer	Co-ordinates:	329821.34E - 343275.03N	Sheet 1 of 1	
				Logged by:	
				MM	

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.20	D1	80		0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				1.10		Firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80	
				1.60		Firm grey to dark grey gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.50	
2.00	D2			2.30		Grey to purple grey slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.70	
2.30	B1			2.60		Firm to stiff purple grey to grey slightly gravelly sandy CLAY. Gravel of fine to coarse sub-rounded to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.30	
2.50								
2.60	D3					End of trial pit at 2.60 m		
				3				
				4				

Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m. Partial pit collapse at 2.80m. Slow GW seepage at 2.30m	Dimensions:  Stability: Unstable
---	---

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham			Method: TP Start: 23/09/2015 Finish:		TP41	
			Client: Carter Jonas Project Engineer: Hugh Dyer			Level (mOD): Co-ordinates: 329894.03E - 343270.38N		1:25 Sheet 1 of 1 Logged by: MM	
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.00	D1			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				0.80		Light brown to brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.40		
				1.80		Firm mottled brown grey to orange brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.00		
3.00	D2			3.00		Grey slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded. Cobbles of sandstone and quartzite.	1.20		
						End of trial pit at 3.00 m			
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.40m. Partial pit collapse at 3.00m. Slow GW seepage at 3.00m


Dimensions:

0.80m

2.80m

Stability: Unstable


 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP42	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329963.12E - 343265.06N		Sheet 1 of 1				
					Logged by:				
					MM				

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
				0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				1.00		Brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.70	
1.50	D1			1.70		Brown to orange brown very clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.70	
2.00	D2			2.50		Brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80	
3.00		140		3.10		Stiff to hard grey to purplish grey gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.60	
3.10	D3					End of trial pit at 3.10 m		
				4				




Notes:
Shear strengths recorded using Pilicon Hand Shear Vane

Remarks
Live roots to 0.30m

Dimensions:



Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP43	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:		1:25	
			Client: Carter Jonas			Level (mOD):		Sheet 1 of 1	
Project Engineer: Hugh Dyer			Co-ordinates: 329827.57E - 343208.82N		Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.00	D1	140		0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
				1.00		Brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.85		
				1.20		Very stiff dark grey to purple grey silty CLAY. Root traces throughout.	0.90		
				2.10		Very stiff dark grey to purple grey slightly sandy very gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.60		
				2.70		Dark grey to purple grey clayey SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.50		
3.00		140		3.20	End of trial pit at 3.20 m				
3.20	D2								

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.35m. Slow GW seepage at 3.10m

Dimensions:

0.80m

2.80m

Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP44	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329909.61E - 343201.87N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.00	D1			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				1.00		Firm light brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	1.00		
2.00	D2			140	2.40		Firm brown gravelly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.		1.00
2.50		140	3.00	3.50		Very stiff to hard grey to purple grey silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.10		
3.00									
3.50	D3								

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.40m

Dimensions:

0.80m

2.80m

Stability: Stable

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP45	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329805.86E - 343127.56N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
0.50	D1			0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
				0.80		MADE GROUND: Light brown to brown silty sand and gravel. Gravel of fine to coarse sub-angular to rounded sandstone, quartzite and brick, Cobbles and boulders of sandstone and quartzite.	0.45		
2.00	D2	140		2		Firm to stiff brown sandy gravelly CLAY. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.60		
2.50				2.40		Very stiff to hard grey to purplish grey slightly sandy slightly gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80		
3.00		140		3					
3.20	D3			3.20		End of trial pit at 3.20 m			
				4					

Notes:
Shear strengths recorded using Pilicon Hand Shear Vane




Remarks
Live roots to 0.35m




Dimensions:


0.80m

2.80m

Stability: Stable

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP46	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329876.41E - 343123.66N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
				0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
				0.60		Light brown to brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.25		
1.00	D1			1.40		Brown to red brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	0.80		
1.50	B1			2.20		Firm to very stiff brown to red brown slightly sandy very gravelly CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.80		
2.50		140		3.20		Very stiff to hard grey to purple grey gravelly silty CLAY. Gravel of fine to coarse sub-rounded to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.00		
3.00		140							
3.20	D2					End of trial pit at 3.20 m			
Notes: Shear strengths recorded using Pilcon Hand Shear Vane Remarks Live roots to 0.35m									
Dimensions:  2.80m 0.80m Stability: Stable									

 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP47	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329766.66E - 343058.42N		Sheet 1 of 1				
					Logged by:				
					MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.40	D1			0.50		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.50		
				0.80		Light brown to brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.30		
				1.50		Brown to red brown clayey SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	0.70		
				2.20		Brown to dark brown gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.90		
3.00		82		3		Firm to stiff dark grey to purplish grey sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.30		
3.50		89							
3.70	D3			3.70		End of trial pit at 3.70 m			
				4					
Notes: Shear strengths recorded using Pilicon Hand Shear Vane Remarks Live roots to 0.30m						Dimensions:  Stability: Stable			

MLM www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP48	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329836.62E - 343063.15N		Sheet 1 of 1				
					Logged by: MM				
INSITU TEST/SAMPLING			STRATA						
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)	
1.50	D1			0.35		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.35		
				0.90		Brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.55		
				1.50		Stiff brown to red brown slightly sandy very gravelly CLAY. Gravel of fine to coarse angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.10		
2.20	B1			2.00		Brown slightly clayey SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.20		
3.50				3.20		Very stiff to hard grey to purplish grey slightly sandy slightly gravelly silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite.	0.30		
3.50	D2	140		3.50	End of trial pit at 3.50 m				
				4					

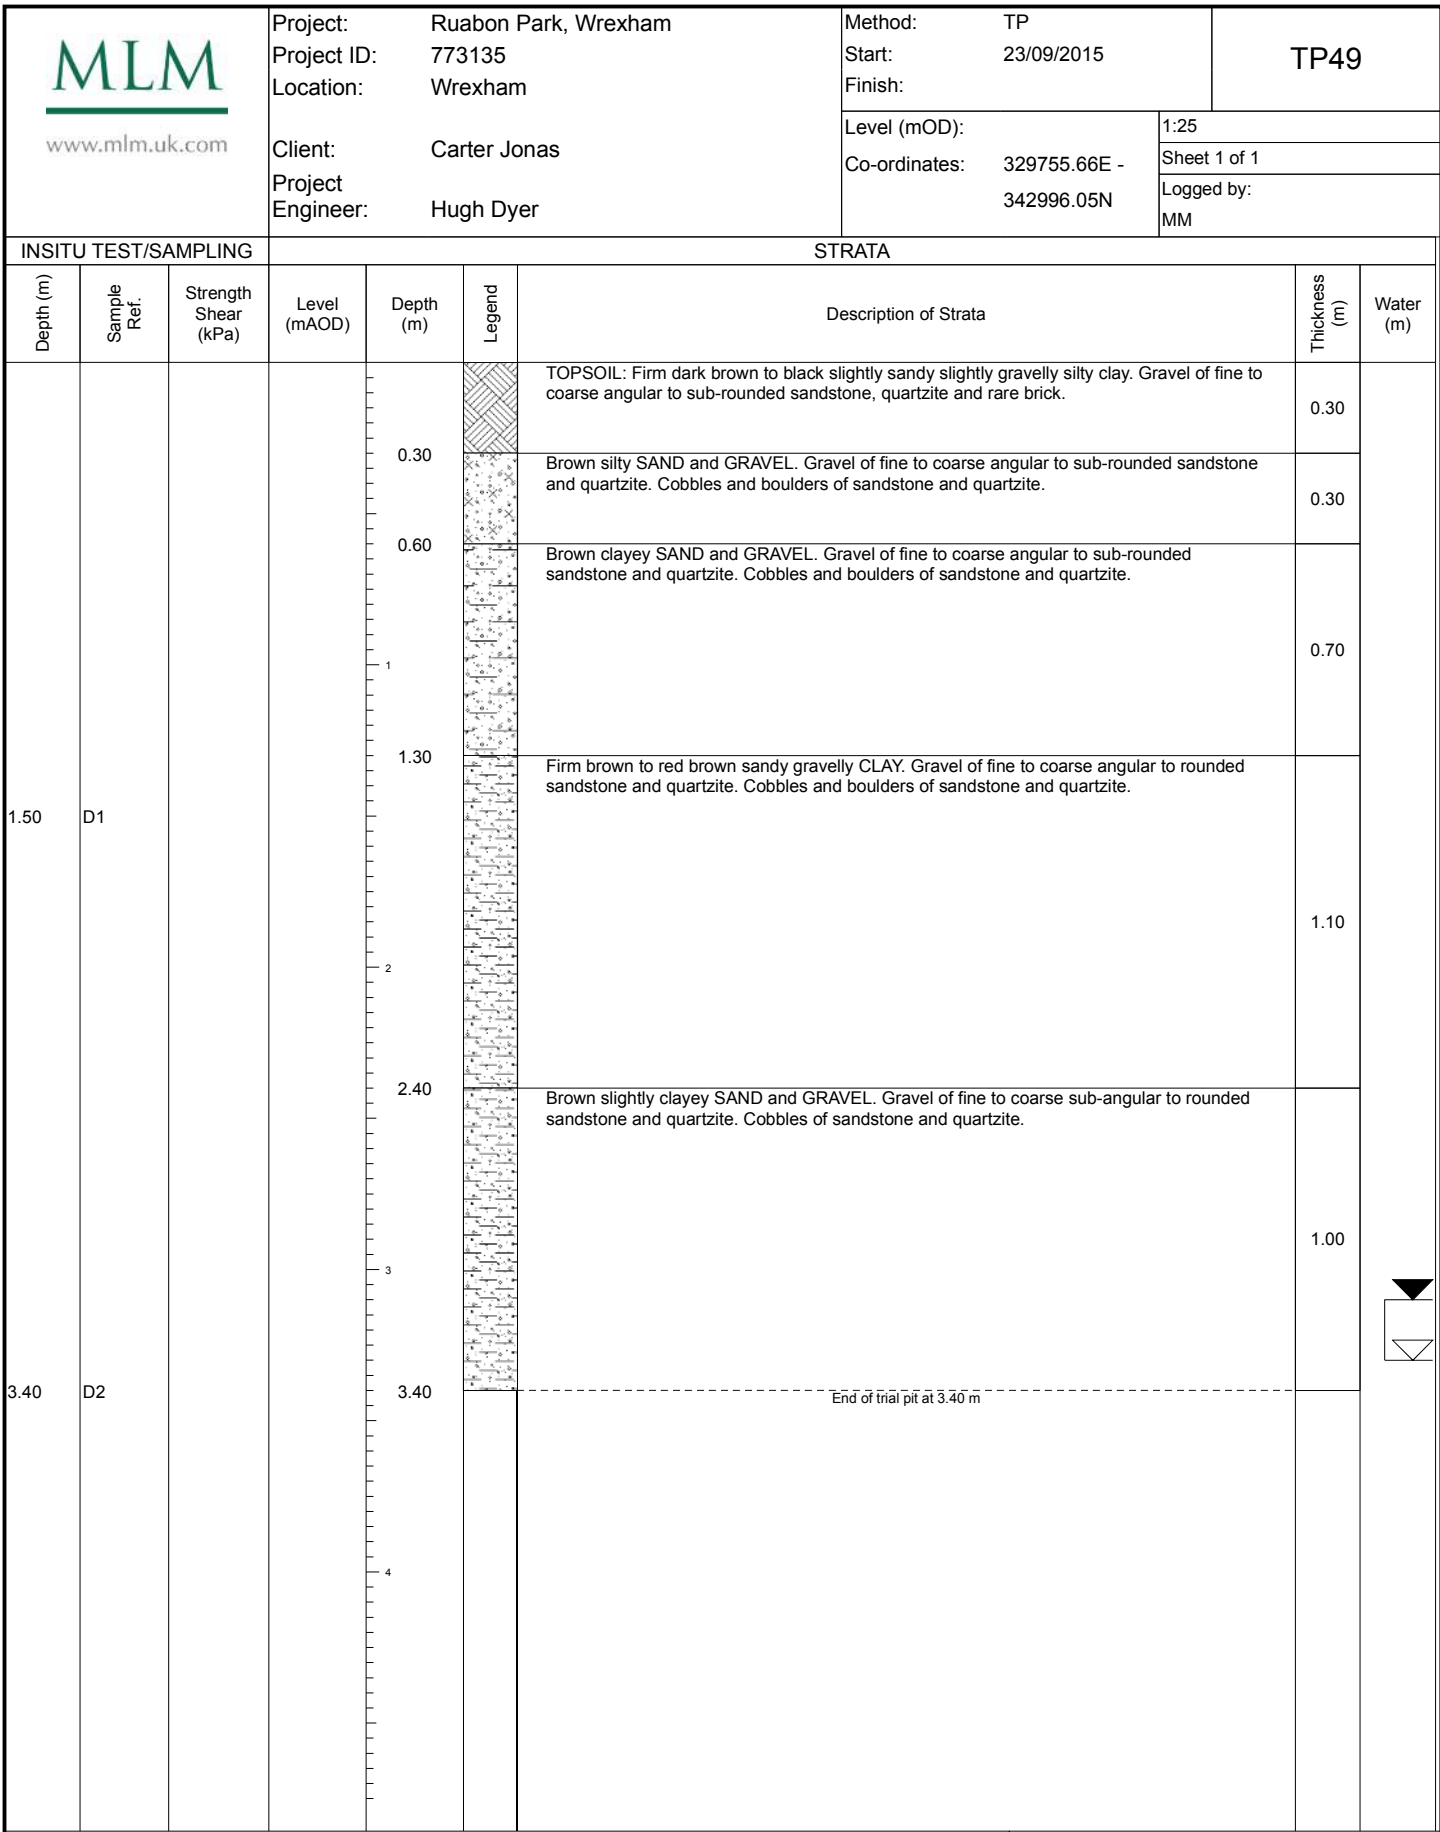
Notes:
Shear strengths recorded using Pilicon Hand Shear Vane
Remarks
Live roots to 0.35m. Partial pit collapse at 3.50m. Slow GW seepage at 3.10m

Dimensions:

0.80m

2.80m

Stability: Unstable



 www.mlm.uk.com			Project: Ruabon Park, Wrexham			Method: TP		TP50	
			Project ID: 773135			Start: 23/09/2015			
			Location: Wrexham			Finish:			
			Client: Carter Jonas			Level (mOD):		1:25	
Project Engineer: Hugh Dyer			Co-ordinates: 329830.00E - 343010.87N		Sheet 1 of 1				
					Logged by:				
					MM				

INSITU TEST/SAMPLING			STRATA					
Depth (m)	Sample Ref.	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Water (m)
0.20	D1			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30	
				0.80		Light brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite. Boulders of sandstone.	0.50	
1.50	D2			2.40		Firm to stiff red brown to red slightly sandy very gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	1.60	
2.80	B1			3.30		Firm brown gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite. Cobbles and boulders of sandstone and quartzite.	0.90	
3.50		140		3.70		Stiff to hard grey to purplish grey slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite. Cobbles of sandstone and quartzite.	0.40	
3.70	D3					End of trial pit at 3.70 m		


Notes:

Shear strengths recorded using Pilicon Hand Shear Vane

Remarks

Live roots to 0.30m. Slow GW seepage at 3.70m

Dimensions:



Stability: Stable

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	WS	WS01
	Project ID:	773135	Start:	25/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:50
Project Engineer:	Hugh Dyer	Co-ordinates:	329589.59E - 343371.22N	Sheet 1 of 1	Logged by:
				MM	

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
D1 : 0.90m 1.00	N=16 (13,10/6,4,3,3) ()			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.60		Grey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.30		
				1.00		Orange brown to brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.40		
D2 : 1.50m 2.00	N=12 (4,2/3,3,3,3) ()			1.00		Firm brown gravelly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.			
2.00				2.00					
3.00	N=13 (2,2/3,3,4,3) ()			3.00			4.00		
4.00	N=36 (3,4/6,6,11,13) ()			4.00					
D3 : 4.90m 5.00	50 (24 for 105mm/50 for 225mm) ()			5.00		End of borehole at 5.00 m			
				6.00					
				7.00					
				8.00					
				9.00					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks Refusal at 5.00m. GW at 3.00m. Live roots to 0.30m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
		3.00			

 www.mlm.uk.com	Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham		Method: WS Start: 25/09/2015 Finish:		WS02
	Client: Carter Jonas Project Engineer: Hugh Dyer		Level (mOD): Co-ordinates: 329697.58E - 343317.18N		
			1:50 Sheet 1 of 1 Logged by: MM		

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
D1 : 0.70m				0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
1.00	N=37 (10,8/10,8,10,9) ()			1.50		Brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.10		
D2 : 1.80m				2.70		Firm to stiff brown gravelly sandy CLAY. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite.	1.20		
2.00	N=17 (6,4/4,5,4,4) ()			3.00		Firm to stiff brown to grey silty CLAY. Occasionally sandy.	2.30		
3.00	N=24 (5,5/5,6,6,7) ()	57		4.00					
3.00				5.00					
4.00	N=20 (6,4/4,5,5,6) ()	78							
4.00									
D3 : 4.90m									
5.00	N=26 (6,6/6,7,6,7) ()	83							
5.00									
									
									
									
									
									
									
									
									
									
									
									
									
									


General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks GW at 4.00m. Live roots to 0.40m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
		4.00			

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	WS	WS03
	Project ID:	773135	Start:	25/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):	1:50	
Project Engineer:	Hugh Dyer	Co-ordinates:	329549.94E - 343289.78N	Sheet 1 of 1	
				Logged by:	
				MM	

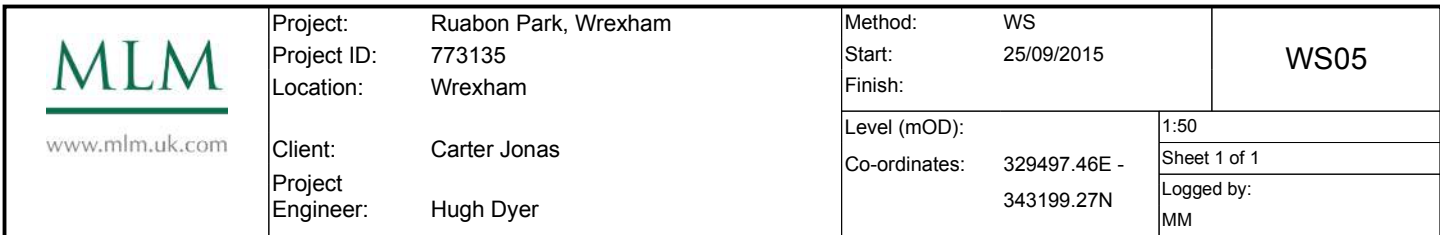
Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
D1 : 0.90m 1.00	N=9 (4,2/2,2,2,3) ()			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
D2 : 1.50m				1.20		Brown to light brown slightly clayey silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.90		
2.00	N=9 (1,2/1,2,3,3) ()			2.00		Firm brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.80		
3.00	N=29 (11,8/6,8,7,8) ()			2.85		Soft to firm dark brown slightly gravelly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.85		
4.00 D3 : 4.00m	50 (8,6/50 for 135mm) ()			4.30		Dark brown to grey gravelly silty SAND. Becoming gravelly very clayey sand. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.45		
				4.30		End of borehole at 4.30 m			
				5					
				6					
				7					
				8					
				9					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks Refusal at 4.30m due to boulder. Live roots to 0.30m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	WS	WS04
	Project ID:	773135	Start:	25/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:50
Project Engineer:	Hugh Dyer	Co-ordinates:	329683.75E - 343177.86N	Sheet 1 of 1	Logged by:
				MM	

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst'/ Backfill	Water (m)
D1 : 0.90m 1.00	N=14 (3,3/3,4,3,4) ()	80		0.20		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.20		
				0.50		Stiff orange brown to light brown slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.30		
				1.70		Firm to stiff brown to orange brown slightly gravelly silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.20		
D2 : 1.90m 2.00	N=11 (3,2/2,3,3,3) ()	80		2.00		Firm to stiff brown to orange brown sandy very silty CLAY.	0.30		
2.50					Firm to stiff grey silty CLAY.	1.00			
3.00	N=20 (3,3/3,4,6,7) ()	80		3.00		Brown slightly gravelly silty SAND. Gravel of fine to medium angular to sub-rounded sandstone and quartzite.	1.00		
D3 : 3.90m 4.00	N=50 (25 for 110mm/50 for 260mm) ()			4.00	End of borehole at 4.00 m				
				5					
				6					
				7					
				8					
				9					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks Refusal at 4.00m. Live roots to 0.20m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)



Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst'/ Backfill	Water (m)	
D1 : 0.50m 1.00 D2 : 1.20m 2.00 D3 : 2.00m	N=17 (7,4/4,4,4,5) () 50 (5,4/50 for 75mm) ()			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30			
				1.00		Brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.70			
				2.35		Firm brown to dark brown sandy gravelly CLAY. Gravel of fine to coarse angular to sub-rounded quartzite and sandstone. Cobbles of sandstone and quartzite.	1.35			
				2.35	End of borehole at 2.35 m					
				3						
				4						
				5						
				6						
				7						
				8						
				9						

Remarks
Refusal at 2.35m due to boulder, Live roots to 0.30m


Water Strike Details. Recorded in metres below ground level (m bgl)				
Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)

 www.mlm.uk.com	Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham	Method: WS Start: 28/09/2015 Finish:	WS06
	Client: Carter Jonas Project Engineer: Hugh Dyer	Level (mOD): Co-ordinates: 329665.90E - 343090.44N	

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
				0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick. Stiff brown grey to orange brown silty CLAY.	0.30		
D1 : 0.90m 1.00	N=13 (3,3/3,4,3,3) ()			1			1.20		
D2 : 1.90m 2.00	N=31 (3,7/6,9,6,10) ()			2		Firm brown slightly gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.			
3.00	N=24 (4,3/4,6,6,8) ()			3			2.50		
D3 : 3.70m 4.00	N=50 (10,11/50 for 285mm) ()			4		End of borehole at 4.00 m			
				5					
				6					
				7					
				8					
				9					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks Refusal at 4.00m. GW at 3.00m. Live roots to 0.30m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
		3.00			

 www.mlm.uk.com	Project: Ruabon Park, Wrexham		Method: WS		WS07
	Project ID: 773135		Start: 28/09/2015		
	Location: Wrexham		Finish:		
	Client: Carter Jonas		Level (mOD):		1:50
Project Engineer: Hugh Dyer		Co-ordinates: 329453.63E - 343108.64N		Sheet 1 of 1	
				Logged by: MM	

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
D1 : 0.90m 1.00	N=20 (3,4/7,5,4,4) ()			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
			1.00	1.00		Firm to stiff brown to light brown slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.60		
D2 : 1.80m 2.00	N=21 (5,5/5,5,4,7) ()			2.00		Firm brown to light brown slightly gravelly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.00		
			3.00	3.00		Firm to light brown slightly gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.50		
			3.50	3.50		Stiff grey slightly gravelly sandy CLAY. Gravel of fine to medium angular to sub-rounded sandstone and quartzite.	0.50		
D3 : 3.90m 4.00 4.00	50 (25 for 135mm/50 for 170mm) ()	90		4.00		End of borehole at 4.00 m			
				5					
				6					
				7					
				8					
				9					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
		3.00			
Remarks Refusal at 4.00m. GW at 3.00m. Live roots to 0.40m					

 www.mlm.uk.com	Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham		Method: WS Start: 28/09/2015 Finish:		WS08
	Client: Carter Jonas Project Engineer: Hugh Dyer		Level (mOD): Co-ordinates: 329646.18E - 343023.17N		
			1:50 Sheet 1 of 1 Logged by:		
			MM		

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
				0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
1.00	N=15 (2,3/4,4,3,4) ()			1		Firm brown to grey slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.70		
2.00	N=50 (10,13/50 for 230mm) ()			2		End of borehole at 2.00 m			
				3					
				4					
				5					
				6					
				7					
				8					
				9					


General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks Refusal at 2.00m due to boulder. Live roots to 0.30m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)

 www.mlm.uk.com	Project:	Ruabon Park, Wrexham	Method:	WS	WS08a
	Project ID:	773135	Start:	28/09/2015	
	Location:	Wrexham	Finish:		
	Client:	Carter Jonas	Level (mOD):		1:50
Project Engineer:	Hugh Dyer	Co-ordinates:	E - N	Sheet 1 of 1	
				Logged by:	
				MM	

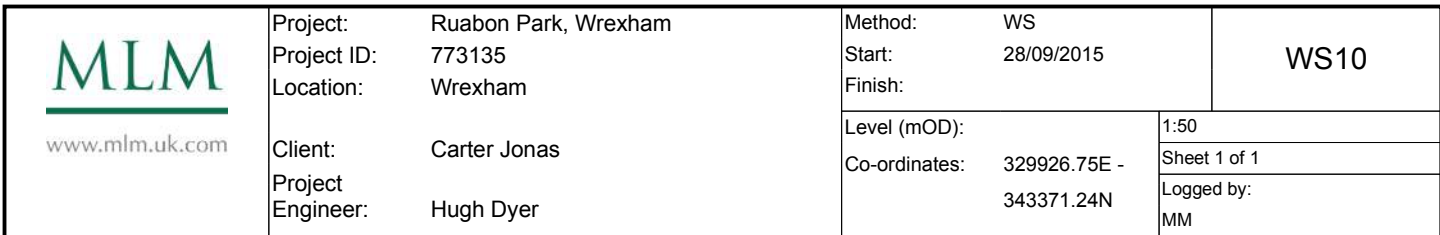
Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
D1 : 0.90m 1.00	N=12 (2,3/3,3,3,3) ()			0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				1.00		Firm to stiff brown to light brown slightly gravelly slightly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.70		
				2.00		Firm brown slightly gravelly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.00		
D2 : 1.90m 2.00	N=50 (5,9/50 for 235mm) ()			2.00		End of borehole at 2.00 m			
				3					
				4					
				5					
				6					
				7					
				8					
				9					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks Refusal at 2.00m due to boulder. Live roots to 0.30m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)

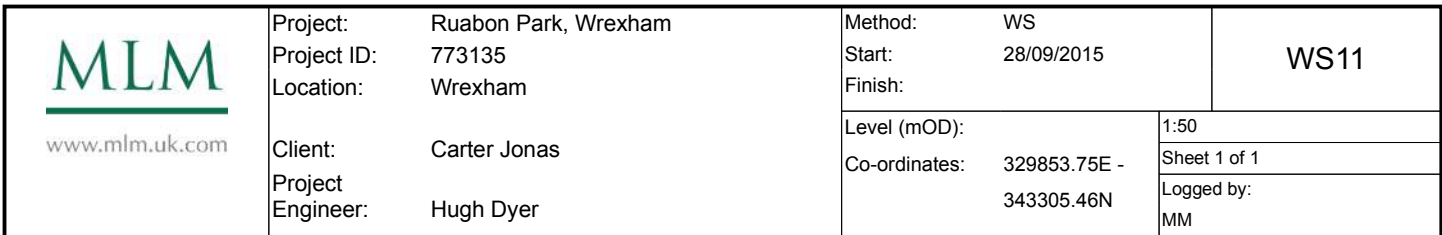
 www.mlm.uk.com	Project: Ruabon Park, Wrexham Project ID: 773135 Location: Wrexham	Method: WS Start: 28/09/2015 Finish:	WS09
	Client: Carter Jonas Project Engineer: Hugh Dyer	Level (mOD): Co-ordinates: 329879.18E - 343486.92N	

Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst/ Backfill	Water (m)
				0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
D1 : 0.90m 1.00	N=9 (3,2/3,2,2,2) ()			1		Brown to light brown slightly clayey gravelly SAND. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	2.60		
D2 : 1.90m 2.00	N=7 (2,1/2,2,1,2) ()			2					
3.00	N=1 (1,0/0,0,0,1) ()			3		Firm brown slightly gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.00		
4.00	N=2 (1,0/0,1,0,1) ()			4		Brown SAND and GRAVEL. Gravel of fine to coarse sub-angular to rounded sandstone and quartzite.	1.00		
D3 : 4.90m 5.00	N=8 (2,3/2,2,2,2) ()			5		End of borehole at 5.00 m			
				6					
				7					
				8					
				9					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks GW at 3.00m. Live roots to 0.40m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
		3.00			

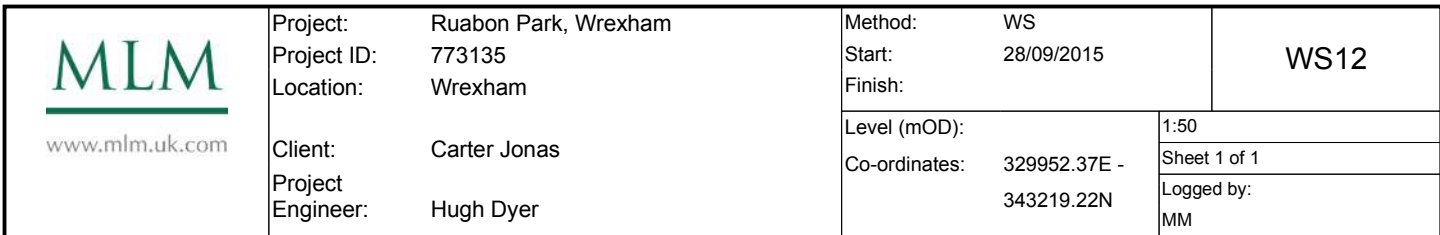


General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
Remarks Refusal at 3.00m due to boulder. GW at 3.00m. Live roots to 0.40m		3.00			

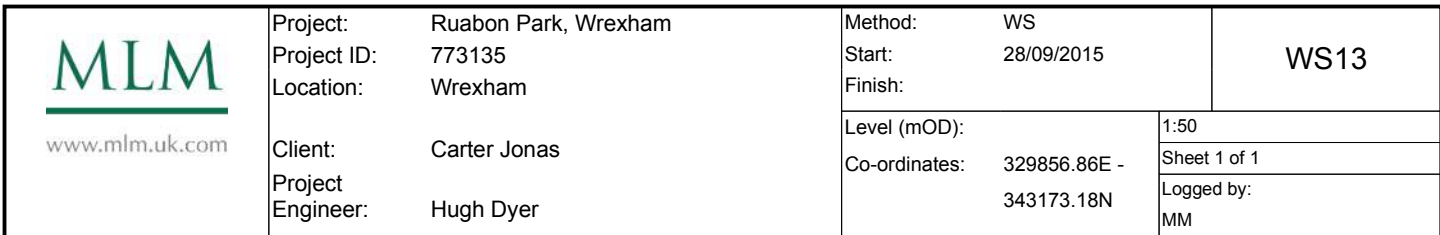


Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst'/ Backfill	Water (m)
D1 : 0.90m 1.00	N=7 (2,2/2,1,2,2) ()			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				1.60		Orange brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.20		
D2 : 1.90m 2.00	N=9 (3,3/3,2,2,2) ()			2.40		Brown very clayey GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.80		
3.00	N=9 (2,2/3,2,2,2) ()			5.00		Orange brown SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	2.60		
D3 : 4.90m 5.00	N=8 (1,1/2,2,2,2) ()			5.00	End of borehole at 5.00 m				
				6.00					
				7.00					
				8.00					
				9.00					

General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols Remarks GW at 3.50m. Live roots to 0.40m	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
		3.50			



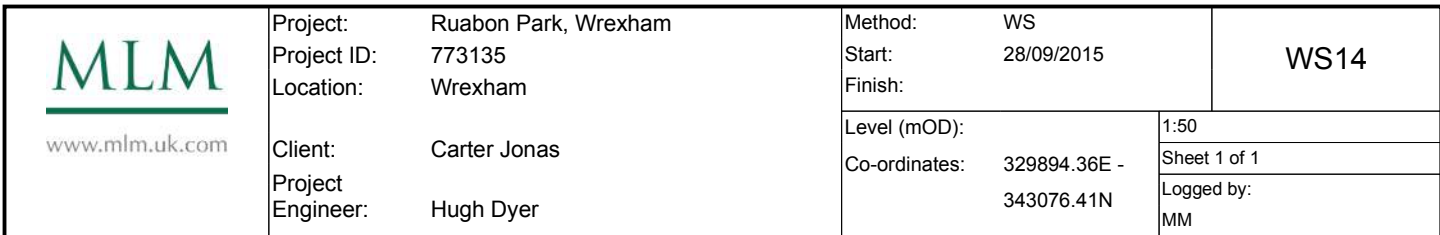
General Notes 1. Shear Strengths determined by hand shear vane. 2. See key sheet for explanation of symbols	Water Strike Details. Recorded in metres below ground level (m bgl)				
	Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)
Remarks Collapse at 4.00m. GW at 3.00m. Live roots to 0.40m		3.00			



Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst'/ Backfill	Water (m)
D1 : 0.80m 1.00	N=33 (5,8/9,9,8,7) ()	89		0.30		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.30		
				0.60		Light brown to brown silty SAND and GRAVEL. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.60		
D2 : 1.90m 2.00 2.00	N=23 (7,11/7,6,5,5) ()	89		0.90		Stiff brown slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.90		
				1.80		Stiff brown to purplish brown slightly gravelly slightly sandy silty CLAY.	0.70		
D3 : 2.90m 3.00 3.00	N=24 (3,7/5,4,6,9) ()	92		2.50		Stiff grey slightly sandy slightly gravelly silty CLAY. Gravel of fine to coarse angular to sub rounded sandstone and quartzite.	1.50		
				4.00		Stiff grey to brown very sandy CLAY.	0.50		
4.50	N=22 (7,7/4,6,5,7) ()	140		4.50		Very stiff red to reddish brown slightly gravelly silty CLAY.	0.50		
5.00 5.00	N=37 (8,9/10,9,8,10) ()	140		5.00		End of borehole at 5.00 m			
				6					
				7					
				8					
				9					

Remarks
Live roots to 0.30m

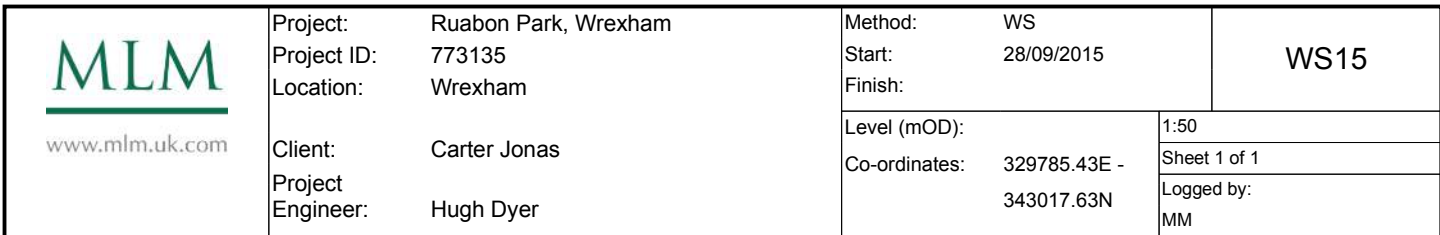
Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)



Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst'/ Backfill	Water (m)
D1 : 0.90m 1.00	N=18 (2,4/4,4,5,5) ()	95		0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				0.90		Firm light brown to brown slightly sandy slightly gravelly silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.50		
				1.50		Stiff red brown to brown slightly sandy slightly gravelly silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	2.10		
D2 : 1.90m 2.00	N=35 (3,4/5,7,9,14) ()	103		2.00					
2.50									
D3 : 2.90m 3.00	0 (75 for 80mm/0 for 0mm) ()			3.00					
				3.00		End of borehole at 3.00 m			
				4.00					
				5.00					
				6.00					
				7.00					
				8.00					
				9.00					

Remarks	Refusal at 3.00m due to boulder. Live roots to 0.40m
---------	--

Water Strike Details. Recorded in metres below ground level (m bgl)				
Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)



Depth (m)	SPT Results (Type)	Strength Shear (kPa)	Level (mAOD)	Depth (m)	Legend	Description of Strata	Thickness (m)	Inst'/ Backfill	Water (m)
D1 : 0.90m 1.00	N=20 (3,6/5,5,4,6) ()			0.40		TOPSOIL: Firm dark brown to black slightly sandy slightly gravelly silty clay. Gravel of fine to coarse angular to sub-rounded sandstone, quartzite and rare brick.	0.40		
				0.95		Firm to stiff light brown to grey slightly gravelly sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	0.55		
D2 : 1.90m 2.00	N=25 (3,4/4,7,7,7) ()			1.00		Red to red brown slightly clayey SAND.	2.00		
						Firm to stiff brown to dark brown slightly gravelly very sandy CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.			
3.00	N=32 (9,8/8,7,8,9) ()	140		3.00		Very stiff to hard grey to purplish grey slightly gravelly slightly sandy silty CLAY. Gravel of fine to coarse angular to sub-rounded sandstone and quartzite.	1.70		
3.50									
4.00	N=40 (5,7/7,10,11,12) ()			4.00					
4.50		140							
4.70	50 (25 for 115mm/50 for 145mm) ()			4.70	End of borehole at 4.70 m				
D3 : 4.70m				5					
				6					
				7					
				8					
				9					

Remarks
Refusal at 4.70m due to boulder. Live roots to 0.40m

Water Strike Details. Recorded in metres below ground level (m bgl)				
Date	Depth Encountered	Casing Depth	Inflow Remarks	Depth to water after 20 mins (m)

KEY TO BOREHOLE, TRIAL PIT AND WINDOW SAMPLE LOGS

SOIL STRATA

STRATA

	MADE GROUND / FILL
	TOPSOIL
	COBBLES AND BOULDERS
	GRAVEL
	SAND
	SILT
	CLAY
	PEAT

WATER

	WATER STRIKE
	WATER STANDING

BACKFILL / INSTALLATIONS

Backfill Details

	CONCRETE
	BENTONITE
	FILTER/GRAVEL
	ARISINGS BACKFILL

Pipe Details

	PLAIN PIPE
	SLOTTED PIPE
	PIEZOMETER TIP

SAMPLES

U100	OPEN DRIVE TUBE SAMPLE (100 mm NOMINAL DIAMETER)
UT100	OPEN DRIVE THIN WALL TUBE SAMPLE (100 mm NOMINAL DIAMETER)
U38	OPEN DRIVE TUBE SAMPLE (38 mm NOMINAL DIAMETER)
P	PISTON SAMPLE (100 mm NOMINAL DIAMETER UNLESS NOTED OTHERWISE)
D	SMALL DISTURBED SAMPLE
B	BULK DISTURBED SAMPLE
BLK	BLOCK SAMPLE
C	ROTARY CORE SAMPLE
G	GAS SAMPLE
U	UNDISTURBED SAMPLE
UT	TUBE SAMPLE
ES	ENVIRONMENTAL SAMPLE
W	WATER SAMPLE
SPTLS	STANDARD PENETRATION TEST LINER SAMPLE

IN SITU TESTING

S	STANDARD PENETRATION TEST USING THE SPLIT SPOON SAMPLER
C	STANDARD PENETRATION TEST USING A SOLID CONE

WHERE A TEST HAS BEEN COMPLETED THE TYPE OF TEST AND THE N-VALUE WILL BE REPORTED.

WHERE THE FULL 300 mm PENETRATION OF THE MAIN DRIVE HAS NOT BEEN COMPLETED, THE NUMBER OF BLOWS (NOT AN N-VALUE) WILL BE REPORTED.

THE FIELD RECORDS COLUMN ON THE LOG WILL SHOW EACH SET OF BLOW COUNTS PER 75 mm OF PENETRATION INCLUDING SEATING BLOWS AND WILL ALSO INDICATE THE PARTIAL PENETRATION ACHIEVED (mm) FOR INCOMPLETE TESTS.

MLM

www.mlm.uk.com

Copyright © MLM Environmental
Part of MLM Consulting Engineers Ltd)

KEY TO BOREHOLE, TRIAL PIT AND WINDOW SAMPLE LOGS

SOIL STRATA

STRATA

	MADE GROUND / FILL
	TOPSOIL
	COBBLES AND BOULDERS
	GRAVEL
	SAND
	SILT
	CLAY
	PEAT

WATER

	WATER STRIKE
	WATER STANDING

BACKFILL / INSTALLATIONS

Backfill Details

	CONCRETE
	BENTONITE
	FILTER/GRAVEL
	ARISINGS BACKFILL

Pipe Details

	PLAIN PIPE
	SLOTTED PIPE
	PIEZOMETER TIP

SAMPLES

U100	OPEN DRIVE TUBE SAMPLE (100 mm NOMINAL DIAMETER)
UT100	OPEN DRIVE THIN WALL TUBE SAMPLE (100 mm NOMINAL DIAMETER)
U38	OPEN DRIVE TUBE SAMPLE (38 mm NOMINAL DIAMETER)
P	PISTON SAMPLE (100 mm NOMINAL DIAMETER UNLESS NOTED OTHERWISE)
D	SMALL DISTURBED SAMPLE
B	BULK DISTURBED SAMPLE
BLK	BLOCK SAMPLE
C	ROTARY CORE SAMPLE
G	GAS SAMPLE
U	UNDISTURBED SAMPLE
UT	TUBE SAMPLE
ES	ENVIRONMENTAL SAMPLE
W	WATER SAMPLE
SPTLS	STANDARD PENETRATION TEST LINER SAMPLE

IN SITU TESTING

S	STANDARD PENETRATION TEST USING THE SPLIT SPOON SAMPLER
C	STANDARD PENETRATION TEST USING A SOLID CONE

WHERE A TEST HAS BEEN COMPLETED THE TYPE OF TEST AND THE N-VALUE WILL BE REPORTED.

WHERE THE FULL 300 mm PENETRATION OF THE MAIN DRIVE HAS NOT BEEN COMPLETED, THE NUMBER OF BLOWS (NOT AN N-VALUE) WILL BE REPORTED.

THE FIELD RECORDS COLUMN ON THE LOG WILL SHOW EACH SET OF BLOW COUNTS PER 75 mm OF PENETRATION INCLUDING SEATING BLOWS AND WILL ALSO INDICATE THE PARTIAL PENETRATION ACHIEVED (mm) FOR INCOMPLETE TESTS.

MLM

www.mlm.uk.com

Copyright © MLM Consulting Limited

KEY TO BOREHOLE, TRIAL PIT AND WINDOW SAMPLE LOGS

SOIL STRATA

STRATA

	MADE GROUND / FILL
	TOPSOIL
	COBBLES AND BOULDERS
	GRAVEL
	SAND
	SILT
	CLAY
	PEAT

WATER

	WATER STRIKE
	WATER STANDING

BACKFILL / INSTALLATIONS

Backfill Details

	CONCRETE
	BENTONITE
	FILTER/GRAVEL
	ARISINGS BACKFILL

Pipe Details

	PLAIN PIPE
	SLOTTED PIPE
	PIEZOMETER TIP

SAMPLES

U100	OPEN DRIVE TUBE SAMPLE (100 mm NOMINAL DIAMETER)
UT100	OPEN DRIVE THIN WALL TUBE SAMPLE (100 mm NOMINAL DIAMETER)
U38	OPEN DRIVE TUBE SAMPLE (38 mm NOMINAL DIAMETER)
P	PISTON SAMPLE (100 mm NOMINAL DIAMETER UNLESS NOTED OTHERWISE)
D	SMALL DISTURBED SAMPLE
B	BULK DISTURBED SAMPLE
BLK	BLOCK SAMPLE
C	ROTARY CORE SAMPLE
G	GAS SAMPLE
U	UNDISTURBED SAMPLE
UT	TUBE SAMPLE
ES	ENVIRONMENTAL SAMPLE
W	WATER SAMPLE
SPTLS	STANDARD PENETRATION TEST LINER SAMPLE

IN SITU TESTING

S	STANDARD PENETRATION TEST USING THE SPLIT SPOON SAMPLER
C	STANDARD PENETRATION TEST USING A SOLID CONE

WHERE A TEST HAS BEEN COMPLETED THE TYPE OF TEST AND THE N-VALUE WILL BE REPORTED.

WHERE THE FULL 300 mm PENETRATION OF THE MAIN DRIVE HAS NOT BEEN COMPLETED, THE NUMBER OF BLOWS (NOT AN N-VALUE) WILL BE REPORTED.

THE FIELD RECORDS COLUMN ON THE LOG WILL SHOW EACH SET OF BLOW COUNTS PER 75 mm OF PENETRATION INCLUDING SEATING BLOWS AND WILL ALSO INDICATE THE PARTIAL PENETRATION ACHIEVED (mm) FOR INCOMPLETE TESTS.

MLM

www.mlm.uk.com

Copyright © MLM Consulting Engineers

Appendix B

Gas and Groundwater Monitoring Results



Project	Ruabon Park, Wrexham
----------------	----------------------

Ruabon Park, Wrexham

773135

05/1015

--	--

GA5000, Dip Meter

MM

Overcast

[illegible]

Appendix C

Geotechnical Test Results



LABORATORY REPORT



4043

Contract Number: PSL15/4944

Client's Reference: 773135 Report Date: 19 October 2015

Client Name: MLM
Building 7200
Cambridge Research Park
Cambridge
CB25 9TL

For the attention of: Hugh Dyer

Contract Title: Ruabon Park, Wrexham, Wales

Date Received: 8/10/2015

Date Commenced: 8/10/2015

Date Completed: 19/10/2015

Notes: Opinions and Interpretations are outside the UKAS Accreditation

A copy of the Laboratory Schedule of accredited tests as issued by UKAS is attached to this report. This certificate is issued in accordance with the accreditation requirements of the United Kingdom Accreditation Service. The results reported herein relate only to the material supplied to the laboratory. This certificate shall not be reproduced in full, without the prior written approval of the laboratory.

Checked and Approved Signatories:


R Gunson
(Director)

A Watkins
(Director)

M Beastall
(Laboratory Manager)

D Lambe
(Senior Technician)

S Royle
(Senior Technician)

5 – 7 Hexthorpe Road, Hexthorpe,
Doncaster DN4 0AR
tel: +44 (0)844 815 6641
fax: +44 (0)844 815 6642
e-mail: rgunson@prosoils.co.uk
awatkins@prosoils.co.uk

Page 1 of

SUMMARY OF LABORATORY SOIL DESCRIPTIONS

Hole Number	Sample Number	Sample Type	Depth m	Description of Sample
TP01	1	B	1.00	Brown gravelly sandy CLAY.
TP07	1	B	2.00	Brown very gravelly very sandy CLAY.
TP08	1	B	0.50	Brown very gravelly very sandy CLAY.
TP10	1	B	2.50	Brown very sandy CLAY.
TP14	1	B	1.50	Brown slightly gravelly sandy CLAY.
TP16	1	B	2.00	Brown gravelly very sandy CLAY.
TP19	1	B	2.70	Grey very silty CLAY.
TP24	1	B	1.20	Brown very sandy very clayey GRAVEL.
TP25	1	B	1.50	Brown slightly gravelly very sandy CLAY.
TP28	1	B	0.50	Brown very gravelly very sandy CLAY.
TP29	1	B	2.00	Brown gravelly sandy CLAY.
TP34	1	B	2.20	Brown gravelly slightly clayey SAND.
TP36	1	B	0.80	Brown slightly gravelly very silty SAND
TP37	1	B	2.00	Brown very gravelly very clayey SAND.
TP39	1	B	1.50	Grey very sandy CLAY.
TP40	1	B	2.30	Brown very gravelly very sandy CLAY.
TP46	1	B	1.50	Brown very sandy CLAY.
TP48	1	B	2.20	Brown slightly gravelly slightly clayey SAND.
TP50	1	B	2.80	Brown gravelly very sandy CLAY.

 Professional Soils Laboratory	Compiled by	Date	Checked by	Date	Approved by	Date
		19/10/15		19/10/15		19/10/15
	RUABON PARK, WREXHAM, WALES				Contract No:	PSL15/4944
					Client Ref:	773135

SUMMARY OF SOIL CLASSIFICATION TESTS

(B.S. 1377 : PART 2 : 1990)

Hole Number	Sample Number	Sample Type	Depth m	Moisture Content % Clause 3.2	Bulk Density Mg/m ³ Clause 7.2	Dry Density Mg/m ³ Clause 7.2	Particle Density Mg/m ³ Clause 8.2	Liquid Limit % Clause 4.3/4.4	Plastic Limit % Clause 5.3	Plasticity Index % Clause 5.4	% Passing .425mm	Remarks
TP01	1	B	1.00	14								
TP07	1	B	2.00	9.2								
TP08	1	B	0.50	9.1								
TP10	1	B	2.50	23				38	19	19	100	Intermediate plasticity CL.
TP14	1	B	1.50	30				40	20	20	95	Low plasticity CL.
TP16	1	B	2.00	11								
TP19	1	B	2.70	24				43	22	21	100	Intermediate plasticity CL.
TP24	1	B	1.20	11								
TP25	1	B	1.50	12				29	17	12	81	Low plasticity CL.
TP28	1	B	0.50	11								
TP29	1	B	2.00	17								
TP34	1	B	2.20	10								
TP36	1	B	0.80	9.1								
TP37	1	B	2.00	14								
TP39	1	B	1.50	20				30	17	13	100	Low plasticity CL.
TP40	1	B	2.30	10				26	14	12	65	Low plasticity CL.
TP46	1	B	1.50	10								
TP48	1	B	2.20	10								
TP50	1	B	2.80	12				32	16	16	80	Low plasticity CL.

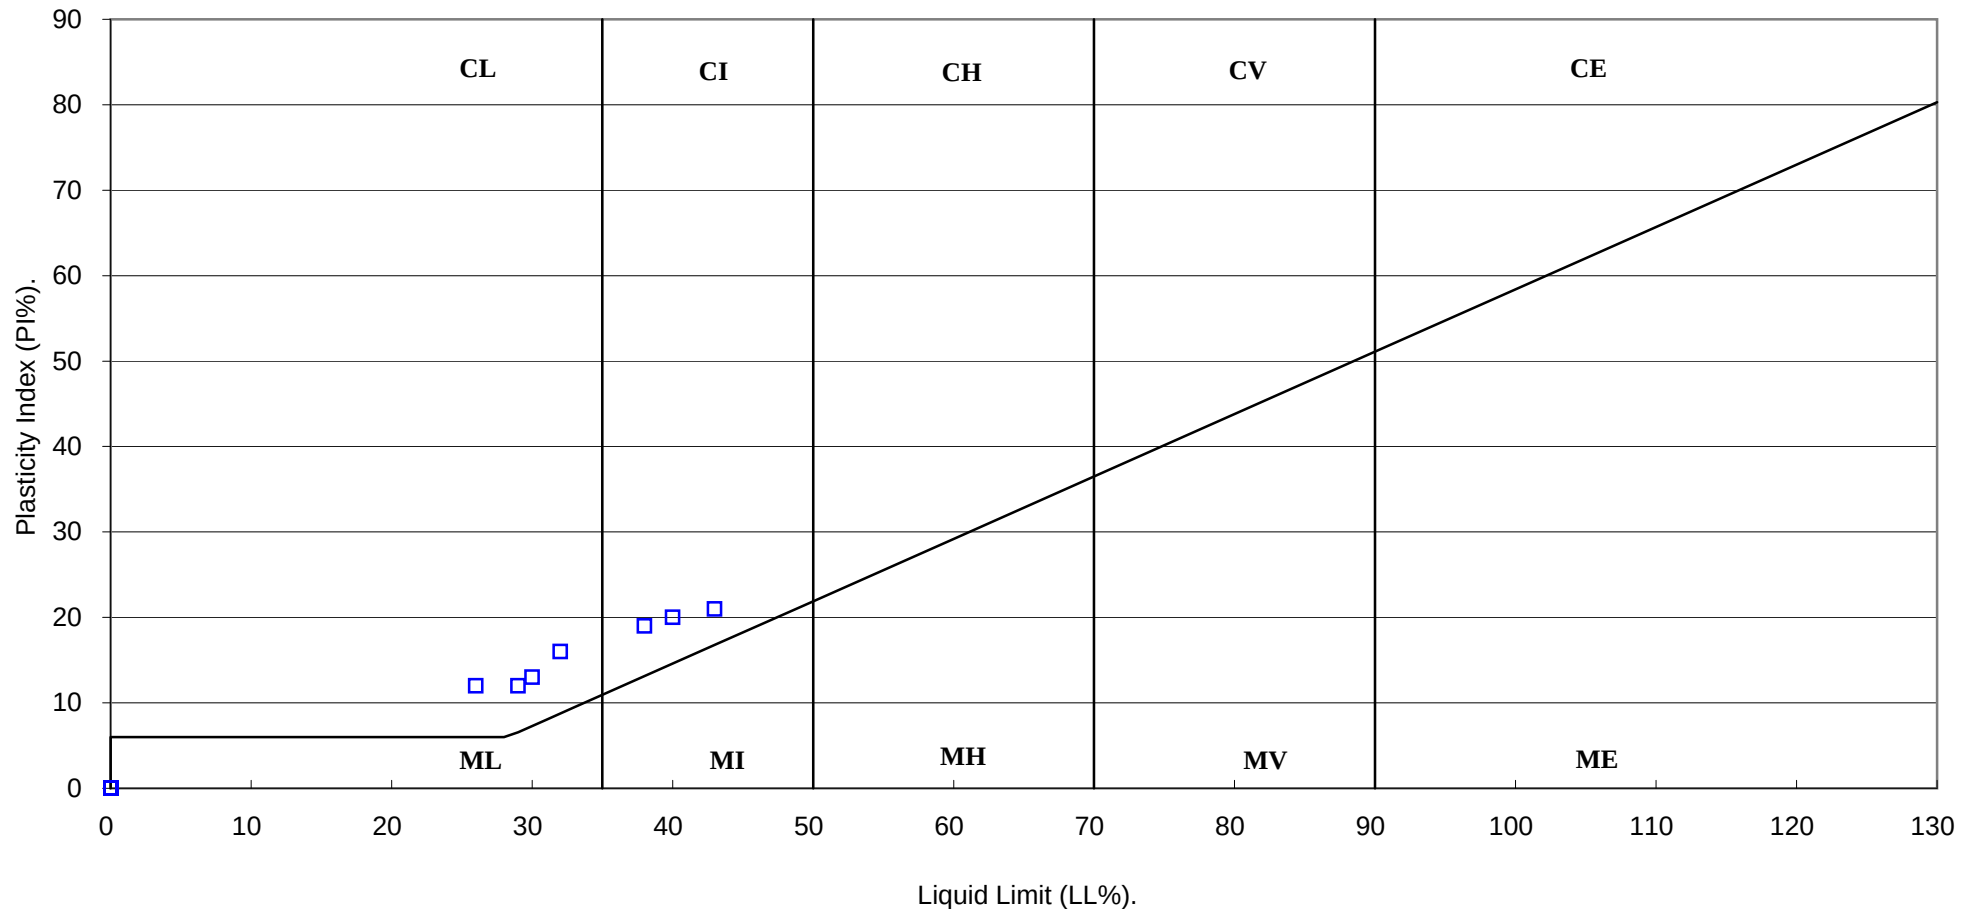
SYMBOLS : NP : Non Plastic

* : Liquid Limit and Plastic Limit Wet Sieved.

 Professional Soils Laboratory	Compiled by	Date	Checked by	Date	Approved by	Date
		19/10/15		19/10/15		19/10/15
	RUABON PARK, WREXHAM, WALES					Contract No: PSL15/4944
						Client Ref: 773135

PLASTICITY CHART FOR CASAGRANDE CLASSIFICATION.

(B.S.5930 : 1999)



PSL

Professional Soils Laboratory

Compiled by	Date	Checked by	Date	Approved by	Date
	19/10/15		19/10/15		19/10/15
RUABON PARK, WREXHAM, WALES				Contract No:	PSL15/4944
				Client Ref:	773135

Particle Size Distribution Test

BS1377 : Part 2 : 1990

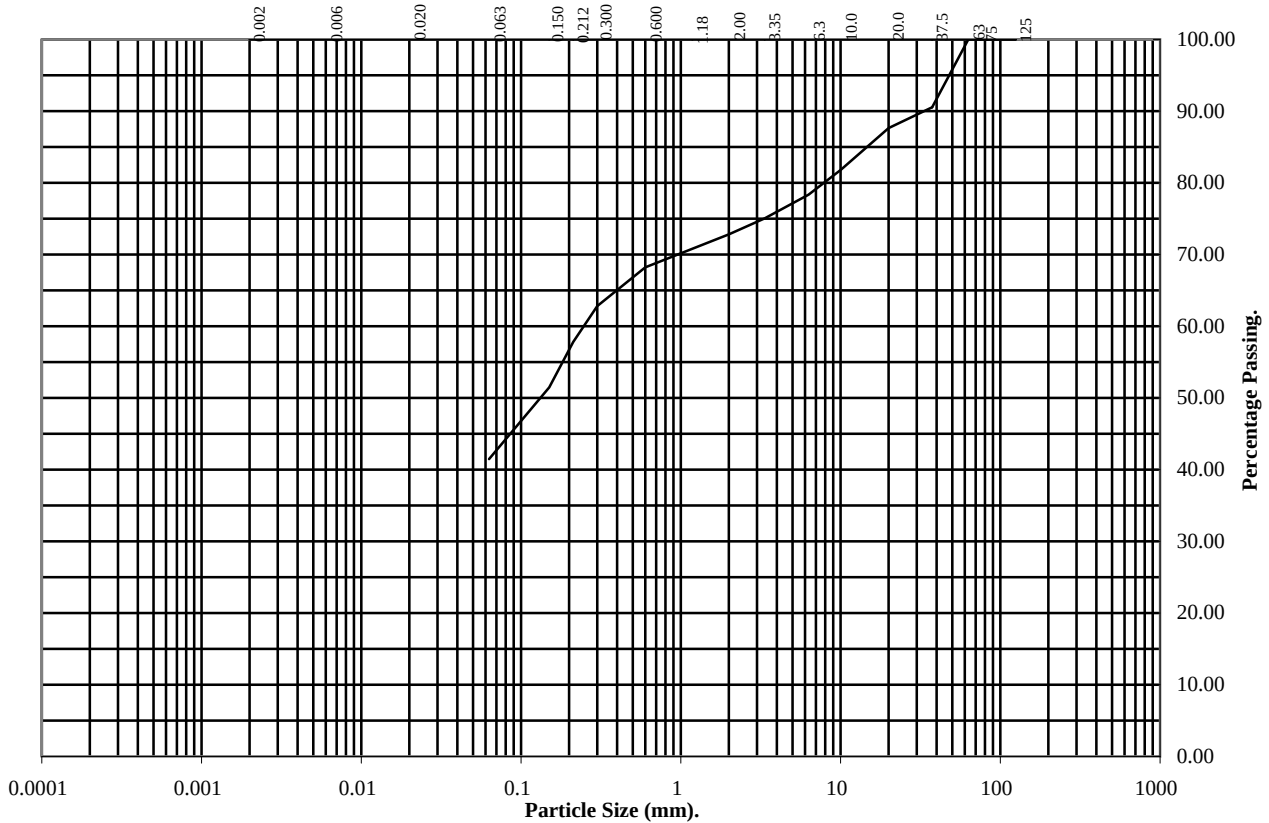
Wet Sieve, Clause 9.2

Hole Number: TP08

Depth (m): 0.50

Sample Number: 1

Sample Type: B



BS Test Sieve	Percentage Passing
125	100
75	100
63	100
37.5	91
20	88
10	82
6.3	78
3.35	75
2	73
1.18	71
0.6	68
0.3	63
0.212	58
0.15	51
0.063	41

Soil Fraction	Total Percentage
Cobbles	0
Gravel	27
Sand	32
Silt / Clay	41

Remarks:

See summary of soil descriptions.

Checked By	Date	Approved By	Date
<i>[Signature]</i>	19/10/15	<i>[Signature]</i>	19/10/15

PSL

Professional Soils Laboratory

RUABON PARK, WREXHAM, WALES.

Contract No.:
PSL15/4944

Particle Size Distribution Test

BS1377 : Part 2 : 1990

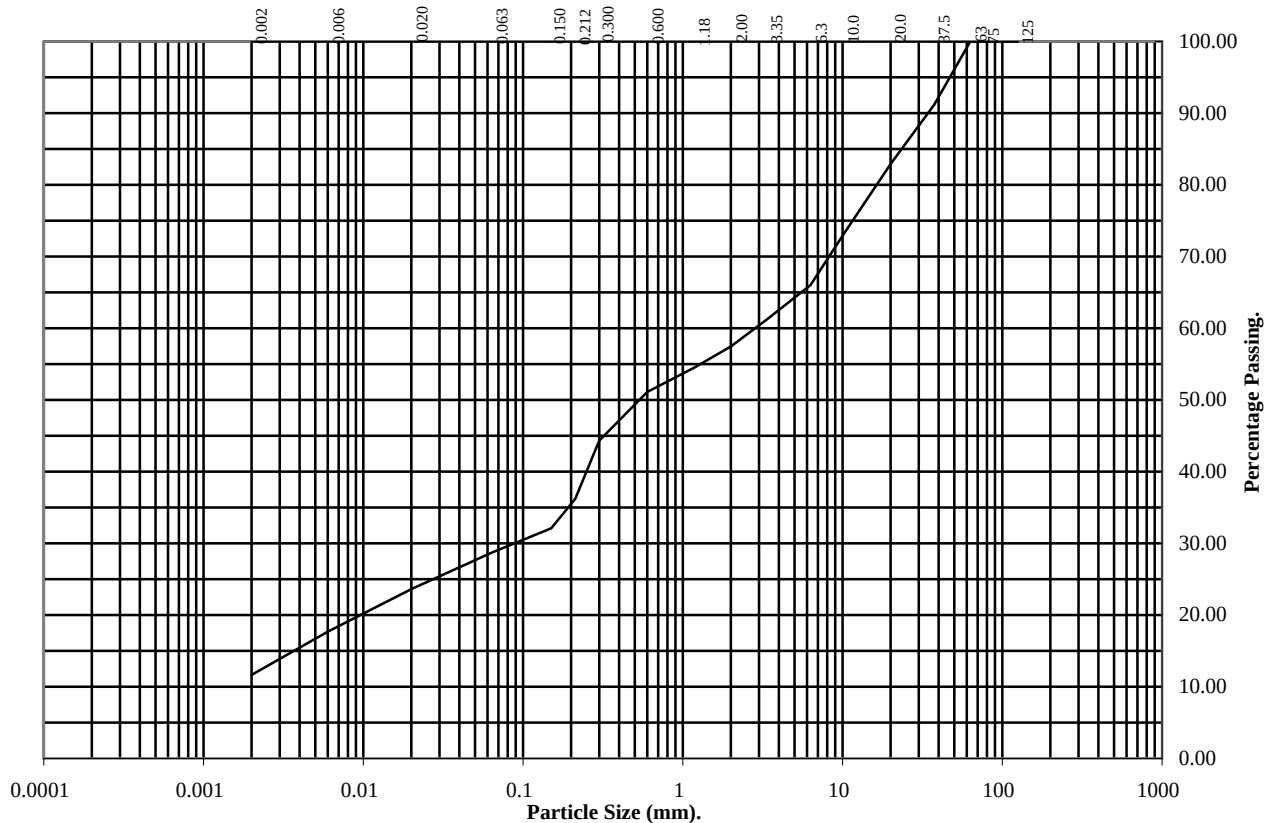
Wet Sieve & Pipette Analysis, Clause 9.2 & 9.4

Hole Number: TP24

Depth (m): 1.20

Sample Number: 1

Sample Type: B



BS Test Sieve	Percentage Passing
125	100
75	100
63	100
37.5	91
20	83
10	73
6.3	66
3.35	61
2	57
1.18	55
0.6	51
0.3	44
0.212	36
0.15	32
0.063	29

Particle Diameter	Percentage Passing
0.02	24
0.006	18
0.002	12

Soil Fraction	Total Percentage
Cobbles	0
Gravel	43
Sand	28
Silt	17
Clay	12

Remarks:

See summary of soil descriptions.

Checked By	Date	Approved By	Date
<i>[Signature]</i>	19/10/15	<i>[Signature]</i>	19/10/15

PSL

Professional Soils Laboratory

RUABON PARK, WREXHAM, WALES.

Contract No.:
PSL15/4944

Particle Size Distribution Test

BS1377 : Part 2 : 1990

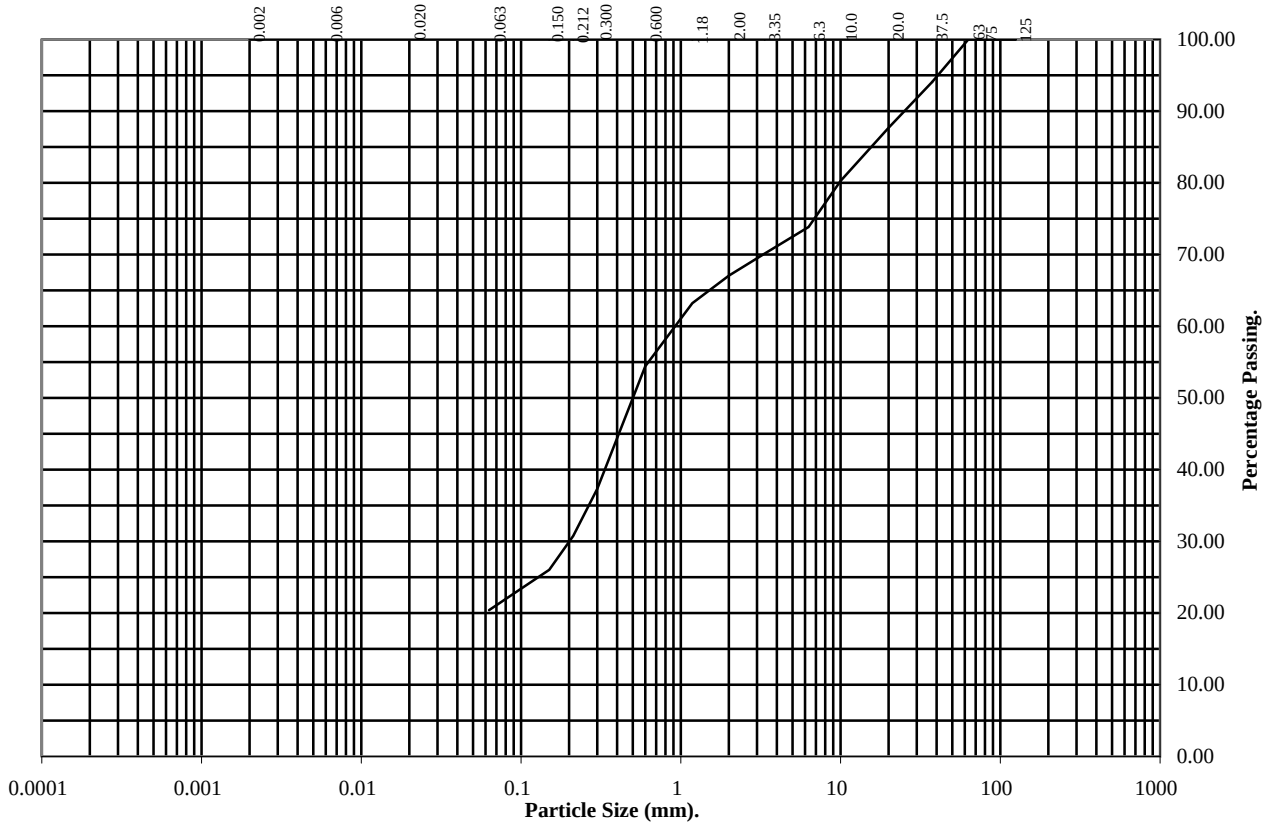
Wet Sieve, Clause 9.2

Hole Number: TP37

Depth (m): 2.00

Sample Number: 1

Sample Type: B



BS Test Sieve	Percentage Passing
125	100
75	100
63	100
37.5	94
20	88
10	80
6.3	74
3.35	70
2	67
1.18	63
0.6	54
0.3	37
0.212	31
0.15	26
0.063	20

Soil Fraction	Total Percentage
Cobbles	0
Gravel	33
Sand	47
Silt / Clay	20

Remarks:

See summary of soil descriptions.

Checked By	Date	Approved By	Date
<i>[Signature]</i>	19/10/15	<i>[Signature]</i>	19/10/15

PSL

Professional Soils Laboratory

RUABON PARK, WREXHAM, WALES.

Contract No.:
PSL15/4944



Final Report

Report No.: 15-23878-1

Initial Date of Issue: 16-Oct-2015

Client Professional Soils Laboratory

Client Address: 5/7 Hexthorpe Road
Doncaster
South Yorkshire
DN4 0AR

Contact(s): Anthony Watkins
Mark Beastall
Russell Gunson
Sean Royle

Project PSL15/4944 - Ruabon Park, Wrexham,
Wales

Quotation No.:		Date Received:	13-Oct-2015
Order No.:		Date Instructed:	12-Oct-2015
No. of Samples:	5	Target Date:	16-Oct-2015
Turnaround (Wkdays):	5	Results Due:	16-Oct-2015
Date Approved:	16-Oct-2015		

Approved By:

Details: Keith Jones, Technical Manager

Project: PSL15/4944 - Ruabon Park, Wrexham, Wales

Client: Professional Soils Laboratory	Chemtest Job No.:					15-23878	15-23878	15-23878	15-23878	15-23878
Quotation No.:	Chemtest Sample ID.:					204195	204196	204197	204198	204199
Order No.:	Client Sample Ref.:					TP08	TP25	TP50	TP39	TP37
	Client Sample ID.:					B1(x3)	B1(x3)	B1(x3)	B1(x3)	B1(x3)
	Sample Type:					SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):					0.5	1.5	2.8	1.5	2.0
	Bottom Depth (m):									
	Date Sampled:									
Determinand	Accred.	SOP	Units	LOD						
Moisture	N	2030	%	0.020	10	10	9.4	16	13	
pH	U	2010		N/A	7.8	8.7	8.6	8.6	8.6	
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	< 0.010	< 0.010	< 0.010	0.042	< 0.010	
Sulphate (Total)	U	2430	%	0.010	0.017	0.017	0.044	0.18	0.023	

Report Information

Key

- U UKAS accredited
- M MCERTS and UKAS accredited
- N Unaccredited
- S This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
- SN This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
- T This analysis has been subcontracted to an unaccredited laboratory
- I/S Insufficient Sample
- U/S Unsuitable Sample
- N/E not evaluated
- < "less than"
- > "greater than"

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVCOs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at our Coventry laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

- A - Date of sampling not supplied
- B - Sample age exceeds stability time (sampling to extraction)
- C - Sample not received in appropriate containers
- D - Broken Container

Sample Retention and Disposal

All soil samples will be retained for a period of 60 days from the date of receipt

All water samples will be retained for 14 days from the date of receipt

Charges may apply to extended sample storage

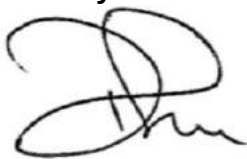
If you require extended retention of samples, please email your requirements to:
customerservices@chemtest.co.uk

Appendix D

Results of Chemical Analysis



Final Report

Report No.:	15-22938-1		
Initial Date of Issue:	09-Oct-2015		
Client	MLM		
Client Address:	55 Charlotte Street Birmingham B3 1PX		
Contact(s):	Hugh Dyer		
Project	773135 - Ruabon Park, Wrexham		
Quotation No.:		Date Received:	01-Oct-2015
Order No.:		Date Instructed:	05-Oct-2015
No. of Samples:	164	Target Date:	09-Oct-2015
Turnaround (Wkdays):	5	Results Due:	09-Oct-2015
Date Approved:	09-Oct-2015		
Approved By:			
Details:	Darrell Hall, Laboratory Director		

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200052	200053	200055	200058	200061	200065	200066	200068
Order No.:	Client Sample Ref.:				TP1	TP1	TP2	TP3	TP4	TP6	TP6	TP7
	Client Sample ID.:				D1	D2	D1	D2	D2	D1	D2	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.3	1.0	0.8	1.2	2.0	0.5	1.5	0.8
	Bottom Depth (m):											
	Date Sampled:				21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
ACM Type	U	2192		N/A		-	-					
Asbestos Identification	U	2192		N/A		No Asbestos Detected	No Asbestos Detected					
Moisture	N	2030	%	0.020	12			10	9.5	5.1	8.0	5.5
Chromatogram (AA Split)	N			N/A	See Attached					See Attached		
pH	U	2010		N/A	7.1			8.0	8.0	8.6	8.5	8.2
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	0.012			0.025	< 0.010	0.13	0.023	0.024
Cyanide (Total)	U	2300	mg/kg	0.50	< 0.50					< 0.50		
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50	4.7					3.1		
Sulphate (Total)	U	2430	%	0.010				0.094	0.011		0.088	0.045
Arsenic	U	2450	mg/kg	1.0	13			8.3	9.2	11	10	10
Boron	N	2450	mg/kg	0.40	6.2					3.6		
Cadmium	U	2450	mg/kg	0.10	0.81			0.26	0.25	0.82	0.29	0.28
Chromium	U	2450	mg/kg	1.0	31			16	15	18	21	23
Copper	U	2450	mg/kg	0.50	32			15	21	21	20	19
Mercury	U	2450	mg/kg	0.10	0.20			< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	20			16	26	23	25	24
Lead	U	2450	mg/kg	0.50	120			72	55	72	51	62
Selenium	U	2450	mg/kg	0.20	< 0.20			< 0.20	< 0.20	< 0.20	< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	130			64	46	110	72	73
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50			< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Organic Matter	U	2625	%	0.40	7.6					1.5		
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	< 1.0					< 1.0		
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0	< 5.0					< 5.0		
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	< 1.0					< 1.0		
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	< 1.0					< 1.0		
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0	< 1.0					< 1.0		
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	< 1.0					< 1.0		

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200052	200053	200055	200058	200061	200065	200068
Order No.:	Client Sample Ref.:				TP1	TP1	TP2	TP3	TP4	TP6	TP7
	Client Sample ID.:				D1	D2	D1	D2	D2	D1	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.3	1.0	0.8	1.2	2.0	0.5	0.8
	Bottom Depth (m):										
	Date Sampled:				21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015
Determinand	Accred.	SOP	Units	LOD							
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0	< 1.0					< 1.0	
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0	< 5.0					< 5.0	
Total Petroleum Hydrocarbons	U	2680	mg/kg	10	< 10					< 10	
Naphthalene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Acenaphthylene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Acenaphthene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Fluorene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Phenanthrene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Anthracene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Fluoranthene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Pyrene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Benzo[a]anthracene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Chrysene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Benzo[b]fluoranthene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Benzo[k]fluoranthene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Benzo[a]pyrene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10	< 0.10					< 0.10	
Total Of 16 PAH's	U	2700	mg/kg	2.0	< 2.0					< 2.0	
Total Phenols	U	2920	mg/kg	0.30	< 0.30					< 0.30	

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200071	200073	200074	200076	200078	200080	200081	200085	200088
Order No.:	Client Sample Ref.:				TP8	TP9	TP9	TP10	TP11	TP12	TP13	TP14	TP16
	Client Sample ID.:				D1	D1	D2	D1	D1	D1	D1	D2	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.0	0.2	1.5	1.0	0.5	1.0	1.0	2.0	0.5
	Bottom Depth (m):												
	Date Sampled:				21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	24-Sep-2015	21-Sep-2015	21-Sep-2015	23-Sep-2015
Determinand	Accred.	SOP	Units	LOD									
ACM Type	U	2192		N/A									
Asbestos Identification	U	2192		N/A									
Moisture	N	2030	%	0.020	6.6	8.1	7.3	6.2	4.9	7.9	7.1	9.7	7.7
Chromatogram (AA Split)	N			N/A	See Attached								
pH	U	2010		N/A	7.5		8.6	8.3	8.7	7.6	7.3	8.2	7.4
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	< 0.010		0.013	0.25	0.069	< 0.010	< 0.010	0.011	< 0.010
Cyanide (Total)	U	2300	mg/kg	0.50	< 0.50								
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50	1.3								
Sulphate (Total)	U	2430	%	0.010			0.013	0.18	0.064	0.032	0.027	< 0.010	0.040
Arsenic	U	2450	mg/kg	1.0	8.9		8.4	9.8	10	6.3	7.8	11	6.7
Boron	N	2450	mg/kg	0.40	2.3								
Cadmium	U	2450	mg/kg	0.10	0.20		0.18	0.53	0.39	0.13	0.19	0.21	0.20
Chromium	U	2450	mg/kg	1.0	17		16	16	14	16	25	33	19
Copper	U	2450	mg/kg	0.50	21		19	20	18	11	12	28	15
Mercury	U	2450	mg/kg	0.10	< 0.10		< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	24		26	19	19	12	26	41	19
Lead	U	2450	mg/kg	0.50	58		90	47	75	56	34	37	70
Selenium	U	2450	mg/kg	0.20	< 0.20		< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	48		47	83	70	43	47	71	51
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50		< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Organic Matter	U	2625	%	0.40	1.7	6.9							
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0	< 1.0								
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	< 1.0								
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0	< 5.0								
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	< 1.0								
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	< 1.0								
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0	< 1.0								
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0	< 1.0								
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0	< 1.0								
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0	< 1.0								
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	< 1.0								

Results - Soil

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:					15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:					200071	200073	200074	200076	200078	200080	200081	200085	200088
Order No.:	Client Sample Ref.:					TP8	TP9	TP9	TP10	TP11	TP12	TP13	TP14	TP16
	Client Sample ID.:					D1	D1	D2	D1	D1	D1	D1	D2	D1
	Sample Type:					SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):					1.0	0.2	1.5	1.0	0.5	1.0	1.0	2.0	0.5
	Bottom Depth (m):													
	Date Sampled:					21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	21-Sep-2015	24-Sep-2015	21-Sep-2015	21-Sep-2015	23-Sep-2015
Determinand	Accred.	SOP	Units	LOD										
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0	< 1.0									
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0	< 5.0									
Total Petroleum Hydrocarbons	U	2680	mg/kg	10	< 10									
Naphthalene	U	2700	mg/kg	0.10	< 0.10									
Acenaphthylene	U	2700	mg/kg	0.10	< 0.10									
Acenaphthene	U	2700	mg/kg	0.10	< 0.10									
Fluorene	U	2700	mg/kg	0.10	< 0.10									
Phenanthrene	U	2700	mg/kg	0.10	< 0.10									
Anthracene	U	2700	mg/kg	0.10	< 0.10									
Fluoranthene	U	2700	mg/kg	0.10	< 0.10									
Pyrene	U	2700	mg/kg	0.10	< 0.10									
Benzo[a]anthracene	U	2700	mg/kg	0.10	< 0.10									
Chrysene	U	2700	mg/kg	0.10	< 0.10									
Benzo[b]fluoranthene	U	2700	mg/kg	0.10	< 0.10									
Benzo[k]fluoranthene	U	2700	mg/kg	0.10	< 0.10									
Benzo[a]pyrene	U	2700	mg/kg	0.10	< 0.10									
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10	< 0.10									
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10	< 0.10									
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10	< 0.10									
Total Of 16 PAH's	U	2700	mg/kg	2.0	< 2.0									
Total Phenols	U	2920	mg/kg	0.30	< 0.30									

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200091	200093	200094	200095	200099	200104	200106	200109
Order No.:	Client Sample Ref.:				TP17	TP18	TP19	TP19	TP20	TP22	TP23	TP24
	Client Sample ID.:				D2	D1	D1	D2	D2	D2	D1	D2
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.5	0.5	0.5	1.2	1.0	2.0	1.0	1.0
	Bottom Depth (m):											
	Date Sampled:				22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
ACM Type	U	2192		N/A						-		
Asbestos Identification	U	2192		N/A						No Asbestos Detected		
Moisture	N	2030	%	0.020	6.6	8.0	9.0	9.2	9.7		6.7	8.2
Chromatogram (AA Split)	N			N/A				See Attached			See Attached	
pH	U	2010		N/A	8.2	7.5	7.4	8.7	7.9		7.8	8.7
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010		< 0.010	< 0.010
Cyanide (Total)	U	2300	mg/kg	0.50				< 0.50			< 0.50	
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50				1.7			1.3	
Sulphate (Total)	U	2430	%	0.010	< 0.010	0.037	0.037		0.012		< 0.010	0.032
Arsenic	U	2450	mg/kg	1.0	10	9.3	7.9	10	9.7		7.0	8.5
Boron	N	2450	mg/kg	0.40				2.6			11	
Cadmium	U	2450	mg/kg	0.10	0.37	0.28	0.33	0.18	0.27		0.11	0.15
Chromium	U	2450	mg/kg	1.0	21	31	32	18	31		13	28
Copper	U	2450	mg/kg	0.50	28	19	17	19	23		18	22
Mercury	U	2450	mg/kg	0.10	< 0.10	< 0.10	< 0.10	< 0.10	0.13		< 0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	33	31	33	26	38		21	33
Lead	U	2450	mg/kg	0.50	78	36	54	56	64		49	44
Selenium	U	2450	mg/kg	0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20		< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	61	55	71	54	66		35	60
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50		< 0.50	< 0.50
Organic Matter	U	2625	%	0.40				0.95			0.62	
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0				< 1.0			< 1.0	
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0				< 5.0			< 5.0	
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0				< 1.0			< 1.0	
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0				< 1.0			< 1.0	
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0				< 1.0			< 1.0	
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0				< 1.0			< 1.0	

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200091	200093	200094	200095	200099	200104	200106	200109
Order No.:	Client Sample Ref.:				TP17	TP18	TP19	TP19	TP20	TP22	TP23	TP24
	Client Sample ID.:				D2	D1	D1	D2	D2	D2	D1	D2
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.5	0.5	0.5	1.2	1.0	2.0	1.0	1.0
	Bottom Depth (m):											
	Date Sampled:				22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0				< 1.0				< 1.0
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0				< 5.0				< 5.0
Total Petroleum Hydrocarbons	U	2680	mg/kg	10				< 10				< 10
Naphthalene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Acenaphthylene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Acenaphthene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Fluorene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Phenanthrene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Anthracene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Fluoranthene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Pyrene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Benzo[a]anthracene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Chrysene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Benzo[b]fluoranthene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Benzo[k]fluoranthene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Benzo[a]pyrene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10				< 0.10				< 0.10
Total Of 16 PAH's	U	2700	mg/kg	2.0				< 2.0				< 2.0
Total Phenols	U	2920	mg/kg	0.30				< 0.30				< 0.30

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200112	200114	200116	200118	200120	200124	200126	200128	200130
Order No.:	Client Sample Ref.:				TP26	TP27	TP28	TP29	TP30	TP31	TP32	TP33	TP34
	Client Sample ID.:				D1	D1	D1	D1	D1	D2	D1	D1	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.0	1.5	0.5	1.5	1.0	1.0	0.5	0.5	0.6
	Bottom Depth (m):												
	Date Sampled:				22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	24-Sep-2015	24-Sep-2015	24-Sep-2015	24-Sep-2015
Determinand	Accred.	SOP	Units	LOD									
ACM Type	U	2192		N/A	-								
Asbestos Identification	U	2192		N/A	No Asbestos Detected								
Moisture	N	2030	%	0.020	7.0	7.9	9.7	7.3	7.5	5.4	5.4	4.9	7.1
Chromatogram (AA Split)	N			N/A			See Attached						
pH	U	2010		N/A	8.1	8.7	7.7	8.7	7.6	7.8	8.1	7.8	7.9
Sulphate (2:1 Water Soluble) as SO4	U	2120	g/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	0.010
Cyanide (Total)	U	2300	mg/kg	0.50			< 0.50						
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50			1.4						
Sulphate (Total)	U	2430	%	0.010	0.011	< 0.010		0.018	0.011	< 0.010	0.011	< 0.010	0.028
Arsenic	U	2450	mg/kg	1.0	9.5	10	7.3	13	6.6	10	10	1.3	5.9
Boron	N	2450	mg/kg	0.40			6.5						
Cadmium	U	2450	mg/kg	0.10	0.15	0.17	0.19	0.20	0.13	0.13	0.36	< 0.10	0.28
Chromium	U	2450	mg/kg	1.0	25	13	24	19	18	25	26	18	14
Copper	U	2450	mg/kg	0.50	23	19	14	22	15	21	21	4.4	15
Mercury	U	2450	mg/kg	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	31	20	25	28	16	26	35	19	14
Lead	U	2450	mg/kg	0.50	66	49	41	67	41	45	63	30	64
Selenium	U	2450	mg/kg	0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	54	43	50	47	31	61	59	40	67
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Organic Matter	U	2625	%	0.40			1.0						
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0			< 1.0						
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0			< 1.0						
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0			< 5.0						
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0			< 1.0						
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0			< 1.0						
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0			< 1.0						
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0			< 1.0						
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0			< 1.0						
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0			< 1.0						
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0			< 1.0						

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200112	200114	200116	200118	200120	200124	200126	200128	200130
Order No.:	Client Sample Ref.:				TP26	TP27	TP28	TP29	TP30	TP31	TP32	TP33	TP34
	Client Sample ID.:				D1	D1	D1	D1	D1	D2	D1	D1	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.0	1.5	0.5	1.5	1.0	1.0	0.5	0.5	0.6
	Bottom Depth (m):												
	Date Sampled:				22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	22-Sep-2015	24-Sep-2015	24-Sep-2015	24-Sep-2015	24-Sep-2015
Determinand	Accred.	SOP	Units	LOD									
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0			< 1.0						
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0			< 5.0						
Total Petroleum Hydrocarbons	U	2680	mg/kg	10			< 10						
Naphthalene	U	2700	mg/kg	0.10			< 0.10						
Acenaphthylene	U	2700	mg/kg	0.10			< 0.10						
Acenaphthene	U	2700	mg/kg	0.10			< 0.10						
Fluorene	U	2700	mg/kg	0.10			< 0.10						
Phenanthrene	U	2700	mg/kg	0.10			< 0.10						
Anthracene	U	2700	mg/kg	0.10			< 0.10						
Fluoranthene	U	2700	mg/kg	0.10			< 0.10						
Pyrene	U	2700	mg/kg	0.10			< 0.10						
Benzo[a]anthracene	U	2700	mg/kg	0.10			< 0.10						
Chrysene	U	2700	mg/kg	0.10			< 0.10						
Benzo[b]fluoranthene	U	2700	mg/kg	0.10			< 0.10						
Benzo[k]fluoranthene	U	2700	mg/kg	0.10			< 0.10						
Benzo[a]pyrene	U	2700	mg/kg	0.10			< 0.10						
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10			< 0.10						
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10			< 0.10						
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10			< 0.10						
Total Of 16 PAH's	U	2700	mg/kg	2.0			< 2.0						
Total Phenols	U	2920	mg/kg	0.30			< 0.30						

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200132	200134	200137	200139	200142	200145	200147	200149
Order No.:	Client Sample Ref.:				TP35	TP36	TP37	TP38	TP39	TP40	TP41	TP42
	Client Sample ID.:				D1	D1	D1	D1	D1	D2	D1	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.2	0.7	1.0	1.0	1.0	2.0	1.0	1.5
	Bottom Depth (m):											
	Date Sampled:				24-Sep-2015	24-Sep-2015	24-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
ACM Type	U	2192		N/A		-						
Asbestos Identification	U	2192		N/A		No Asbestos Detected						
Moisture	N	2030	%	0.020	3.9	3.0	7.1	5.1	5.5	11	9.1	7.5
Chromatogram (AA Split)	N			N/A		See Attached	See Attached	See Attached				
pH	U	2010		N/A	7.9	7.9	8.0	7.7	7.8	8.5	8.6	8.1
Sulphate (2:1 Water Soluble) as SO4	U	2120	g/l	0.010	< 0.010	< 0.010	0.037	< 0.010	< 0.010	0.18	< 0.010	< 0.010
Cyanide (Total)	U	2300	mg/kg	0.50		< 0.50	< 0.50	< 0.50				
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50		0.87	0.87	0.80				
Sulphate (Total)	U	2430	%	0.010	0.016				0.039	0.64	0.019	< 0.010
Arsenic	U	2450	mg/kg	1.0	8.3	6.6	7.1	6.8	5.2	13	7.0	14
Boron	N	2450	mg/kg	0.40		2.1	2.2	2.8				
Cadmium	U	2450	mg/kg	0.10	0.19	0.28	0.33	< 0.10	0.18	0.23	0.13	0.31
Chromium	U	2450	mg/kg	1.0	15	23	16	24	20	18	14	19
Copper	U	2450	mg/kg	0.50	15	11	12	13	8.8	15	16	18
Mercury	U	2450	mg/kg	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	0.14
Nickel	U	2450	mg/kg	0.50	15	26	14	22	15	22	22	27
Lead	U	2450	mg/kg	0.50	56	60	47	24	35	61	51	47
Selenium	U	2450	mg/kg	0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	50	66	75	61	60	45	38	51
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Organic Matter	U	2625	%	0.40		0.79	1.5	0.76				
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0		< 5.0	< 5.0	< 5.0				
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				

Results - Soil

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200132	200134	200137	200139	200142	200145	200147	200149
Order No.:	Client Sample Ref.:				TP35	TP36	TP37	TP38	TP39	TP40	TP41	TP42
	Client Sample ID.:				D1	D1	D1	D1	D1	D2	D1	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.2	0.7	1.0	1.0	1.0	2.0	1.0	1.5
	Bottom Depth (m):											
	Date Sampled:				24-Sep-2015	24-Sep-2015	24-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0		< 1.0	< 1.0	< 1.0				
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0		< 5.0	< 5.0	< 5.0				
Total Petroleum Hydrocarbons	U	2680	mg/kg	10		< 10	< 10	< 10				
Naphthalene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Acenaphthylene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Acenaphthene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Fluorene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Phenanthrene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Anthracene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Fluoranthene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Pyrene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Benzo[a]anthracene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Chrysene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Benzo[b]fluoranthene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Benzo[k]fluoranthene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Benzo[a]pyrene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10		< 0.10	< 0.10	< 0.10				
Total Of 16 PAH's	U	2700	mg/kg	2.0		< 2.0	< 2.0	< 2.0				
Total Phenols	U	2920	mg/kg	0.30		< 0.30	< 0.30	< 0.30				

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200152	200154	200157	200158	200160	200162	200163	200165
Order No.:	Client Sample Ref.:				TP43	TP44	TP45	TP45	TP46	TP47	TP47	TP48
	Client Sample ID.:				D1	D1	D1	D2	D1	D1	D2	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.0	1.0	0.5	2.0	1.0	1.4	2.2	1.5
	Bottom Depth (m):											
	Date Sampled:				23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
ACM Type	U	2192		N/A								
Asbestos Identification	U	2192		N/A								
Moisture	N	2030	%	0.020	4.2	7.8	5.6	7.0	6.9	5.8	7.4	8.1
Chromatogram (AA Split)	N			N/A				See Attached	See Attached		See Attached	
pH	U	2010		N/A	8.8	8.4	8.8	8.6	8.6	8.8	8.6	8.4
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	< 0.010	< 0.010	< 0.010	0.010	< 0.010	< 0.010	< 0.010	< 0.010
Cyanide (Total)	U	2300	mg/kg	0.50				< 0.50	< 0.50		< 0.50	
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50				0.97	1.2		1.1	
Sulphate (Total)	U	2430	%	0.010	< 0.010	0.016	0.016			< 0.010		< 0.010
Arsenic	U	2450	mg/kg	1.0	11	5.8	9.8	10	9.7	10	12	8.6
Boron	N	2450	mg/kg	0.40				3.5	2.9		3.6	
Cadmium	U	2450	mg/kg	0.10	0.17	0.13	0.14	0.14	0.17	0.24	0.12	0.17
Chromium	U	2450	mg/kg	1.0	20	20	23	21	21	16	16	20
Copper	U	2450	mg/kg	0.50	18	9.0	18	21	19	18	16	21
Mercury	U	2450	mg/kg	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	25	17	30	27	25	23	21	27
Lead	U	2450	mg/kg	0.50	37	41	26	41	58	49	44	51
Selenium	U	2450	mg/kg	0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	47	37	47	49	38	44	41	44
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Organic Matter	U	2625	%	0.40				0.78	0.76		0.95	
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0				< 5.0	< 5.0		< 5.0	
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200152	200154	200157	200158	200160	200162	200163	200165
Order No.:	Client Sample Ref.:				TP43	TP44	TP45	TP45	TP46	TP47	TP47	TP48
	Client Sample ID.:				D1	D1	D1	D2	D1	D1	D2	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.0	1.0	0.5	2.0	1.0	1.4	2.2	1.5
	Bottom Depth (m):											
	Date Sampled:				23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015	23-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0				< 1.0	< 1.0		< 1.0	
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0				< 5.0	< 5.0		< 5.0	
Total Petroleum Hydrocarbons	U	2680	mg/kg	10				< 10	< 10		< 10	
Naphthalene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Acenaphthylene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Acenaphthene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Fluorene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Phenanthrene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Anthracene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Fluoranthene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Pyrene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Benzo[a]anthracene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Chrysene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Benzo[b]fluoranthene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Benzo[k]fluoranthene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Benzo[a]pyrene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10				< 0.10	< 0.10		< 0.10	
Total Of 16 PAH's	U	2700	mg/kg	2.0				< 2.0	< 2.0		< 2.0	
Total Phenols	U	2920	mg/kg	0.30				< 0.30	< 0.30		< 0.30	

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200167	200170	200172	200173	200175	200178	200181	200185	200187
Order No.:	Client Sample Ref.:				TP49	TP50	WS01	WS01	WS02	WS03	WS04	WS05	WS06
	Client Sample ID.:				D1	D2	D1	D2	D1	D1	D1	D2	D1
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.5	1.5	0.9	1.5	0.7	0.9	0.9	1.2	0.9
	Bottom Depth (m):												
	Date Sampled:				23-Sep-2015	23-Sep-2015	25-Sep-2015	25-Sep-2015	25-Sep-2015	25-Sep-2015	24-Sep-2015	25-Sep-2015	28-Sep-2015
Determinand	Accred.	SOP	Units	LOD									
ACM Type	U	2192		N/A		-		-					
Asbestos Identification	U	2192		N/A		No Asbestos Detected		No Asbestos Detected					
Moisture	N	2030	%	0.020	6.8		5.4		5.7	6.0	11	5.7	9.7
Chromatogram (AA Split)	N			N/A									
pH	U	2010		N/A	8.7		8.9			8.2	8.6	8.3	8.6
Sulphate (2:1 Water Soluble) as SO4	U	2120	g/l	0.010	< 0.010		0.035			< 0.010	< 0.010	< 0.010	< 0.010
Cyanide (Total)	U	2300	mg/kg	0.50									
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50									
Sulphate (Total)	U	2430	%	0.010	0.026		0.033			< 0.010	< 0.010	< 0.010	< 0.010
Arsenic	U	2450	mg/kg	1.0	12		8.7			6.5	11	9.5	9.3
Boron	N	2450	mg/kg	0.40									
Cadmium	U	2450	mg/kg	0.10	0.26		0.24			0.19	0.23	0.21	0.18
Chromium	U	2450	mg/kg	1.0	16		14			14	28	18	29
Copper	U	2450	mg/kg	0.50	19		13			16	24	24	27
Mercury	U	2450	mg/kg	0.10	< 0.10		< 0.10			< 0.10	< 0.10	< 0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	23		17			22	38	29	38
Lead	U	2450	mg/kg	0.50	60		76			50	45	78	56
Selenium	U	2450	mg/kg	0.20	< 0.20		< 0.20			< 0.20	< 0.20	< 0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	44		40			31	63	50	67
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50		< 0.50			< 0.50	< 0.50	< 0.50	< 0.50
Organic Matter	U	2625	%	0.40					1.5				
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0									
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0									
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0									
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0									
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0									
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0									
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0									
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0									
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0									
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0									
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0									
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0									
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0									
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0									
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0									
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0									

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200167	200170	200172	200173	200175	200178	200181	200185
Order No.:	Client Sample Ref.:				TP49	TP50	WS01	WS01	WS02	WS03	WS04	WS05
	Client Sample ID.:				D1	D2	D1	D2	D1	D1	D1	D2
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.5	1.5	0.9	1.5	0.7	0.9	0.9	1.2
	Bottom Depth (m):											0.9
	Date Sampled:				23-Sep-2015	23-Sep-2015	25-Sep-2015	25-Sep-2015	25-Sep-2015	25-Sep-2015	24-Sep-2015	25-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0								
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0								
Total Petroleum Hydrocarbons	U	2680	mg/kg	10								
Naphthalene	U	2700	mg/kg	0.10								
Acenaphthylene	U	2700	mg/kg	0.10								
Acenaphthene	U	2700	mg/kg	0.10								
Fluorene	U	2700	mg/kg	0.10								
Phenanthrene	U	2700	mg/kg	0.10								
Anthracene	U	2700	mg/kg	0.10								
Fluoranthene	U	2700	mg/kg	0.10								
Pyrene	U	2700	mg/kg	0.10								
Benzo[a]anthracene	U	2700	mg/kg	0.10								
Chrysene	U	2700	mg/kg	0.10								
Benzo[b]fluoranthene	U	2700	mg/kg	0.10								
Benzo[k]fluoranthene	U	2700	mg/kg	0.10								
Benzo[a]pyrene	U	2700	mg/kg	0.10								
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10								
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10								
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10								
Total Of 16 PAH's	U	2700	mg/kg	2.0								
Total Phenols	U	2920	mg/kg	0.30								

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200190	200195	200196	200198	200201	200204	200207	200210	200211
Order No.:	Client Sample Ref.:				WS07	WS09	WS09	WS10	WS11	WS12	WS13	WS14	WS14
	Client Sample ID.:				D1	D1	D2	D1	D1	D1	D1	D1	D2
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.9	0.9	1.9	0.9	0.9	0.2	0.9	0.9	1.9
	Bottom Depth (m):												
	Date Sampled:				28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015
Determinand	Accred.	SOP	Units	LOD									
ACM Type	U	2192		N/A									
Asbestos Identification	U	2192		N/A									
Moisture	N	2030	%	0.020	8.0	6.6	6.4	4.3	3.4	9.5	4.9	8.0	9.9
Chromatogram (AA Split)	N			N/A									
pH	U	2010		N/A	7.4	8.4		8.0	8.2		8.7		8.5
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	< 0.010	< 0.010		< 0.010	< 0.010		< 0.010		< 0.010
Cyanide (Total)	U	2300	mg/kg	0.50									
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50									
Sulphate (Total)	U	2430	%	0.010	< 0.010	0.019		< 0.010	< 0.010		0.017		0.022
Arsenic	U	2450	mg/kg	1.0	9.5	7.5		9.0	10	9.1		8.4	
Boron	N	2450	mg/kg	0.40									
Cadmium	U	2450	mg/kg	0.10	0.28	0.17		0.12	0.38	0.92		0.20	
Chromium	U	2450	mg/kg	1.0	18	13		20	19	25		17	
Copper	U	2450	mg/kg	0.50	35	15		16	17	22		20	
Mercury	U	2450	mg/kg	0.10	< 0.10	< 0.10		< 0.10	< 0.10	0.16		0.13	
Nickel	U	2450	mg/kg	0.50	36	17		30	26	14		22	
Lead	U	2450	mg/kg	0.50	75	40		87	93	110		53	
Selenium	U	2450	mg/kg	0.20	< 0.20	< 0.20		< 0.20	< 0.20	< 0.20		< 0.20	
Zinc	U	2450	mg/kg	0.50	57	42		62	52	140		39	
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50		< 0.50	< 0.50	< 0.50		< 0.50	
Organic Matter	U	2625	%	0.40			0.71						
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0									
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0									
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0									
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0									
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0									
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0									
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0									
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0									
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0									
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0									
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0									
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0									
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0									
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0									
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0									
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0									

Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938	15-22938
Quotation No.:	Chemtest Sample ID.:				200190	200195	200196	200198	200201	200204	200207	200210
Order No.:	Client Sample Ref.:				WS07	WS09	WS09	WS10	WS11	WS12	WS13	WS14
	Client Sample ID.:				D1	D1	D2	D1	D1	D1	D1	D2
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.9	0.9	1.9	0.9	0.9	0.2	0.9	0.9
	Bottom Depth (m):											
	Date Sampled:				28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015	28-Sep-2015
Determinand	Accred.	SOP	Units	LOD								
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0								
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0								
Total Petroleum Hydrocarbons	U	2680	mg/kg	10								
Naphthalene	U	2700	mg/kg	0.10								
Acenaphthylene	U	2700	mg/kg	0.10								
Acenaphthene	U	2700	mg/kg	0.10								
Fluorene	U	2700	mg/kg	0.10								
Phenanthrene	U	2700	mg/kg	0.10								
Anthracene	U	2700	mg/kg	0.10								
Fluoranthene	U	2700	mg/kg	0.10								
Pyrene	U	2700	mg/kg	0.10								
Benzo[a]anthracene	U	2700	mg/kg	0.10								
Chrysene	U	2700	mg/kg	0.10								
Benzo[b]fluoranthene	U	2700	mg/kg	0.10								
Benzo[k]fluoranthene	U	2700	mg/kg	0.10								
Benzo[a]pyrene	U	2700	mg/kg	0.10								
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10								
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10								
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10								
Total Of 16 PAH's	U	2700	mg/kg	2.0								
Total Phenols	U	2920	mg/kg	0.30								

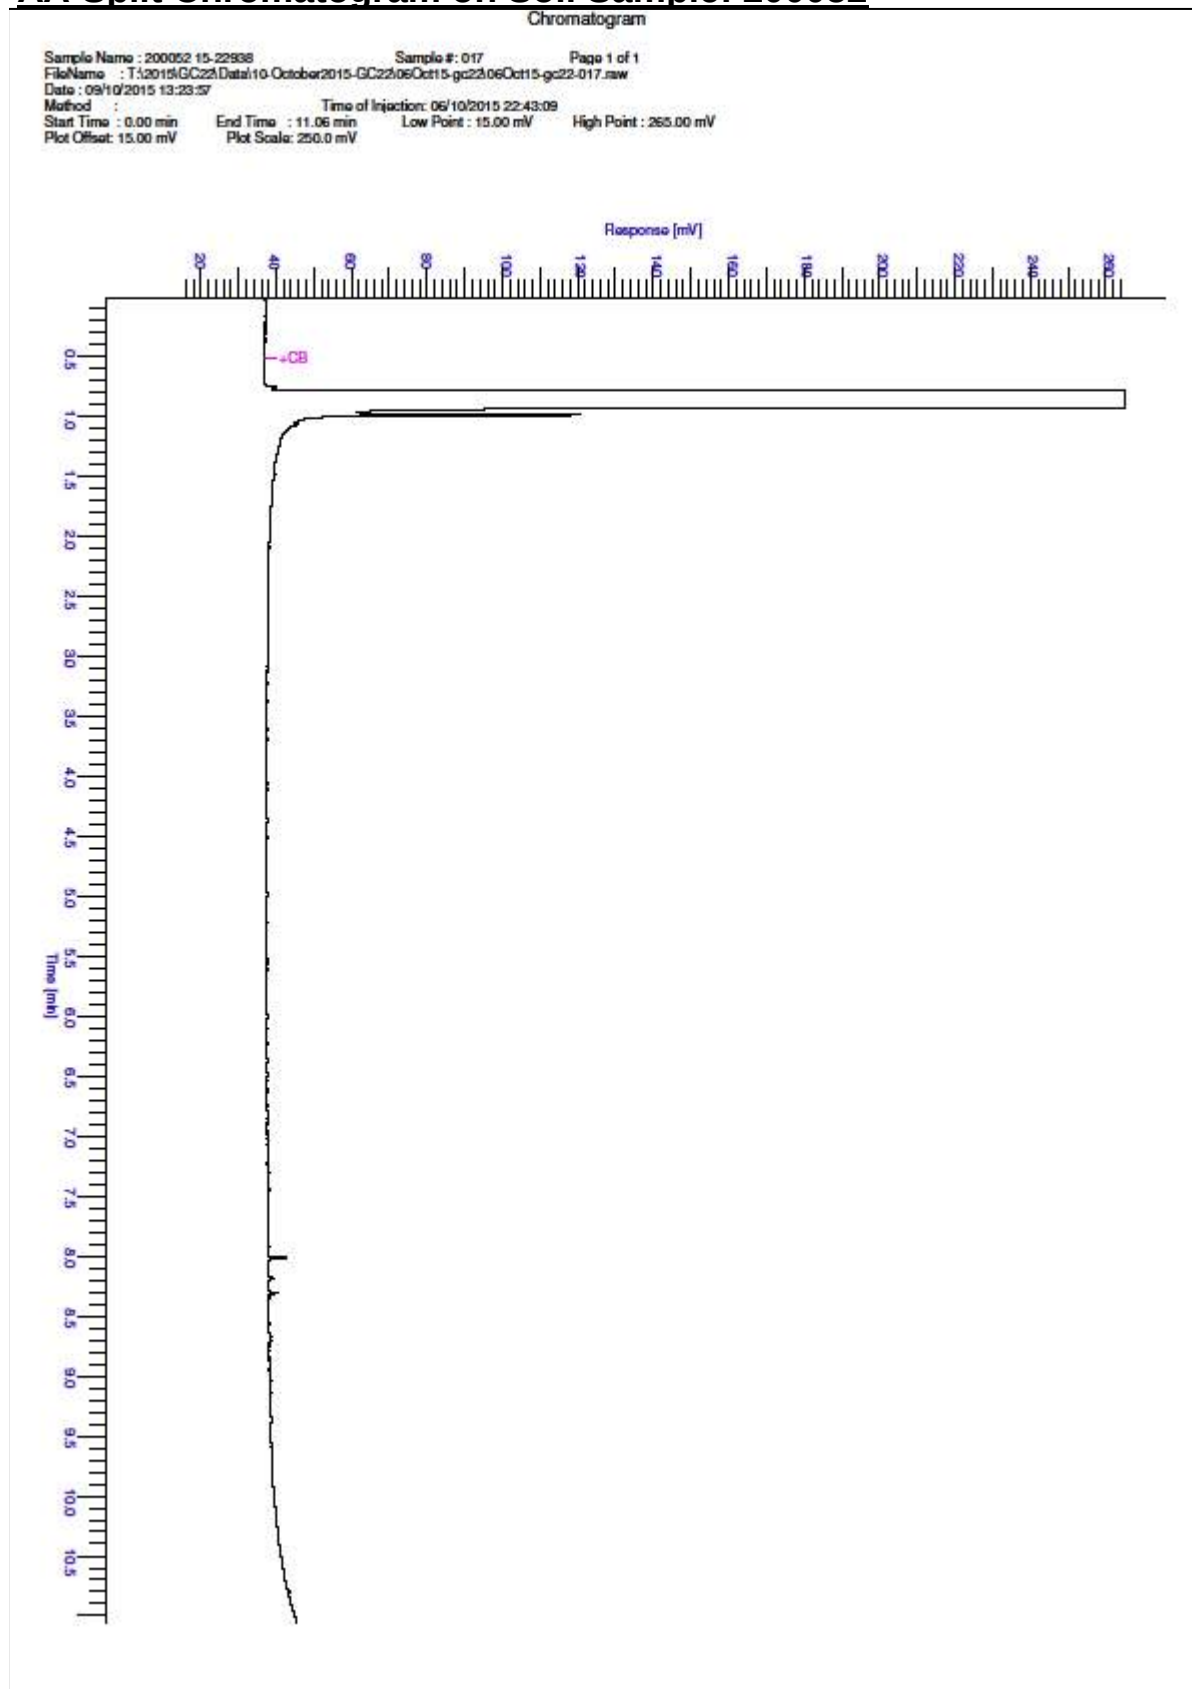
Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.:				15-22938
Quotation No.:	Chemtest Sample ID.:				200213
Order No.:	Client Sample Ref.:				WS15
	Client Sample ID.:				D1
	Sample Type:				SOIL
	Top Depth (m):				0.9
	Bottom Depth (m):				
	Date Sampled:				28-Sep-2015
Determinand	Accred.	SOP	Units	LOD	
ACM Type	U	2192		N/A	
Asbestos Identification	U	2192		N/A	
Moisture	N	2030	%	0.020	13
Chromatogram (AA Split)	N			N/A	
pH	U	2010		N/A	
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	
Cyanide (Total)	U	2300	mg/kg	0.50	
Sulphide (Easily Liberatable)	U	2325	mg/kg	0.50	
Sulphate (Total)	U	2430	%	0.010	
Arsenic	U	2450	mg/kg	1.0	7.3
Boron	N	2450	mg/kg	0.40	
Cadmium	U	2450	mg/kg	0.10	0.22
Chromium	U	2450	mg/kg	1.0	21
Copper	U	2450	mg/kg	0.50	21
Mercury	U	2450	mg/kg	0.10	< 0.10
Nickel	U	2450	mg/kg	0.50	29
Lead	U	2450	mg/kg	0.50	37
Selenium	U	2450	mg/kg	0.20	< 0.20
Zinc	U	2450	mg/kg	0.50	50
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50
Organic Matter	U	2625	%	0.40	
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	
Aliphatic TPH >C8-C10	U	2680	mg/kg	1.0	
Aliphatic TPH >C10-C12	U	2680	mg/kg	1.0	
Aliphatic TPH >C12-C16	U	2680	mg/kg	1.0	
Aliphatic TPH >C16-C21	U	2680	mg/kg	1.0	
Aliphatic TPH >C21-C35	U	2680	mg/kg	1.0	
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	
Total Aliphatic Hydrocarbons	U	2680	mg/kg	5.0	
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	
Aromatic TPH >C8-C10	U	2680	mg/kg	1.0	
Aromatic TPH >C10-C12	U	2680	mg/kg	1.0	
Aromatic TPH >C12-C16	U	2680	mg/kg	1.0	
Aromatic TPH >C16-C21	U	2680	mg/kg	1.0	
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	

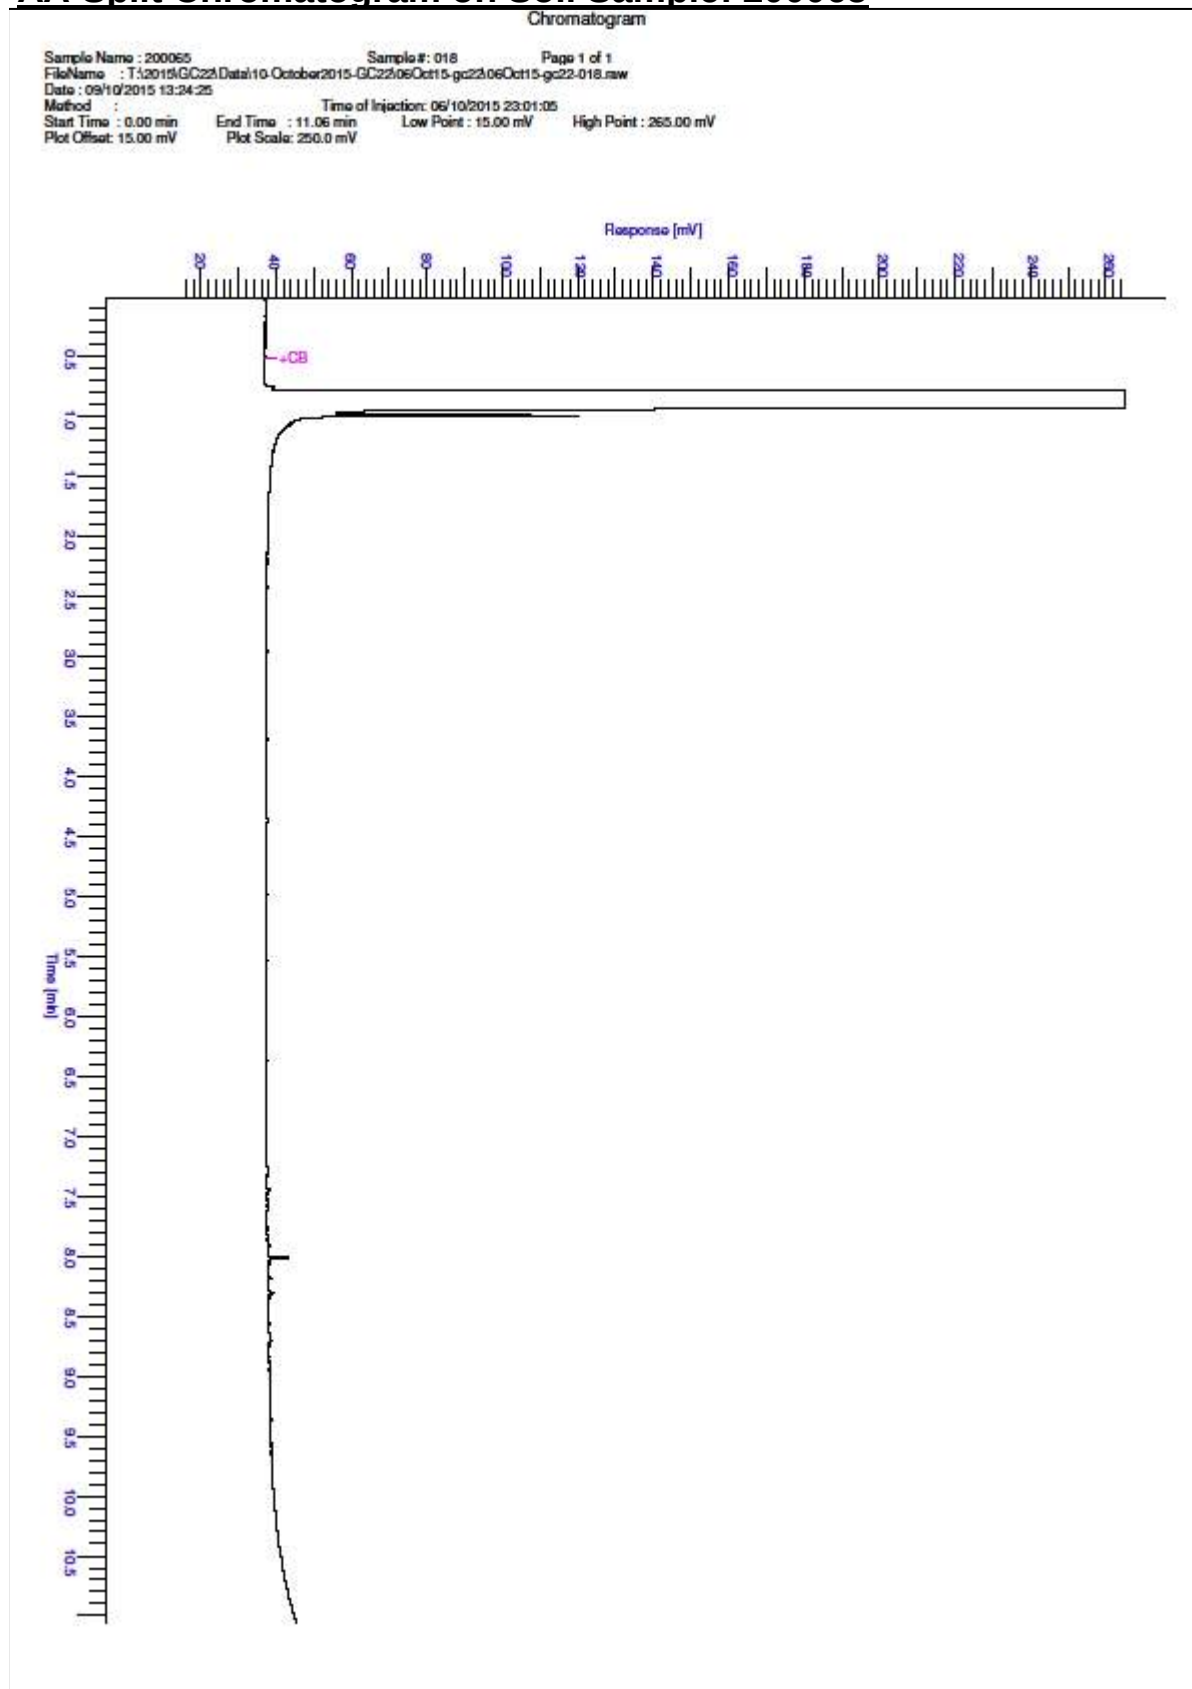
Project: 773135 - Ruabon Park, Wrexham

Client: MLM	Chemtest Job No.: 15-22938			
Quotation No.:	Chemtest Sample ID.: 200213			
Order No.:	Client Sample Ref.: WS15			
	Client Sample ID.: D1			
	Sample Type: SOIL			
	Top Depth (m): 0.9			
	Bottom Depth (m):			
	Date Sampled: 28-Sep-2015			
Determinand	Accred.	SOP	Units	LOD
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0
Total Aromatic Hydrocarbons	U	2680	mg/kg	5.0
Total Petroleum Hydrocarbons	U	2680	mg/kg	10
Naphthalene	U	2700	mg/kg	0.10
Acenaphthylene	U	2700	mg/kg	0.10
Acenaphthene	U	2700	mg/kg	0.10
Fluorene	U	2700	mg/kg	0.10
Phenanthrene	U	2700	mg/kg	0.10
Anthracene	U	2700	mg/kg	0.10
Fluoranthene	U	2700	mg/kg	0.10
Pyrene	U	2700	mg/kg	0.10
Benzo[a]anthracene	U	2700	mg/kg	0.10
Chrysene	U	2700	mg/kg	0.10
Benzo[b]fluoranthene	U	2700	mg/kg	0.10
Benzo[k]fluoranthene	U	2700	mg/kg	0.10
Benzo[a]pyrene	U	2700	mg/kg	0.10
Indeno(1,2,3-c,d)Pyrene	U	2700	mg/kg	0.10
Dibenz(a,h)Anthracene	U	2700	mg/kg	0.10
Benzo[g,h,i]perylene	U	2700	mg/kg	0.10
Total Of 16 PAH's	U	2700	mg/kg	2.0
Total Phenols	U	2920	mg/kg	0.30

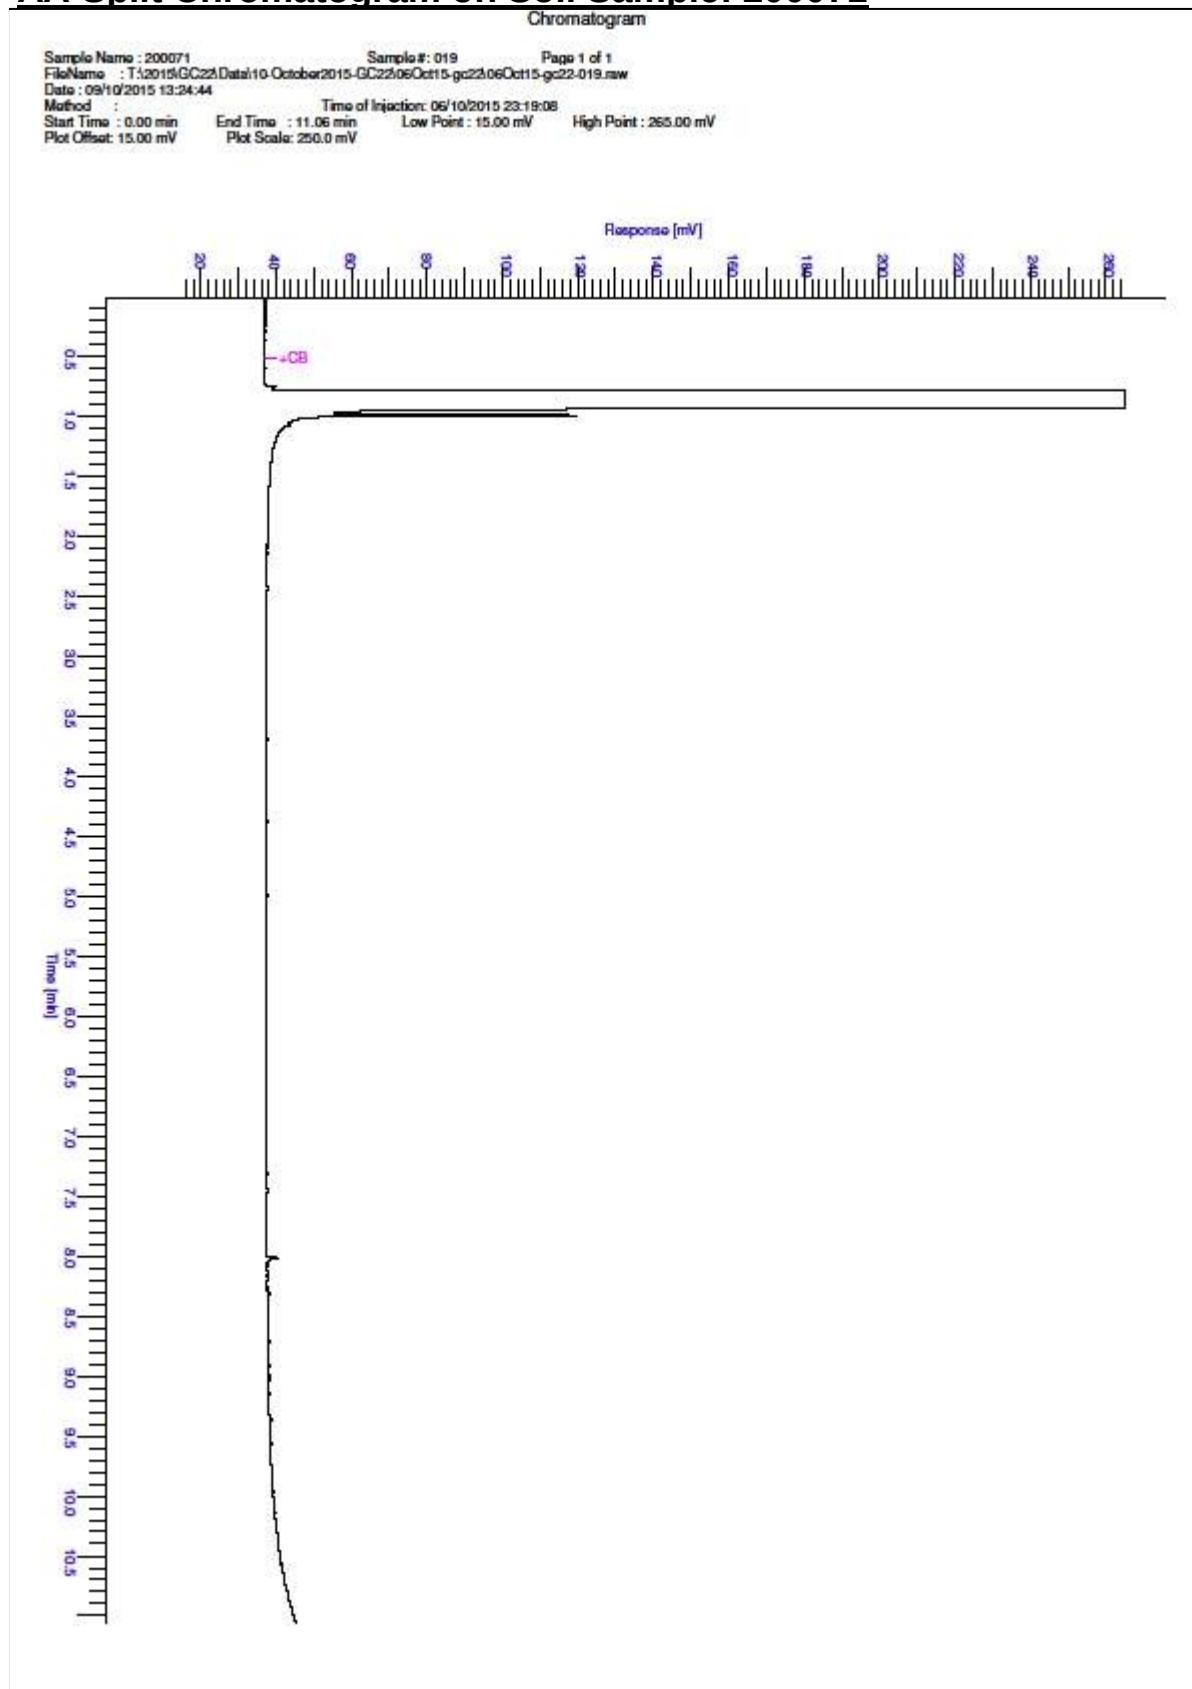
AA-Split Chromatogram on Soil Sample: 200052



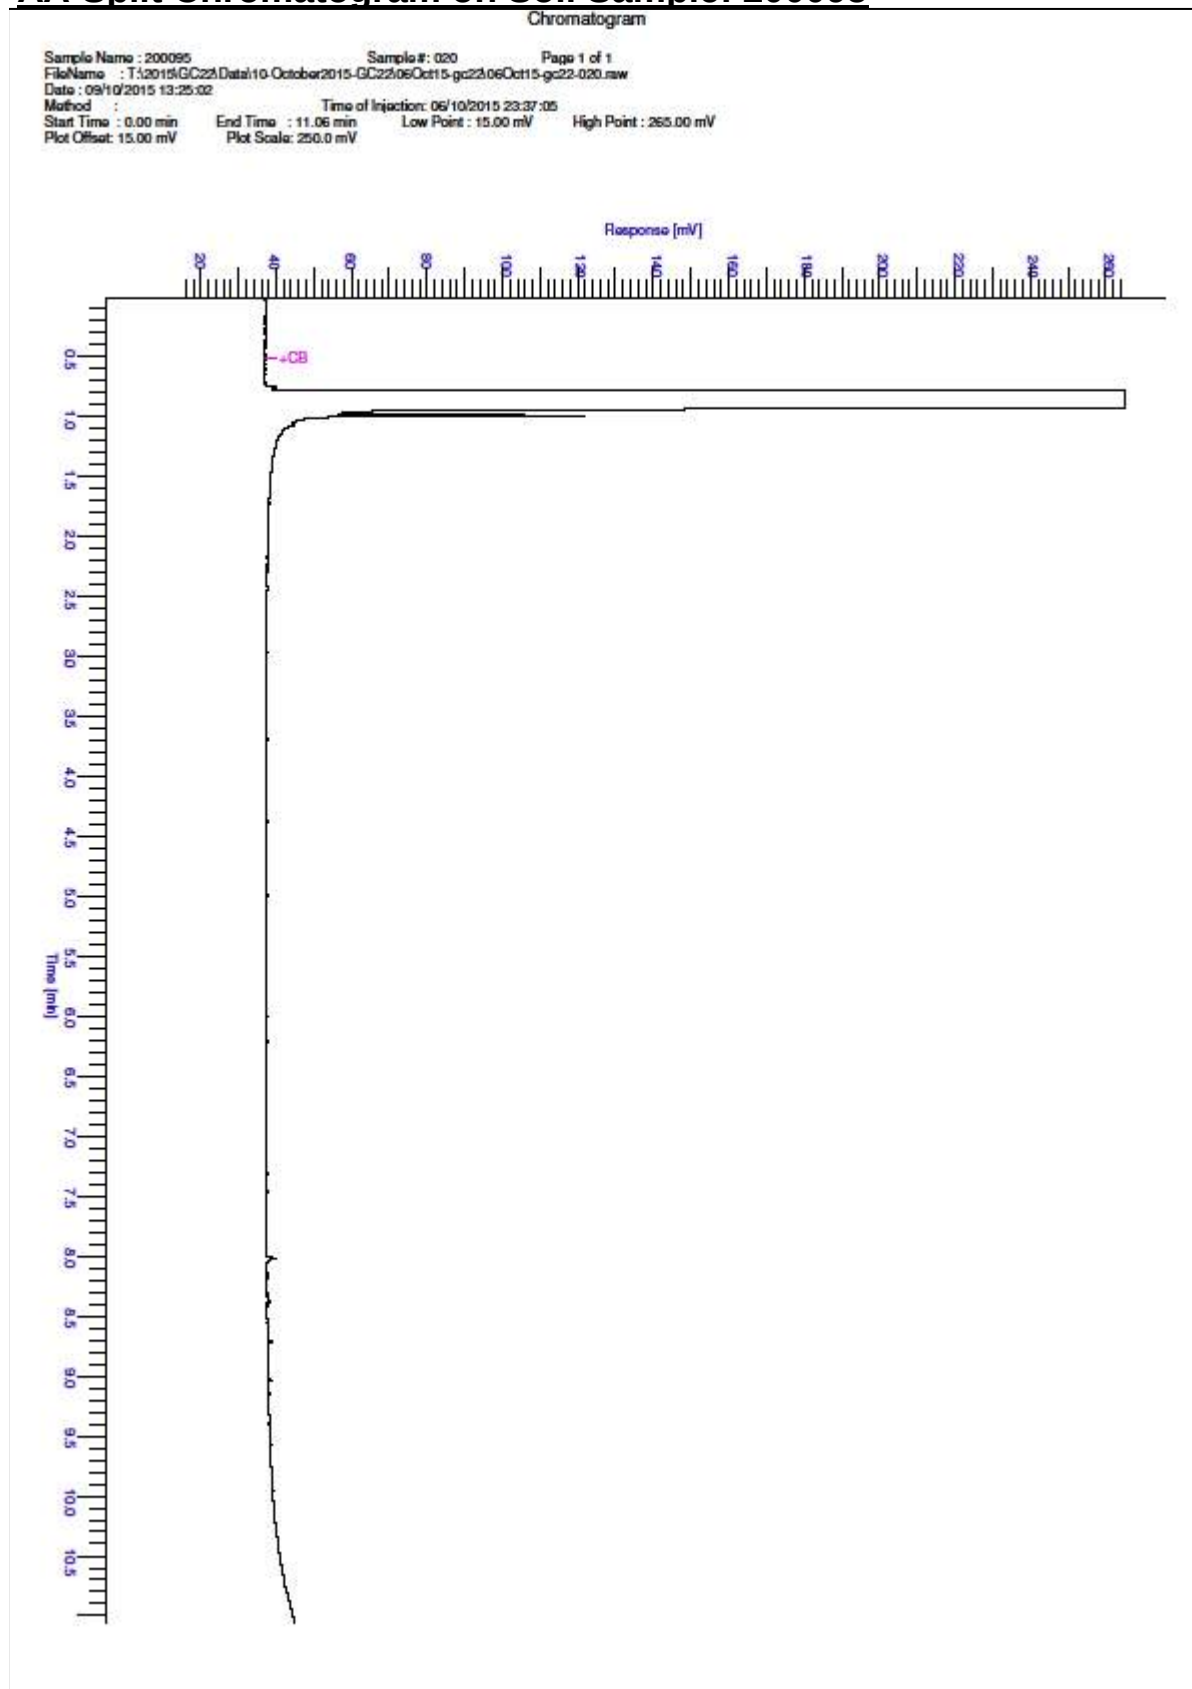
AA-Split Chromatogram on Soil Sample: 200065



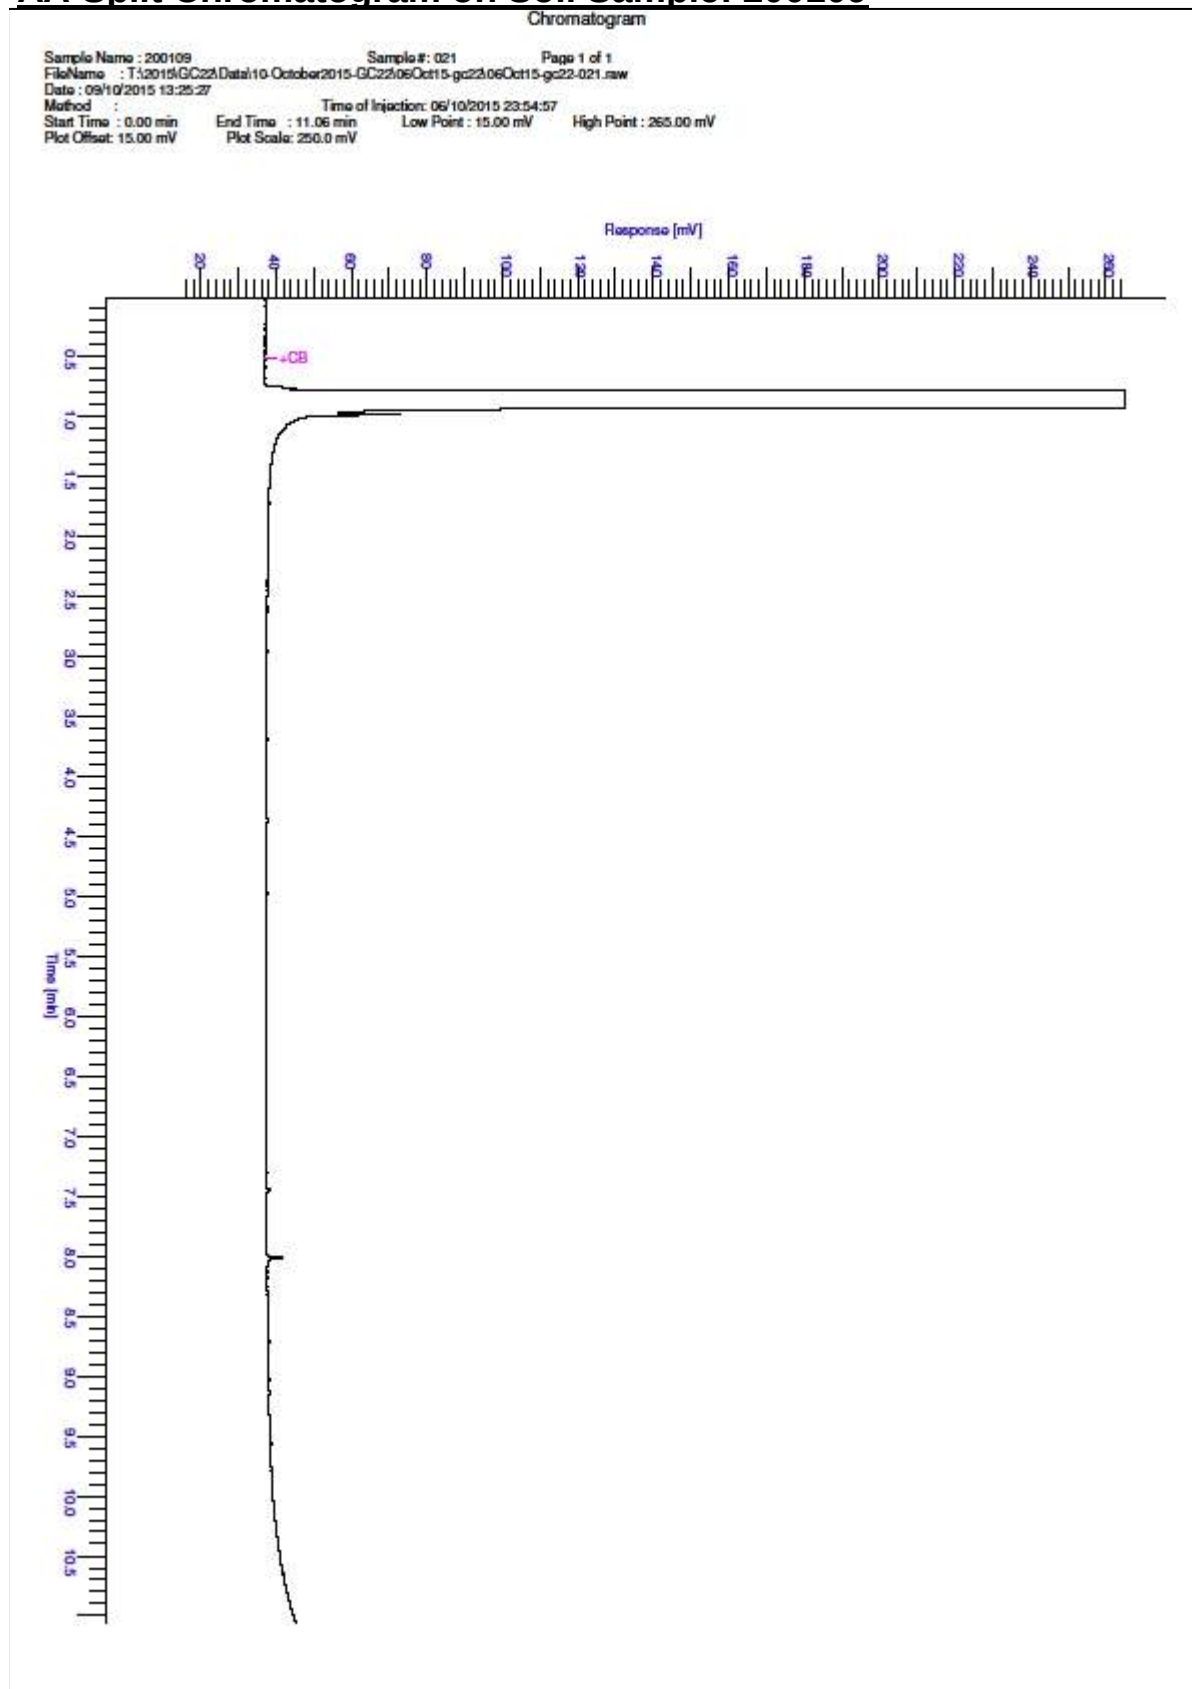
AA-Split Chromatogram on Soil Sample: 200071



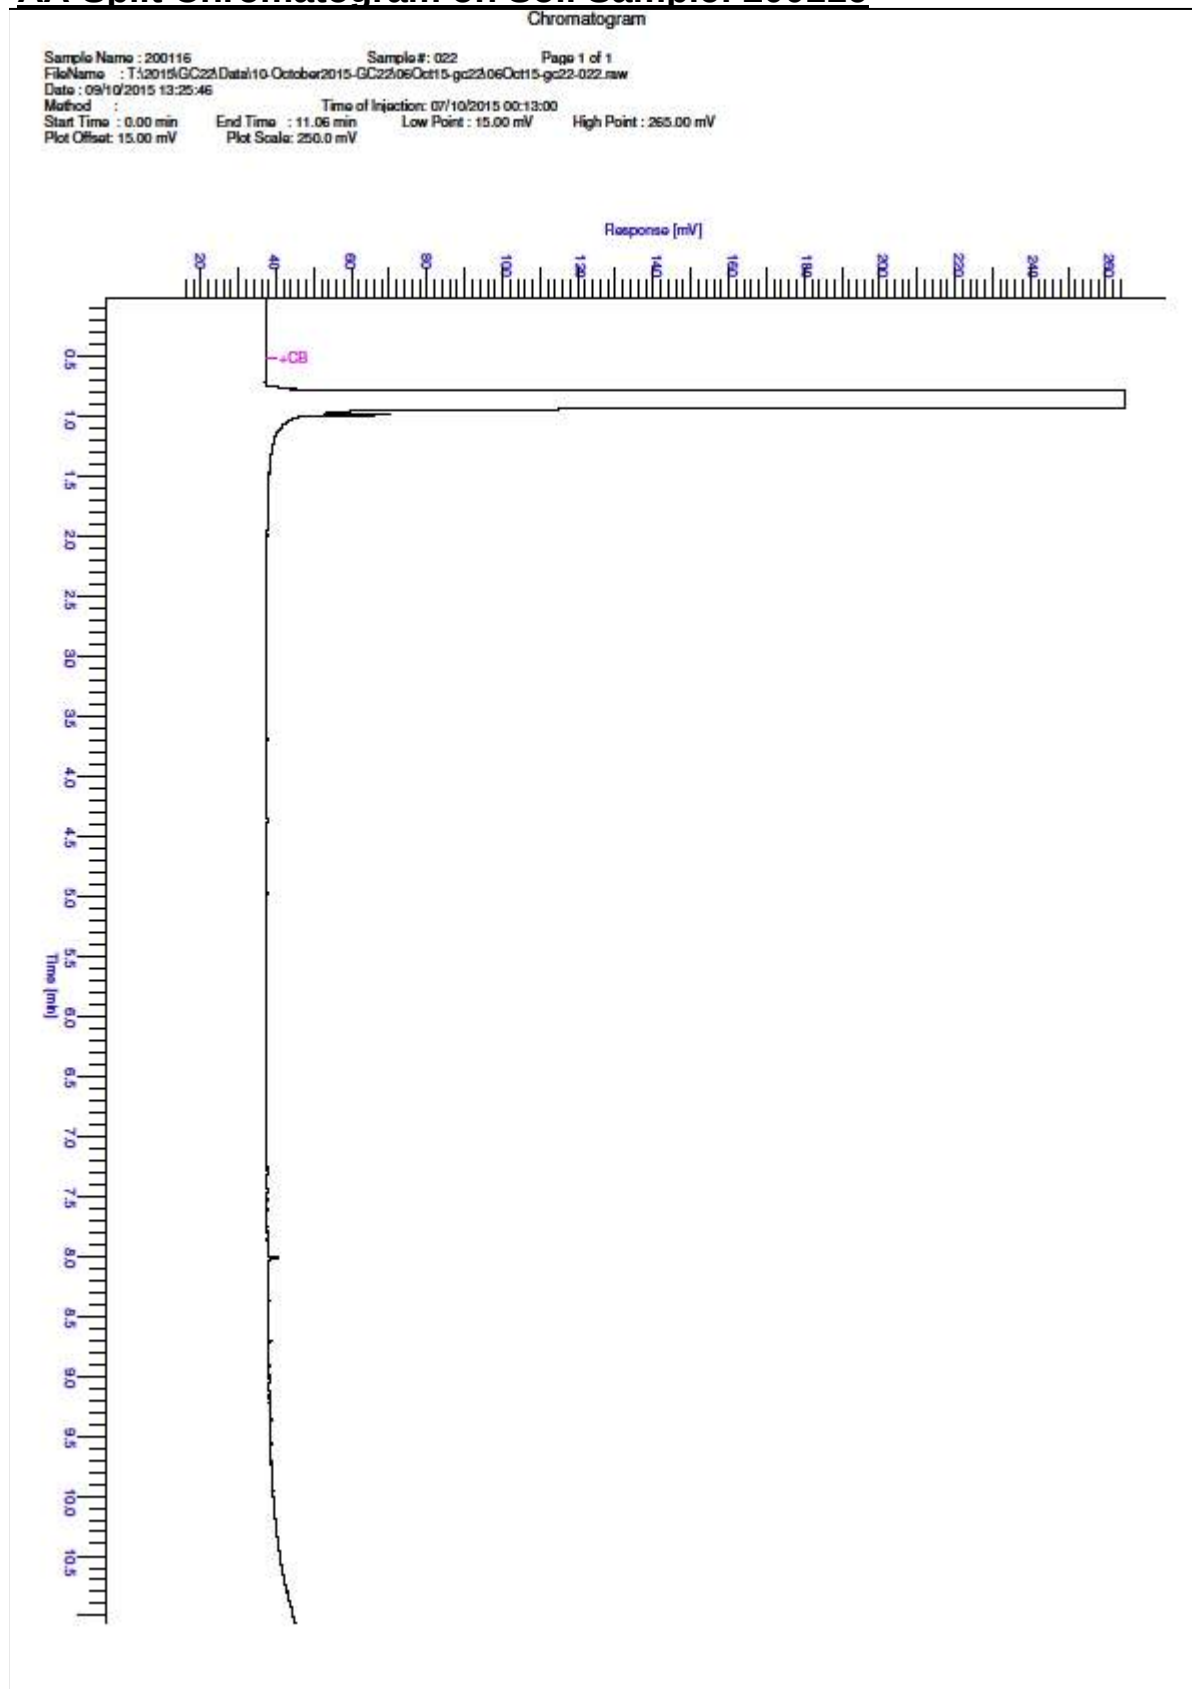
AA-Split Chromatogram on Soil Sample: 200095



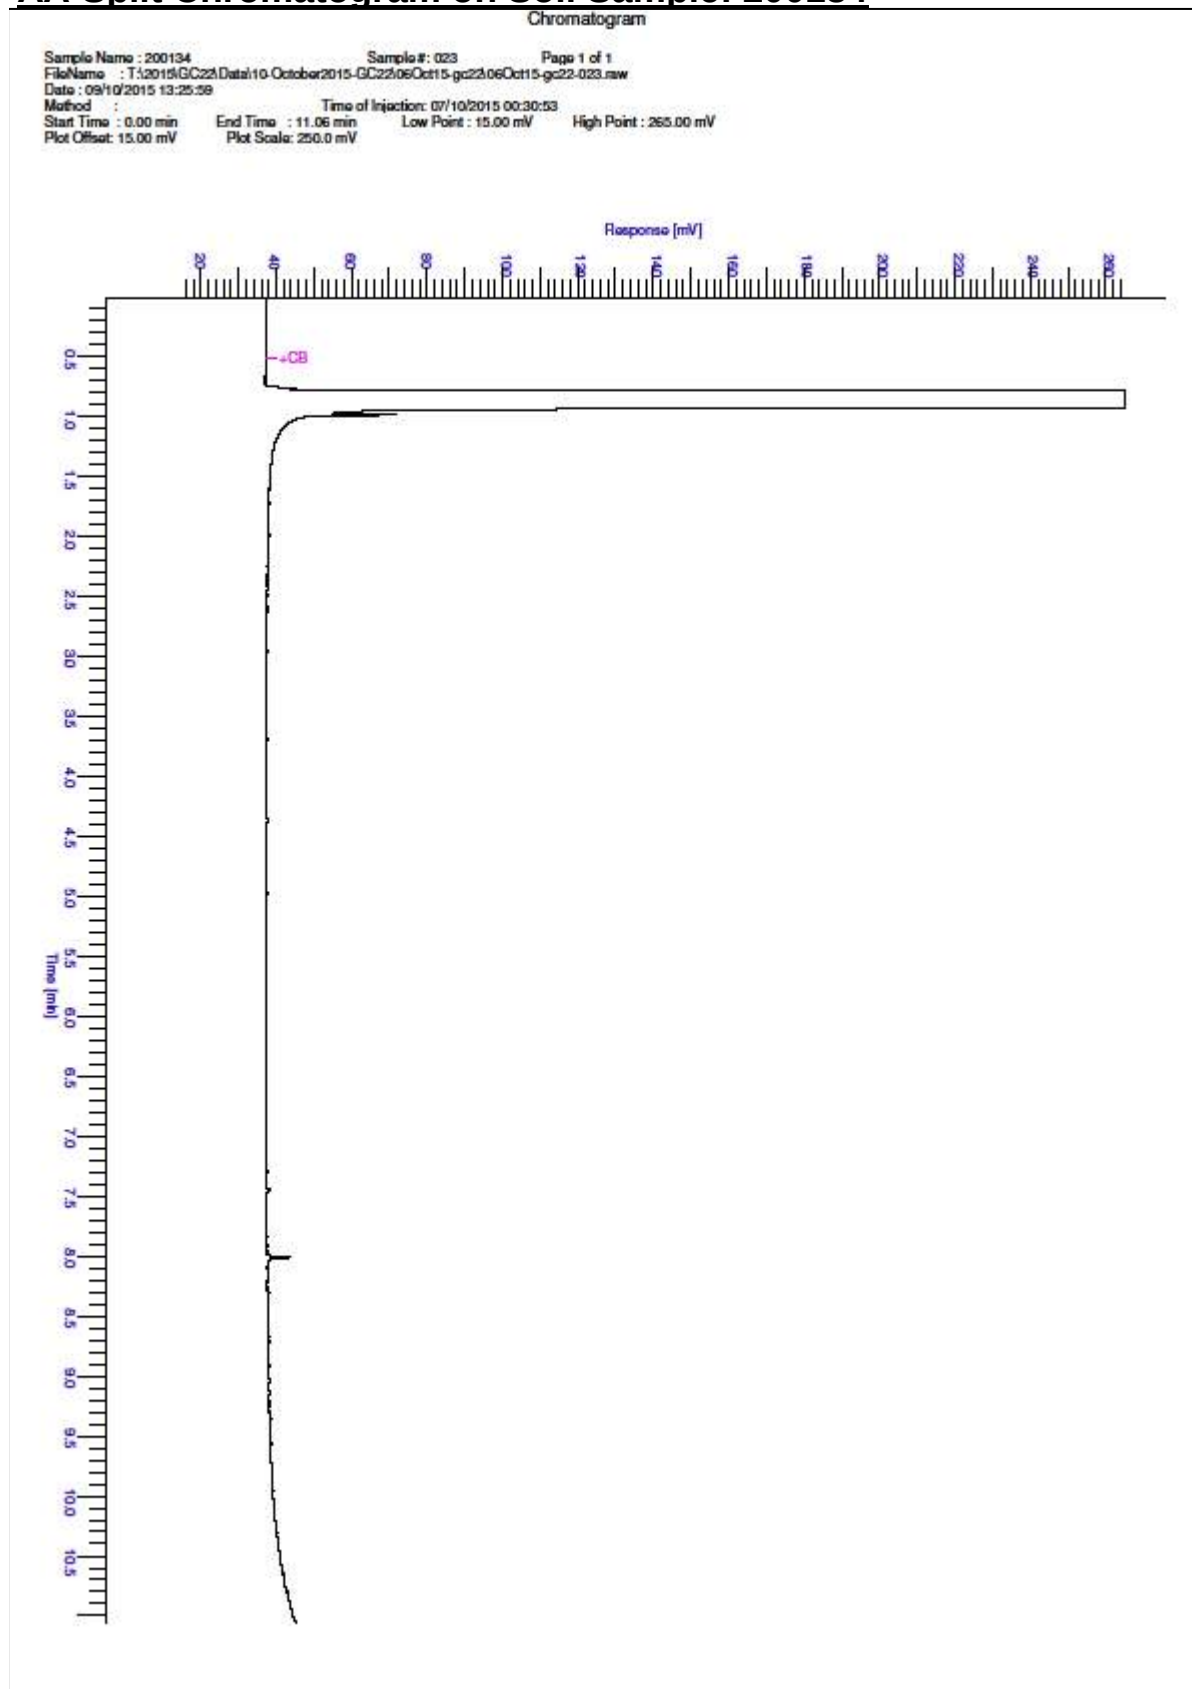
AA-Split Chromatogram on Soil Sample: 200109



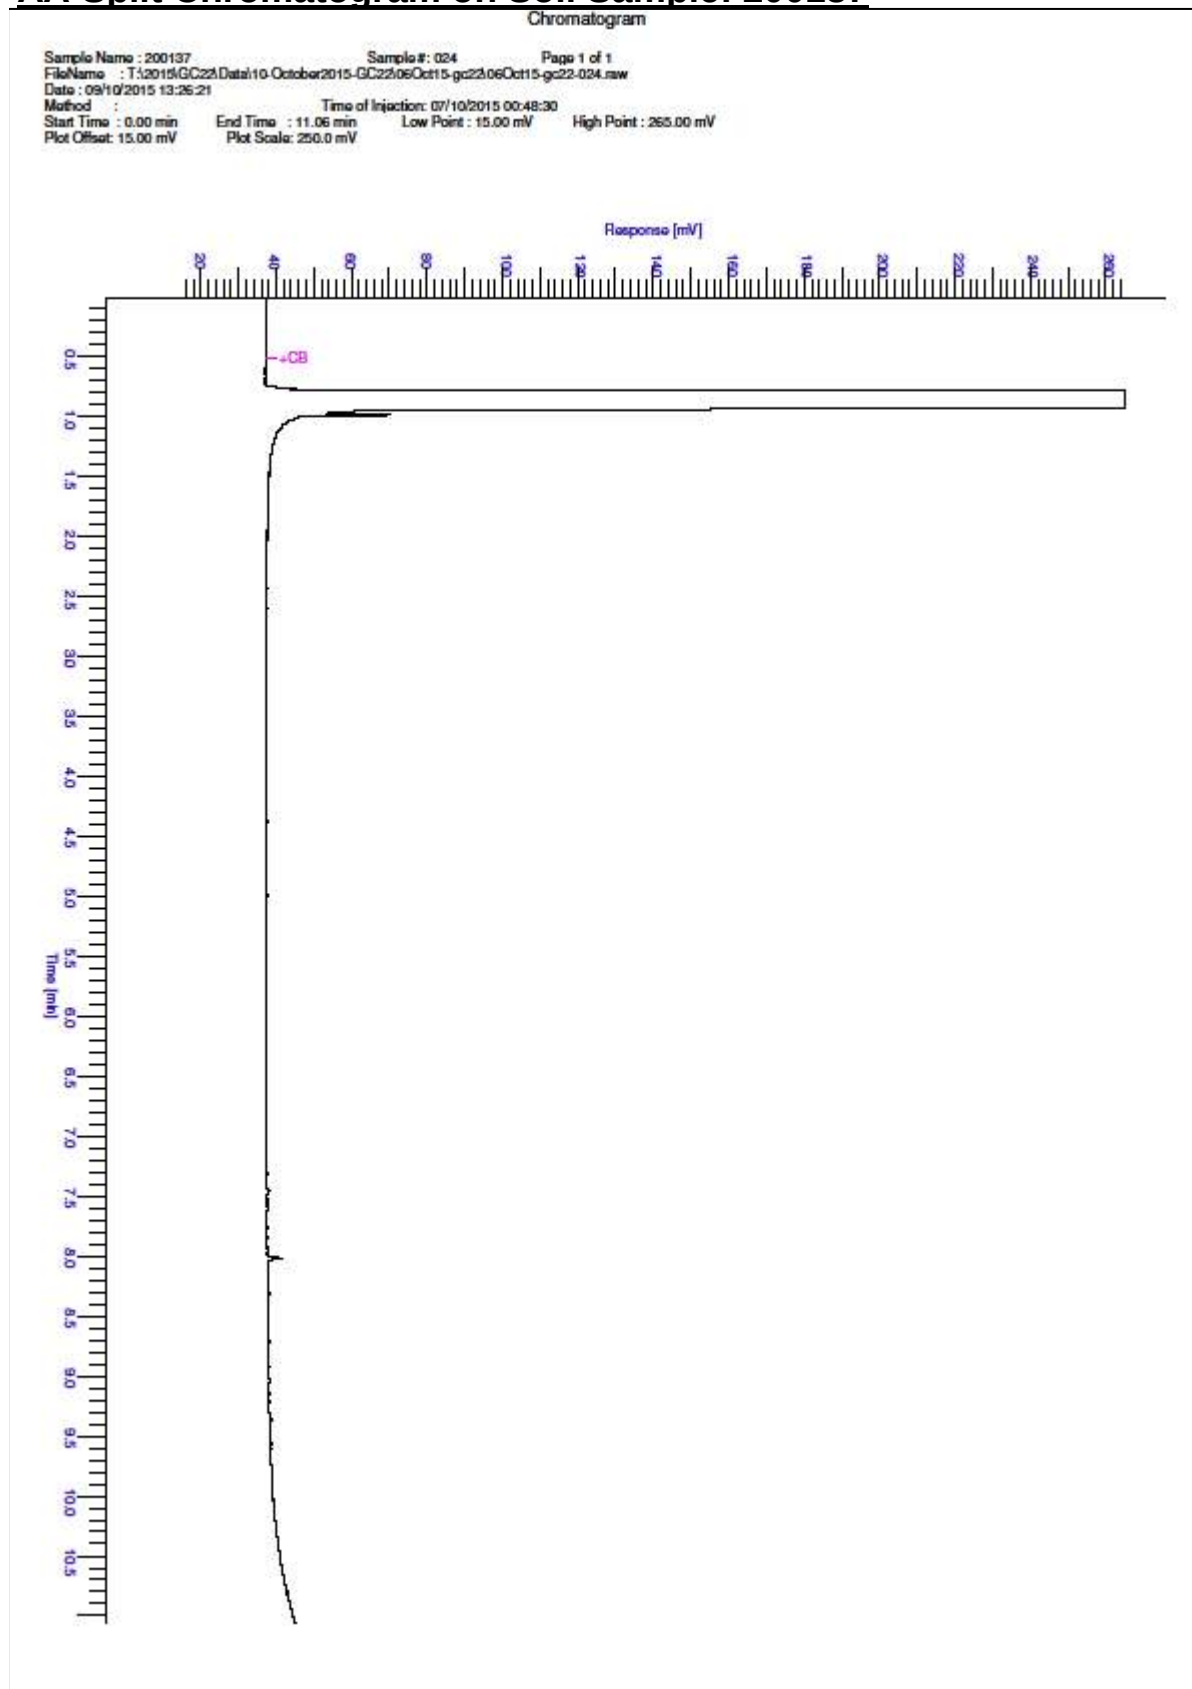
AA-Split Chromatogram on Soil Sample: 200116



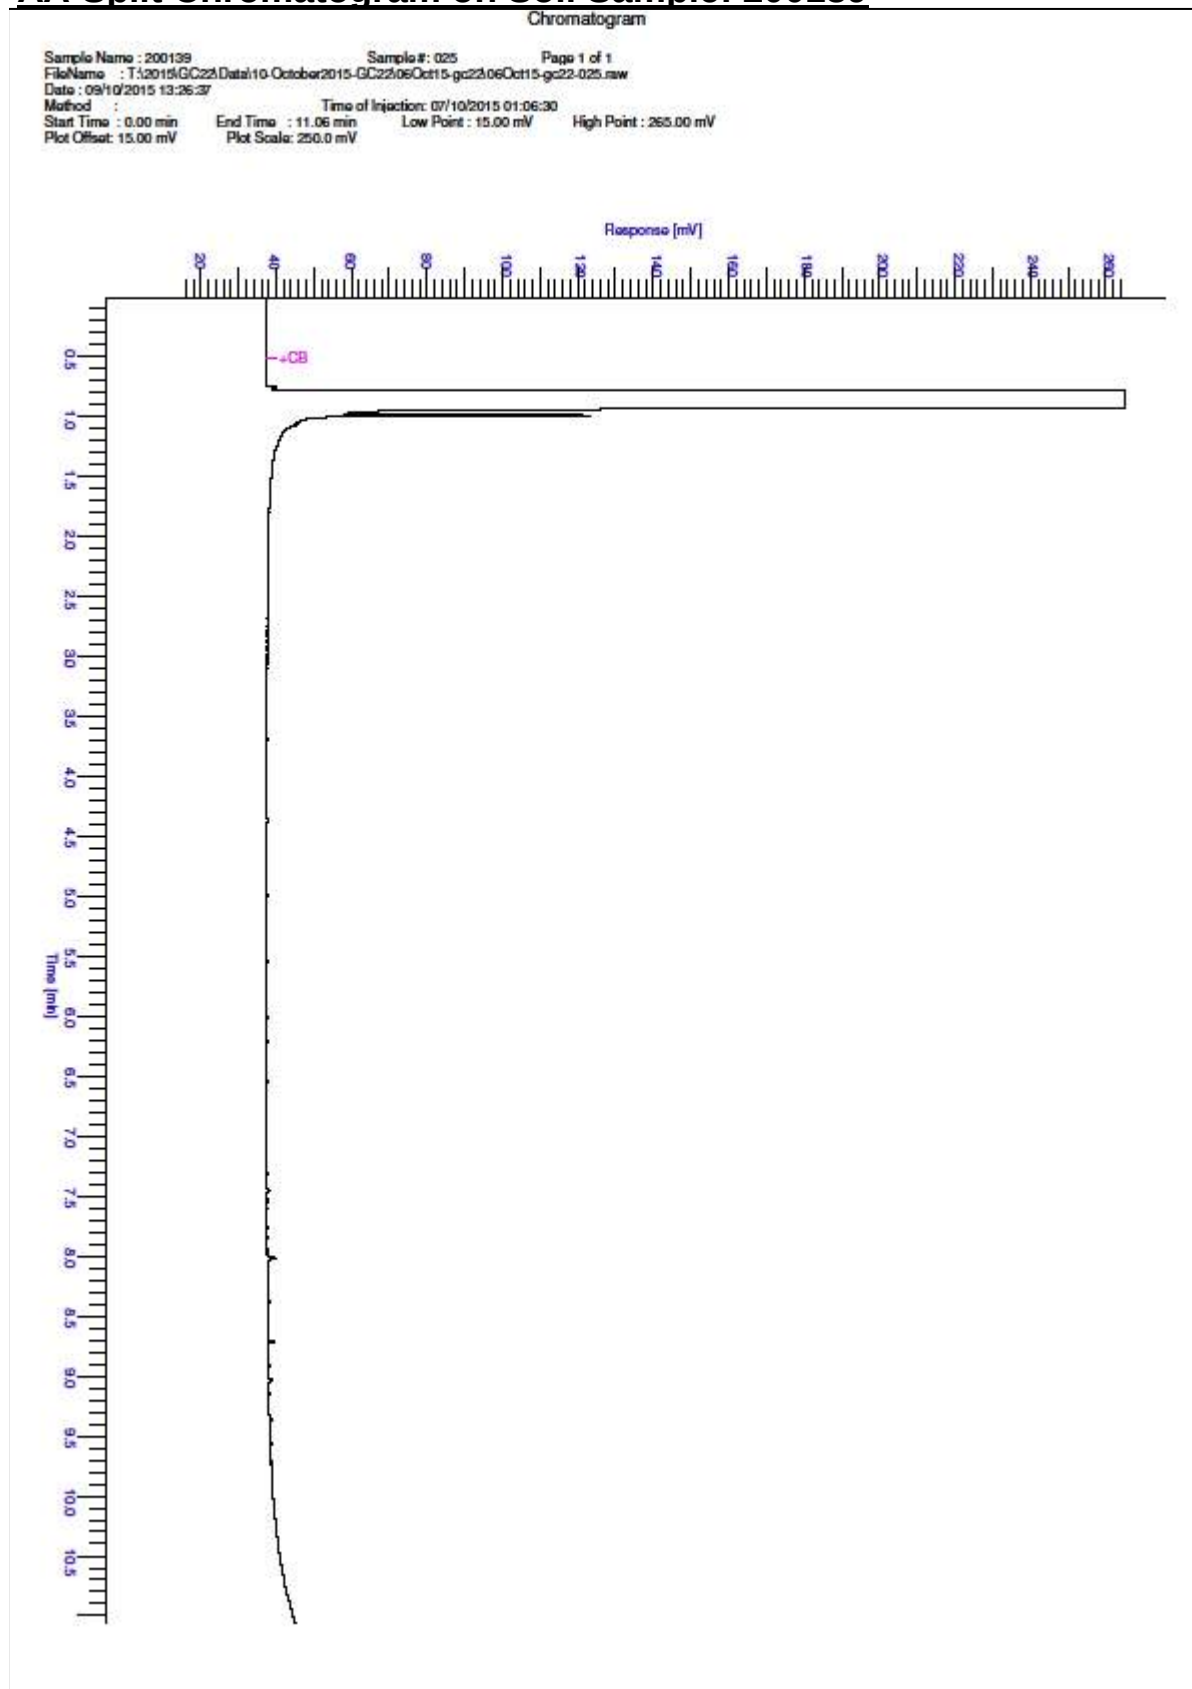
AA-Split Chromatogram on Soil Sample: 200134



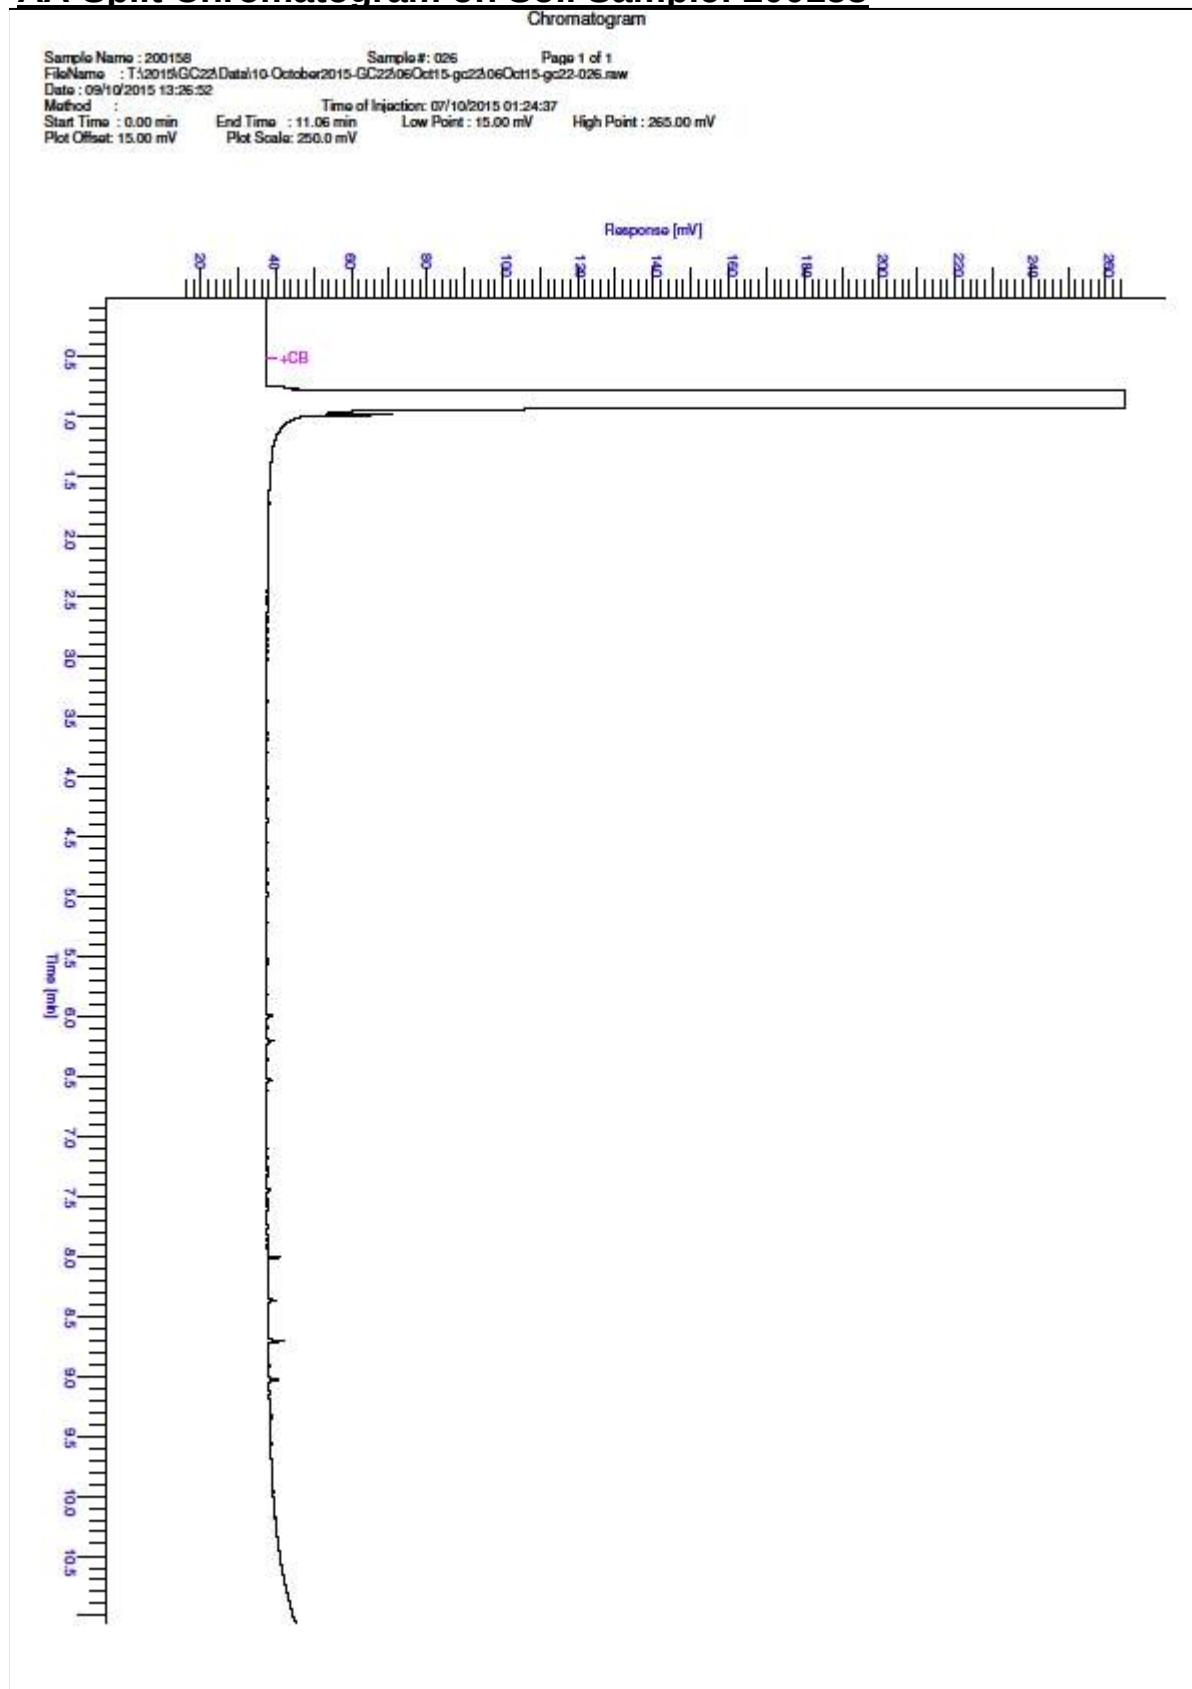
AA-Split Chromatogram on Soil Sample: 200137



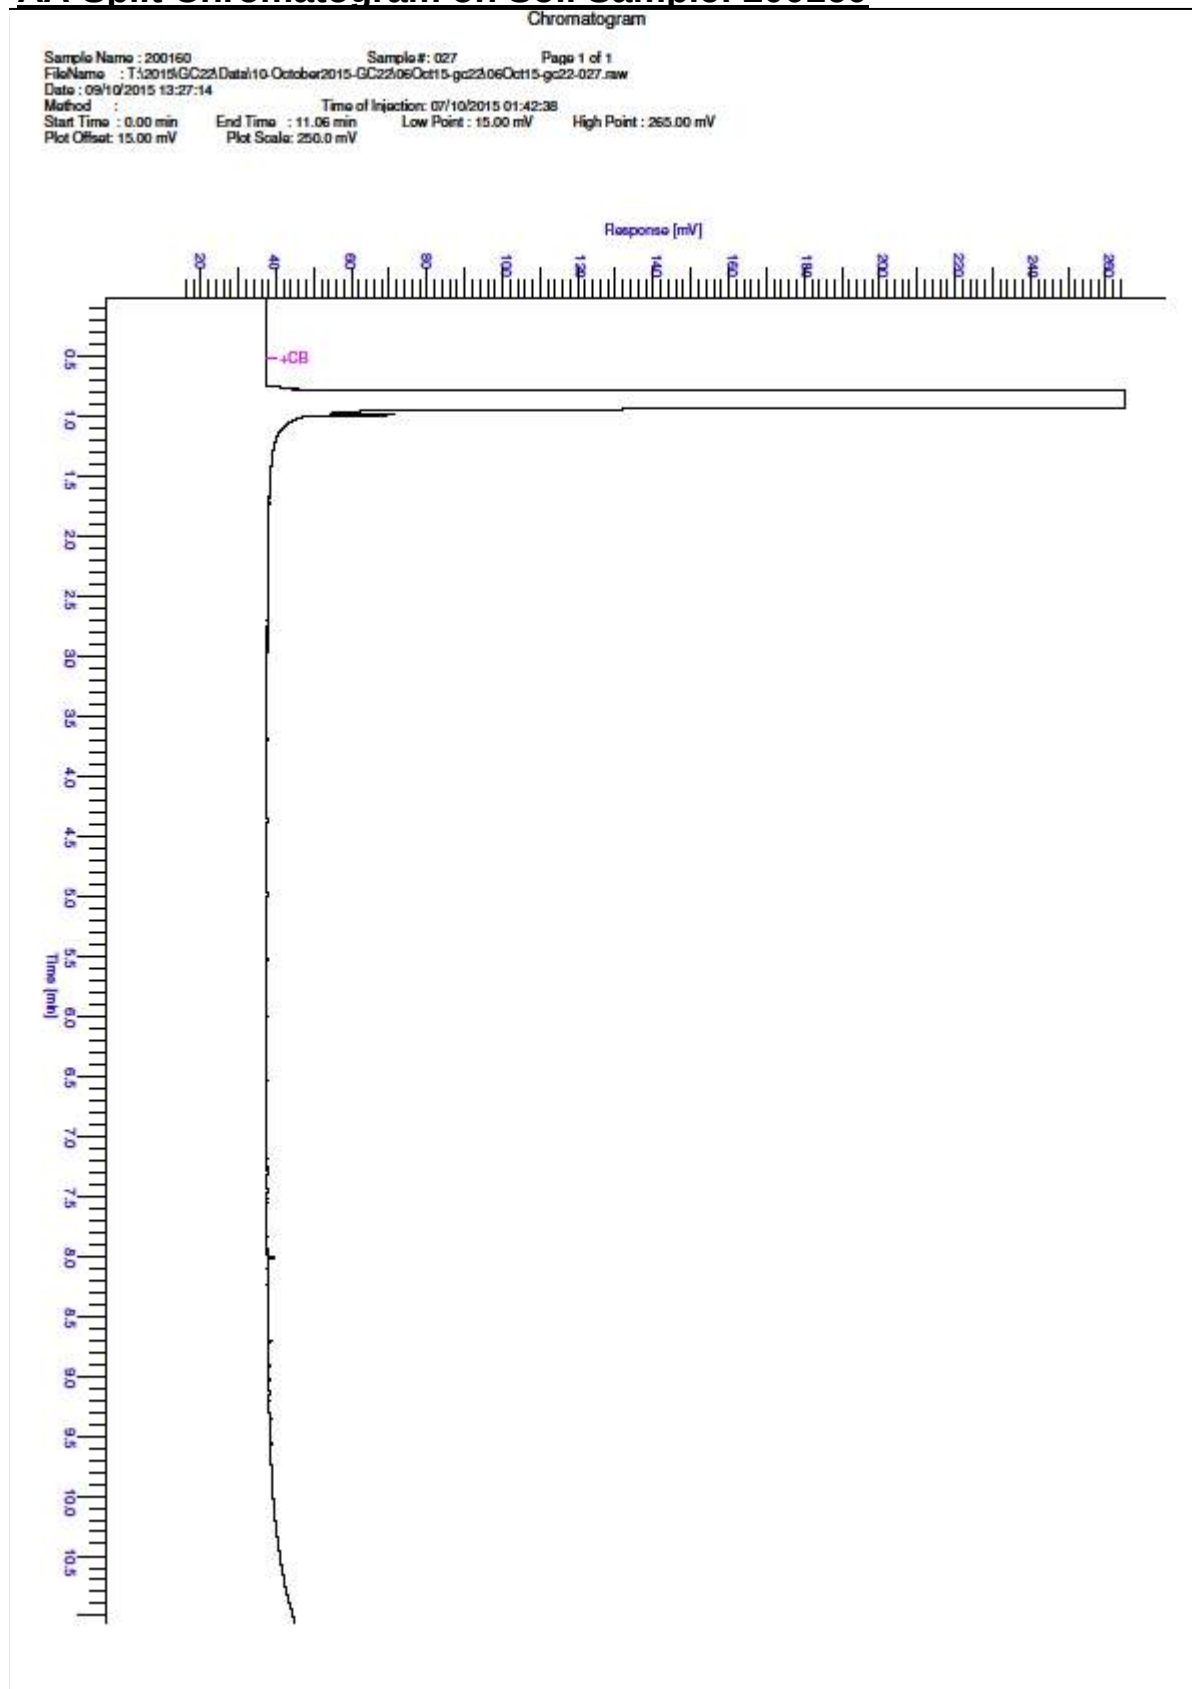
AA-Split Chromatogram on Soil Sample: 200139



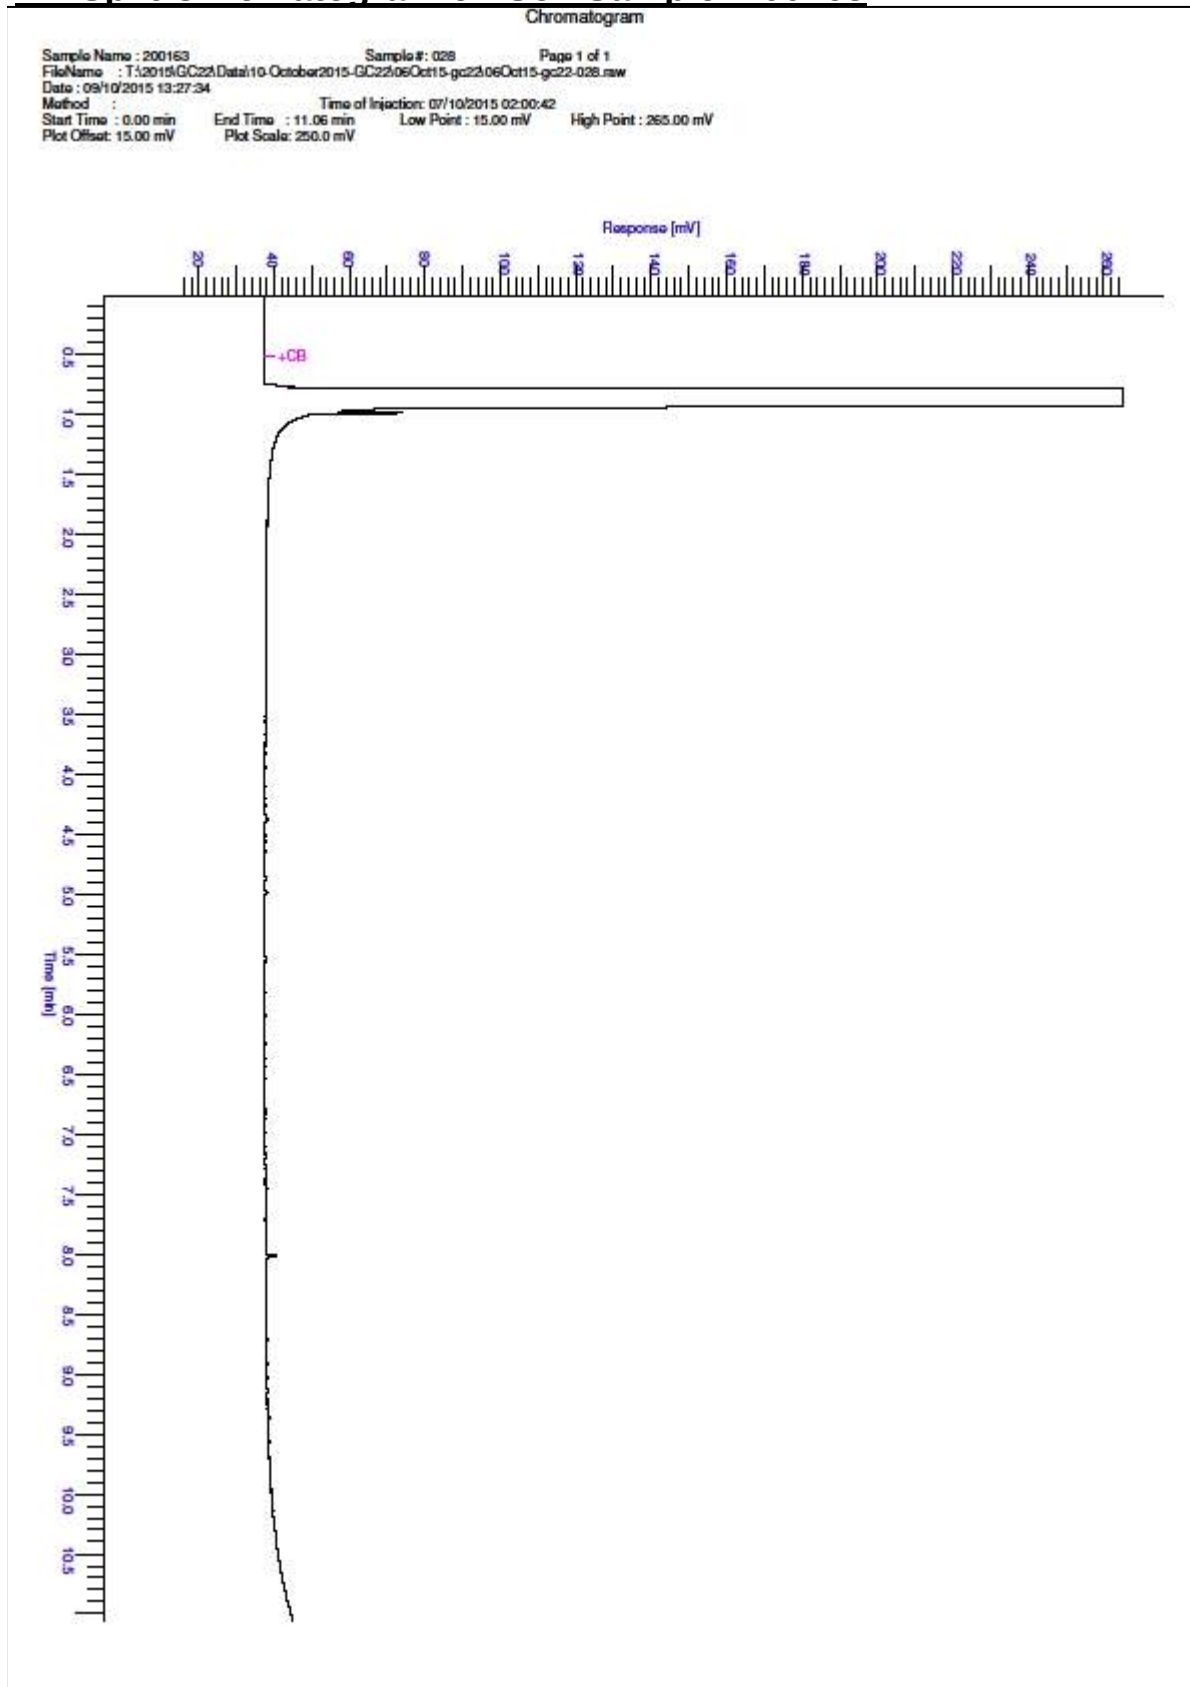
AA-Split Chromatogram on Soil Sample: 200158



AA-Split Chromatogram on Soil Sample: 200160



AA-Split Chromatogram on Soil Sample: 200163



Report Information

Key

- U UKAS accredited
- M MCERTS and UKAS accredited
- N Unaccredited
- S This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
- SN This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
- T This analysis has been subcontracted to an unaccredited laboratory
- I/S Insufficient Sample
- U/S Unsuitable Sample
- N/E not evaluated
- < "less than"
- > "greater than"

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVCOs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at our Coventry laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

- A - Date of sampling not supplied
- B - Sample age exceeds stability time (sampling to extraction)
- C - Sample not received in appropriate containers
- D - Broken Container

Sample Retention and Disposal

All soil samples will be retained for a period of 60 days from the date of receipt

All water samples will be retained for 14 days from the date of receipt

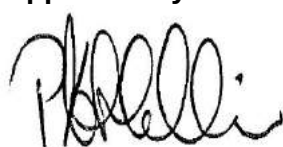
Charges may apply to extended sample storage

If you require extended retention of samples, please email your requirements to:

customerservices@chemtest.co.uk



Final Report

Report No.:	15-23813-1		
Initial Date of Issue:	15-Oct-2015		
Client	MLM		
Client Address:	55 Charlotte Street Birmingham B3 1PX		
Contact(s):	Michael Maynard		
Project	773135 - Ruabon Park		
Quotation No.:		Date Received:	12-Oct-2015
Order No.:		Date Instructed:	12-Oct-2015
No. of Samples:	10	Target Date:	16-Oct-2015
Turnaround (Wkdays):	5	Results Due:	16-Oct-2015
Date Approved:	15-Oct-2015		
Approved By:			
Details:	Phil Hellier, Project Director		

Results - Water

Project: 773135 - Ruabon Park

Client: MLM	Chemtest Job No.:				15-23813	15-23813	15-23813	15-23813	15-23813	15-23813	15-23813	15-23813	15-23813
Quotation No.:	Chemtest Sample ID.:				203888	203889	203890	203891	203892	203893	203894	203895	203896
Order No.:	Client Sample Ref.:				WS01	WS02	WS03	WS04	WS07	WS09	WS11	WS13	WS14
	Client Sample ID.:				W1	W1	W1	W1	W1	W1	W1	W1	W1
	Sample Type:				WATER	WATER	WATER	WATER	WATER	WATER	WATER	WATER	WATER
	Top Depth (m):				3.25	2.79	2.65	2.2	3.0	3.44	3.80	2.10	2.04
	Bottom Depth (m):												
	Date Sampled:				07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015
Determinand	Accred.	SOP	Units	LOD									
pH	U	1010		N/A	8.0	7.2	8.0	8.1	8.0	8.1	8.2	8.3	8.2
Sulphate	U	1220	mg/l	1.0	71	58	170	97	45	66	42	66	47
Hardness	U	1415	mg/l	15	410	670	490	420	370	390	320	320	360
Arsenic (Dissolved)	U	1450	µg/l	1.0	< 1.0	1.3	< 1.0	1.4	< 1.0	1.2	< 1.0	< 1.0	< 1.0
Cadmium (Dissolved)	U	1450	µg/l	0.080	0.17	0.29	0.11	0.18	< 0.080	0.13	< 0.080	< 0.080	< 0.080
Chromium (Dissolved)	U	1450	µg/l	1.0	1.8	3.9	2.3	1.8	1.5	2.1	2.5	< 1.0	4.2
Copper (Dissolved)	U	1450	µg/l	1.0	< 1.0	3.9	1.0	< 1.0	< 1.0	2.2	1.1	1.1	1.5
Mercury (Dissolved)	U	1450	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Nickel (Dissolved)	U	1450	µg/l	1.0	5.3	9.9	2.4	2.4	2.0	2.0	< 1.0	1.5	1.3
Lead (Dissolved)	U	1450	µg/l	1.0	< 1.0	< 1.0	< 1.0	< 1.0	< 1.0	< 1.0	< 1.0	< 1.0	< 1.0
Selenium (Dissolved)	U	1450	µg/l	1.0	< 1.0	5.6	< 1.0	< 1.0	1.5	< 1.0	1.1	< 1.0	< 1.0
Zinc (Dissolved)	U	1450	µg/l	1.0	8.3	21	7.4	5.5	2.1	3.9	2.1	3.2	20
Chromium (Hexavalent)	U	1490	µg/l	20	[B] < 20	[B] < 20	[B] < 20	[B] < 20	[B] < 20	[B] < 20	[B] < 20	[B] < 20	[B] < 20
Aliphatic TPH >C5-C6	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C6-C8	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C8-C10	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C10-C12	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C12-C16	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C16-C21	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C21-C35	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C35-C44	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Total Aliphatic Hydrocarbons	N	1675	µg/l	5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0
Aromatic TPH >C5-C7	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C7-C8	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C8-C10	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C10-C12	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C12-C16	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C16-C21	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C21-C35	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C35-C44	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Total Aromatic Hydrocarbons	N	1675	µg/l	5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0
Total Petroleum Hydrocarbons	N	1675	µg/l	10	[B] < 10	[B] < 10	[B] < 10	[B] < 10	[B] < 10	[B] < 10	[B] < 10	[B] < 10	[B] < 10
Naphthalene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Acenaphthylene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Acenaphthene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Fluorene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Phenanthrene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Anthracene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10

Results - Water

Project: 773135 - Ruabon Park

Client: MLM	Chemtest Job No.:				15-23813	15-23813	15-23813	15-23813	15-23813	15-23813	15-23813	15-23813	15-23813
Quotation No.:	Chemtest Sample ID.:				203888	203889	203890	203891	203892	203893	203894	203895	203896
Order No.:	Client Sample Ref.:				WS01	WS02	WS03	WS04	WS07	WS09	WS11	WS13	WS14
	Client Sample ID.:				W1	W1	W1	W1	W1	W1	W1	W1	W1
	Sample Type:				WATER	WATER	WATER	WATER	WATER	WATER	WATER	WATER	WATER
	Top Depth (m):				3.25	2.79	2.65	2.2	3.0	3.44	3.80	2.10	2.04
	Bottom Depth (m):												
	Date Sampled:				07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015	07-May-2015
Determinand	Accred.	SOP	Units	LOD									
Fluoranthene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Pyrene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Benzo[a]anthracene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Chrysene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Benzo[b]fluoranthene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Benzo[k]fluoranthene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Benzo[a]pyrene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Indeno(1,2,3-c,d)Pyrene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Dibenz(a,h)Anthracene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Benzo[g,h,i]perylene	U	1700	µg/l	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10
Total Of 16 PAH's	U	1700	µg/l	2.0	< 2.0	< 2.0	< 2.0	< 2.0	< 2.0	< 2.0	< 2.0	< 2.0	< 2.0

Project: 773135 - Ruabon Park

Client: MLM	Chemtest Job No.: 15-23813			
Quotation No.:	Chemtest Sample ID.: 203897			
Order No.:	Client Sample Ref.: WS15			
	Client Sample ID.: W1			
	Sample Type: WATER			
	Top Depth (m): 2.18			
	Bottom Depth (m):			
	Date Sampled: 07-May-2015			
Determinand	Accred.	SOP	Units	LOD
pH	U	1010		N/A
Sulphate	U	1220	mg/l	1.0
Hardness	U	1415	mg/l	15
Arsenic (Dissolved)	U	1450	µg/l	1.0
Cadmium (Dissolved)	U	1450	µg/l	0.080
Chromium (Dissolved)	U	1450	µg/l	1.0
Copper (Dissolved)	U	1450	µg/l	1.0
Mercury (Dissolved)	U	1450	µg/l	0.50
Nickel (Dissolved)	U	1450	µg/l	1.0
Lead (Dissolved)	U	1450	µg/l	1.0
Selenium (Dissolved)	U	1450	µg/l	1.0
Zinc (Dissolved)	U	1450	µg/l	1.0
Chromium (Hexavalent)	U	1490	µg/l	20
Aliphatic TPH >C5-C6	N	1675	µg/l	0.10
Aliphatic TPH >C6-C8	N	1675	µg/l	0.10
Aliphatic TPH >C8-C10	N	1675	µg/l	0.10
Aliphatic TPH >C10-C12	N	1675	µg/l	0.10
Aliphatic TPH >C12-C16	N	1675	µg/l	0.10
Aliphatic TPH >C16-C21	N	1675	µg/l	0.10
Aliphatic TPH >C21-C35	N	1675	µg/l	0.10
Aliphatic TPH >C35-C44	N	1675	µg/l	0.10
Total Aliphatic Hydrocarbons	N	1675	µg/l	5.0
Aromatic TPH >C5-C7	N	1675	µg/l	0.10
Aromatic TPH >C7-C8	N	1675	µg/l	0.10
Aromatic TPH >C8-C10	N	1675	µg/l	0.10
Aromatic TPH >C10-C12	N	1675	µg/l	0.10
Aromatic TPH >C12-C16	N	1675	µg/l	0.10
Aromatic TPH >C16-C21	N	1675	µg/l	0.10
Aromatic TPH >C21-C35	N	1675	µg/l	0.10
Aromatic TPH >C35-C44	N	1675	µg/l	0.10
Total Aromatic Hydrocarbons	N	1675	µg/l	5.0
Total Petroleum Hydrocarbons	N	1675	µg/l	10
Naphthalene	U	1700	µg/l	0.10
Acenaphthylene	U	1700	µg/l	0.10
Acenaphthene	U	1700	µg/l	0.10
Fluorene	U	1700	µg/l	0.10
Phenanthrene	U	1700	µg/l	0.10
Anthracene	U	1700	µg/l	0.10

Results - Water

Project: 773135 - Ruabon Park

Client: MLM	Chemtest Job No.:		15-23813		
Quotation No.:	Chemtest Sample ID.:		203897		
Order No.:	Client Sample Ref.:		WS15		
	Client Sample ID.:		W1		
	Sample Type:		WATER		
	Top Depth (m):		2.18		
	Bottom Depth (m):				
	Date Sampled:		07-May-2015		
Determinand	Accred.	SOP	Units	LOD	
Fluoranthene	U	1700	µg/l	0.10	< 0.10
Pyrene	U	1700	µg/l	0.10	< 0.10
Benzo[a]anthracene	U	1700	µg/l	0.10	< 0.10
Chrysene	U	1700	µg/l	0.10	< 0.10
Benzo[b]fluoranthene	U	1700	µg/l	0.10	< 0.10
Benzo[k]fluoranthene	U	1700	µg/l	0.10	< 0.10
Benzo[a]pyrene	U	1700	µg/l	0.10	< 0.10
Indeno(1,2,3-c,d)Pyrene	U	1700	µg/l	0.10	< 0.10
Dibenz(a,h)Anthracene	U	1700	µg/l	0.10	< 0.10
Benzo[g,h,i]perylene	U	1700	µg/l	0.10	< 0.10
Total Of 16 PAH's	U	1700	µg/l	2.0	< 2.0

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample ID:	Sample Ref:	Sample ID:	Sampled Date:	Deviation Code(s):	Containers Received:
203888	WS01	W1	07-May-2015	B	Coloured Winchester 1000ml
203888	WS01	W1	07-May-2015	B	Plastic Bottle 1000ml
203889	WS02	W1	07-May-2015	B	Coloured Winchester 1000ml
203889	WS02	W1	07-May-2015	B	Plastic Bottle 1000ml
203890	WS03	W1	07-May-2015	B	Coloured Winchester 1000ml
203890	WS03	W1	07-May-2015	B	Plastic Bottle 1000ml
203891	WS04	W1	07-May-2015	B	Coloured Winchester 1000ml
203891	WS04	W1	07-May-2015	B	Plastic Bottle 1000ml
203892	WS07	W1	07-May-2015	B	Coloured Winchester 1000ml
203892	WS07	W1	07-May-2015	B	Plastic Bottle 1000ml
203893	WS09	W1	07-May-2015	B	Coloured Winchester 1000ml
203893	WS09	W1	07-May-2015	B	Plastic Bottle 1000ml
203894	WS11	W1	07-May-2015	B	Coloured Winchester 1000ml
203895	WS13	W1	07-May-2015	B	Coloured Winchester 1000ml
203895	WS13	W1	07-May-2015	B	Plastic Bottle 1000ml
203896	WS14	W1	07-May-2015	B	Coloured Winchester 1000ml
203896	WS14	W1	07-May-2015	B	Plastic Bottle 1000ml
203897	WS15	W1	07-May-2015	B	Coloured Winchester 1000ml
203897	WS15	W1	07-May-2015	B	Plastic Bottle 1000ml

Report Information

Key

- U UKAS accredited
- M MCERTS and UKAS accredited
- N Unaccredited
- S This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
- SN This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
- T This analysis has been subcontracted to an unaccredited laboratory
- I/S Insufficient Sample
- U/S Unsuitable Sample
- N/E not evaluated
- < "less than"
- > "greater than"

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVCOs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at our Coventry laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

- A - Date of sampling not supplied
- B - Sample age exceeds stability time (sampling to extraction)
- C - Sample not received in appropriate containers
- D - Broken Container

Sample Retention and Disposal

All soil samples will be retained for a period of 60 days from the date of receipt

All water samples will be retained for 14 days from the date of receipt

Charges may apply to extended sample storage

If you require extended retention of samples, please email your requirements to:
customerservices@chemtest.co.uk

Appendix E

Soakaway Test Results

SOAKAWAY TEST RESULTS

Based on BRE Digest 365: Soakaway Design (2007)



Project Name: Ruabon Park, Wrexham

Location: Wrexham, Wales

Project Ref: 773135

Test Location: **TP21**

Soil Infiltration Rate (m/sec)

Test Failed

Readings:

Time (mins)	Water Level (m bgl)
1	0.40
2	0.41
3	0.41
4	0.42
5	0.42
10	0.44
16	0.46
20	0.48
25	0.49
30	0.50
60	0.58
120	0.67
180	0.80
240	0.83
300	0.90
360	0.96

Trial Pit Dimensions (m)

Length	2.90
Width	0.75
Depth	2.20

Assumed Invert Level (m bgl)

0.40

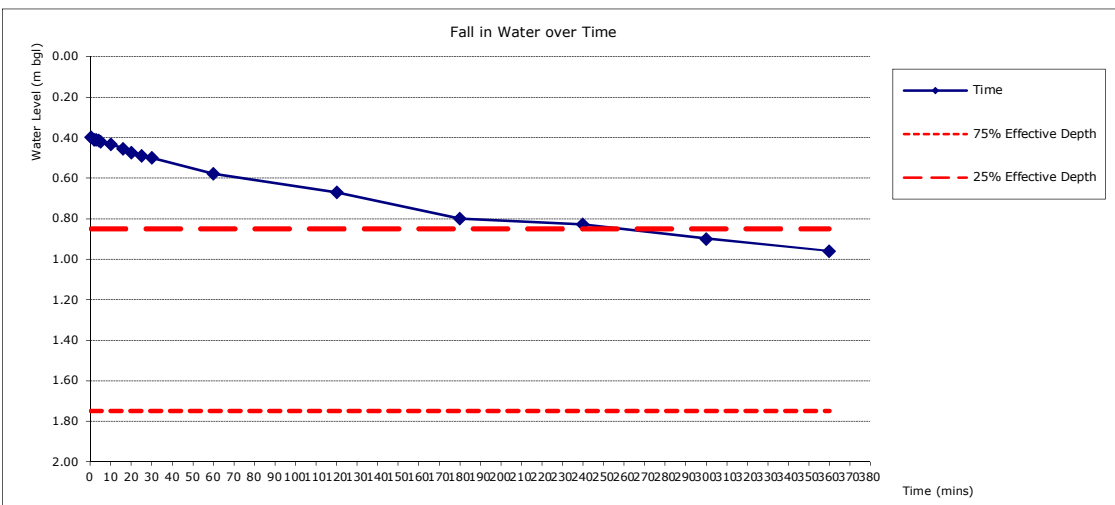
Ground Conditions:

Refer to engineers logs

Was trial pit filled with gravel (Yes/No):

No

Remarks:



Soil Infiltration Rate (m/sec) $f = \frac{V_{p75-25}}{a_{p50} \times t_{p75-25}}$

Fill Porosity	Assumed porosity of granular fill material based on CIRIA 156 (%)	0.35
V_{p75-25}	Effective depth storage volume of water in the trial pit between 75% and 25% effective depth	1.96
Revised V_{p75-25}	Reduced effective storage volume as a result of gravel fill	0.69
a_{p50}	The internal surface area of the trial pit up to 50% effective depth and including the base area	8.75
t_{p75-25}	The time for the water level to fall from 75% to 25% effective depth	

Soil Infiltration Rate (m/sec) $f = 1.958$

f Test Failed

SOAKAWAY TEST RESULTS

Based on BRE Digest 365: Soakaway Design (2007)



www.mlm.uk.com

Project Name: Ruabon Park, Wrexham

Location: Wrexham, Wales

Project Ref: 773135

Test Location: **TP12**

Soil Infiltration Rate (m/sec)

Test Failed

Readings:

Time (mins)	Water Level (m bgl)
1	0.31
2	0.33
3	0.36
4	0.37
5	0.38
10	0.44
16	0.51
20	0.55
25	0.58
30	0.62
60	0.72
120	0.76
180	1.00
240	1.05
300	1.13
360	1.20

Trial Pit Dimensions (m)

Length	2.80
Width	0.75
Depth	2.00

Assumed Invert Level (m bgl)

0.31

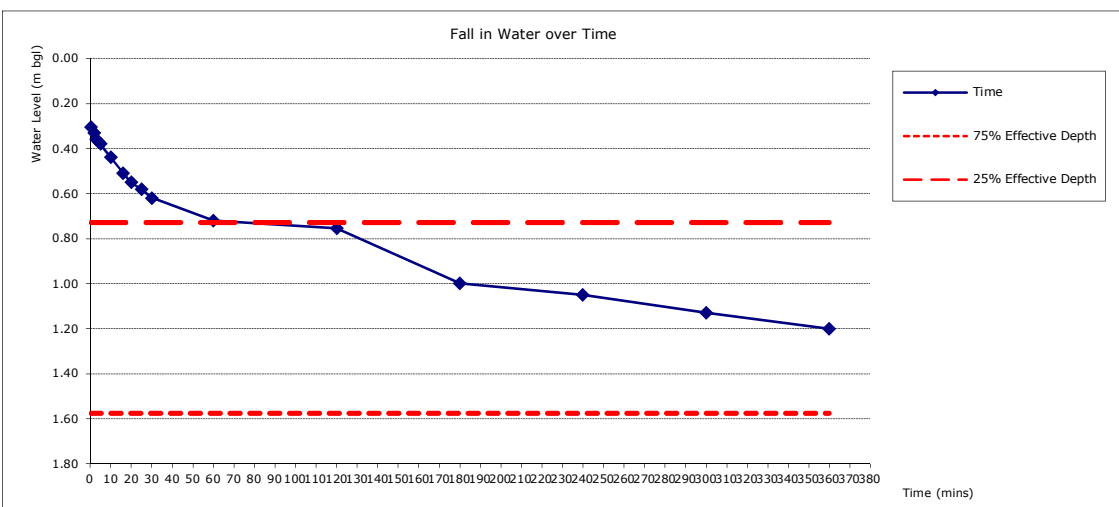
Ground Conditions:

Refer to engineers logs

Was trial pit filled with gravel (Yes/No):

No

Remarks:



Soil Infiltration Rate (m/sec) $f = \frac{V_{p75-25}}{a_{p50} \times t_{p75-25}}$

Fill Porosity	Assumed porosity of granular fill material based on CIRIA 156 (%)	0.35
V_{p75-25}	Effective depth storage volume of water in the trial pit between 75% and 25% effective depth	1.78
Revised V_{p75-25}	Reduced effective storage volume as a result of gravel fill	0.62
a_{p50}	The internal surface area of the trial pit up to 50% effective depth and including the base area	8.12
t_{p75-25}	The time for the water level to fall from 75% to 25% effective depth	

Soil Infiltration Rate (m/sec) $f = 1.780$

f Test Failed

SOAKAWAY TEST RESULTS

Based on BRE Digest 365: Soakaway Design (2007)



www.mlm.uk.com

Project Name: Ruabon Park, Wrexham

Location: Wrexham, Wales

Project Ref: 773135

Test Location: **TP33**

Soil Infiltration Rate (m/sec)

Test Failed

Readings:

Time (mins)	Water Level (m bgl)
1	0.35
2	0.37
3	0.39
4	0.41
5	0.42
10	0.45
16	0.47
20	0.50
25	0.53
40	0.58
50	0.65
60	0.67
90	0.71
120	0.79
150	0.85
180	0.87
240	1.02
300	1.15

Trial Pit Dimensions (m)

Length	3.30
Width	0.70
Depth	1.90

Assumed Invert Level (m bgl)

0.35

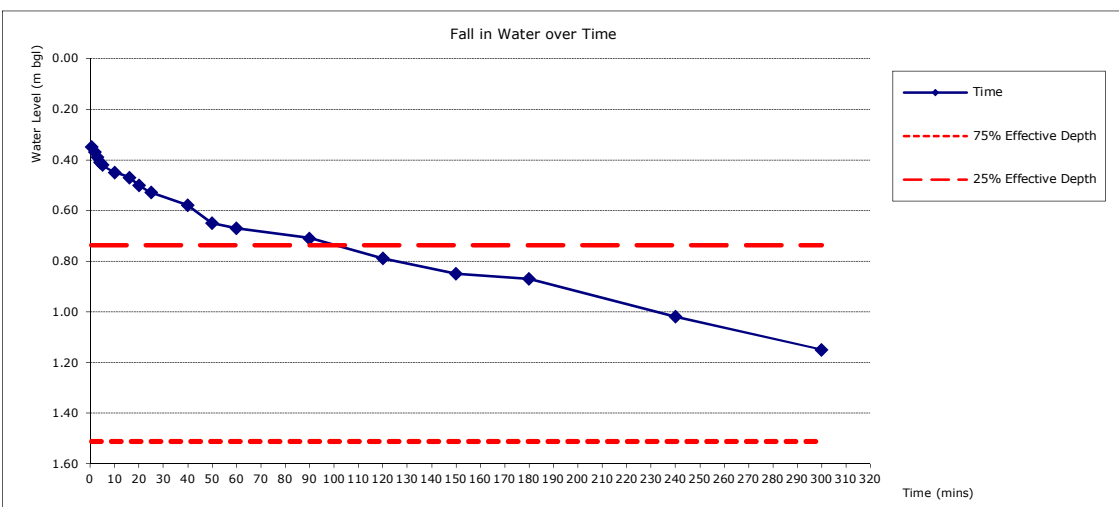
Ground Conditions:

Refer to engineers logs

Was trial pit filled with gravel (Yes/No):

No

Remarks:



Soil Infiltration Rate (m/sec) $f = \frac{V_{p75-25}}{a_{p50} \times t_{p75-25}}$

Fill Porosity	Assumed porosity of granular fill material based on CIRIA 156 (%)	0.35
V_{p75-25}	Effective depth storage volume of water in the trial pit between 75% and 25% effective depth	1.79
Revised V_{p75-25}	Reduced effective storage volume as a result of gravel fill	0.63
a_{p50}	The internal surface area of the trial pit up to 50% effective depth and including the base area	8.51
t_{p75-25}	The time for the water level to fall from 75% to 25% effective depth	

Soil Infiltration Rate (m/sec) $f = 1.790$

f Test Failed

SOAKAWAY TEST RESULTS

Based on BRE Digest 365: Soakaway Design (2007)



www.mlm.uk.com

Project Name: Ruabon Park, Wrexham

Location: Wrexham, Wales

Project Ref: 773135

Test Location: **TP32**

Soil Infiltration Rate (m/sec)

2.96E-04

Readings:

Time (mins)	Water Level (m bgl)
1	1.34
2	1.37
3	1.40
4	1.42
5	1.49
6	1.51
7	1.53
8	1.58
9	1.62
10	1.67
11	1.71
12	1.76
13	1.80

Trial Pit Dimensions (m)

Length	3.30
Width	0.70
Depth	1.90

Assumed Invert Level (m bgl)

1.34

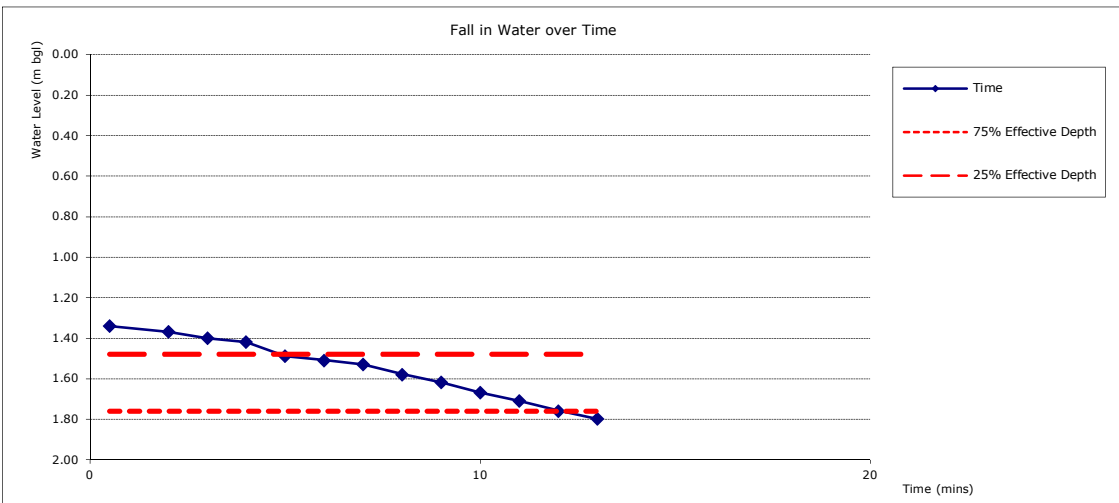
Ground Conditions:

Refer to engineers logs

Was trial pit filled with gravel (Yes/No):

No

Remarks:



Soil Infiltration Rate (m/sec) $f = \frac{V_{p75-25}}{a_{p50} \times t_{p75-25}}$

Fill Porosity	Assumed porosity of granular fill material based on CIRIA 156 (%)	0.35
V_{p75-25}	Effective depth storage volume of water in the trial pit between 75% and 25% effective depth	0.65
Revised V_{p75-25}	Reduced effective storage volume as a result of gravel fill	0.23
a_{p50}	The internal surface area of the trial pit up to 50% effective depth and including the base area	4.55
t_{p75-25}	The time for the water level to fall from 75% to 25% effective depth	8.00

Soil Infiltration Rate (m/sec) $f = \frac{0.647}{2184}$

f 2.96E-04

Appendix F

Generic Assessment Criteria

Screening Levels – Human Health (soil)

LQM/CIEH S4UL (except allotments)	Residential		Allotments	Commercial	Public Open Space (residential)	Public Open Space (park)
	With homegrown produce	Without homegrown produce				
	Metals and semi-metals (based on sandy loam soil with SOM 6%)					
Arsenic (inorganic)	37	40	43	640	79	170
Beryllium	1.7	1.7	35	12	2.2	63
Boron	290	1.1e+4	45	2.4e+5	2.1e+4	4.6e+4
Cadmium	11	85	1.9	190	120	532
Chromium III (or total)	910	910	18000	8600	1500	3.3e+4
Chromium VI (hexavalent)	6	6	1.8	33	7.7	220
Copper	2400	7100	520	6.8e+4	1.2e+4	4.4e+4
Mercury (inorganic)	40	56	19	1100	120	240
Nickel	180	180	230	980	230	3400
Selenium	250	430	88	1.2e+4	1100	1800
Vanadium	410	1200	91	9000	2000	5000
Zinc	3700	4.0e+4	620	7.3e+5	8.1e+4	1.7e+5
Lead (Defra C4SL used in the absence of a published S4UL)	200	310	80	2330	630	1300
	Polycyclic Aromatic Hydrocarbons (based on sandy loam soil with SOM 1%, 2.5% or 6%)					
Acenaphthene	210	3000	34	8.4e+4	1.5e+4	2.9e+4
	510	4700	85	9.7e+4		3.0e+4
	1100	6000	200	1.0e+5		3.0e+4
Acenaphthylene	170	2900	28	8.3e+4	1.5e+4	2.9e+4
	420	4600	69	9.7e+4		3.0e+4
	920	6000	160	1.0e+5		3.0e+4
Anthracene	2400	3.1e+4 ^{vap (1.17)}	380	5.2e+5	7.4e+4	1.5e+5
	5400	3.5e+4	950	5.4e+5		
	1.1e+4	3.7e+4	2200	5.4e+5		
Benzo[a]anthracene	7.2	11	2.9	170	29	49
	11	14	6.5	170		56
	13	15	13	180		62
Benzo[a]pyrene	2.2	3.2	0.97	35	5.7	11
	2.7		2.0	35		12
	3.0		3.5	36		13
Benzo[b]fluoranthene	2.6	3.9	0.99	44	7.1	13
	3.3	4.0	2.1	44	7.2	15
	3.7	4.0	3.9	45	7.2	16
Benzo[ghi]perylene	320	360	290	3900	640	1400
	340		470	4000		1500
	350		640	4000		1600
Benzo[k]fluoranthene	77	110	37	1200	190	370
	93		75			410
	100		130			440
Chrysene	15	30	4.1	350	57	93
	22	31	9.4			110
	27	32	19			120
Dibenzo[ah]anthracene	0.24	0.31	0.14	3.5	0.57	1.1
	0.28	0.32	0.27	3.6	0.57	1.3
	0.30	0.32	0.43	3.6	0.58	1.4
Fluoranthene	280	1500	52	2.3e+4	3100	6300
	560	1600	130			6300
	890	1600	290			6400
Fluorene	170	2800	27	6.3e+4	9900	2.0e+4
	400	3800	67	6.8e+4		
	860	4500	160	7.1e+4		
Indeno[123-cd]pyrene	27	45	9.5	500	82	150
	36	46	21	510		170
	41	46	39	510		180
Naphthalene	2.3	2.3	4.1	190	4900	1200
	5.6	5.6	10	460		1900
	13	13	24	1100		3000
Phenanthrene	95	1300	15	2.2e+4	3100	6200
	220	1500	38	2.2e+4		6200
	440	1500	90	2.3e+4		6300
Pyrene	620	3700	110	5.4e+4	7400	1.5e+4
	1200	3800	270			
	2000	3800	620			

Screening Levels – Human Health (soil)

LQM/CIEH S4UL (except allotments)	Residential		Allotments	Commercial	Public Open Space (residential)	Public Open Space (park)
	With homegrown produce	Without homegrown produce				
	BTEX (based on sandy loam soil with SOM 1%, 2.5% or 6%)					
Benzene	0.087	0.38	0.017	27	72	90
	0.17	0.7	0.034	47	72	100
	0.37	1.4	0.075	90	73	110
Toluene	130	880 ^(vap 869)	22	5.6e+4 ^{vap (869)}	5.6e+4	8.7e+4 ^{vap (869)}
	290	1900	51	1.1e+5 ^{vap (1920)}	5.6e+4	9.5e+4 ^{vap (1920)}
	660	3900	120	1.8e+5 ^{vap (4360)}	5.6e+4	1.0e+5 ^{vap (4360)}
Ethylbenzene	47	83	16	5700 ^{vap (518)}	2.4e+4	1.7e+4 ^{vap (518)}
	110	190	39	1.3e+4 ^{vap (1220)}	2.4e+4	2.2e+4 ^{vap (1220)}
	260	440	91	2.7e+4 ^{vap (2840)}	2.5e+4	2.7e+4 ^{vap (2840)}
m- & p-xylene	56	79	29	5900	4.1e+4	1.7e+4
	130	180	69	1.4e+4	4.2e+4	2.3e+4
	310	430	160	3.0e+4	4.3e+4	3.1e+4
o-xylene	60	88	28	6600	4.1e+4	1.7e+4
	140	210	67	1.5e+4	4.2e+4	2.3e+4
	330	480	160	3.3e+4	4.3e+4	3.3e+4
	Petroleum Hydrocarbons (based on sandy loam soil with SOM 1%, 2.5% or 6%)					
TPH aliphatic EC>5-6	42	42	730	3200	5.7e+5	9.5e+4
	78	78	1700	5900	5.9e+5	1.3e+5
	160	160	3900	1.2e+4	6.0e+5	1.8e+5
TPH aliphatic EC>6-8	100	100	2300	7800	6.0e+5	1.5e+5
	230	230	5600	1.7e+4	6.1e+5	2.2e+5
	530	530	1.3e+4	4.0e+4	6.2e+5	3.2e+5
TPH aliphatic EC>8-10	27	27	320	2000	1.3e+4	1.4e+4
	65	65	770	4800 ^{vap (190)}		1.8e+4 ^{vap (190)}
	150	150	1700	1.1e+4 ^{vap (451)}		2.1e+4 ^{vap (451)}
TPH aliphatic EC>10-12	130 ^{vap (48)}	130 ^{vap (48)}	2200	9700	1.3e+4	2.1e+4
	330 ^{vap (118)}	330 ^{vap (118)}	4400	2.3e+4 ^{vap (118)}		2.3e+4 ^{vap (118)}
	760 ^{vap (283)}	770 ^{vap (283)}	7300	4.7e+4 ^{vap (283)}		2.4e+4 ^{vap (283)}
TPH aliphatic EC>12-16	1100	1100	1.1e+4	5.9e+4	1.3e+4	2.5e+4
	2400	2400	1.3e+4	8.2e+4		2.5e+4
	4300	4400	1.3e+4	9.0e+4 ^s		2.6e+4
TPH aliphatic EC>16-35	6.5e+4	6.5e+4	2.6e+5	1.6e+6	2.5e+5	4.5e+5
	9.2e+4	9.2e+4	2.7e+5	1.7e+6		4.8e+5
	1.1e+5	1.1e+5	2.7e+5	1.8e+6		4.9e+5
TPH aliphatic EC>35-44	6.5e+4	6.5e+4	2.6e+5	1.6e+6	2.5e+5	4.5e+5
	9.2e+4	9.2e+4	2.7e+5	1.7e+6		4.8e+5
	1.1e+5	1.1e+5	2.7e+5	1.8e+6		4.9e+5
TPH aromatic EC>5-7	70	370	13	2.6e+4	5.6e+4	7.6e+4
	140	690	27	4.6e+4		8.4e+4
	300	1400	57	8.6e+4		9.2e+4 ^s
TPH aromatic EC>7-8	130	860	22	5.6e+4 ^{vap (869)}	5.6e+4	8.7e+4 ^{vap (869)}
	290	1800	51	1.1e+5		9.5e+4
	660	3900	120	1.8e+5 ^{vap (4360)}		1.0e+5 ^{vap (4360)}
TPH aromatic EC>8-10	34	47	8.6	3500 ^{vap (613)}	5000	7200 ^{vap (613)}
	83	110	21	8100 ^{vap (1500)}		8500 ^{vap (1500)}
	190	270	51	1.7e+4 ^{vap (3580)}		9300 ^{vap (3580)}
TPH aromatic EC>10-12	74	250	13	1.6e+4	5000	9200
	180	590	31	2.8e+4		9700
	380	1200	74	3.4e+4		1.0e+4
TPH aromatic EC>12-16	140	1800	23	3.6e+4	5100	1.0e+4
	330	2300	57	3.7e+4		
	660	2500	130	3.8e+4		
TPH aromatic EC>16-21	260	1900	46	2.8e+4	3800	7600
	540		110			7700
	930		260			7800
TPH aromatic EC>21-35	1100	1900	370	2.8e+4	3800	7800
	1500		820			7800
	1700		1600			7900
TPH aromatic EC>35-44	1100	1900	370	2.8e+4	3800	7800
	1500		820			7800
	1700		1600			7900
Phenols (based on sandy loam soil with SOM 1%, 2.5% or 6%)						
Phenol	120	440	23	440	440	440
	200	690	42	690	690	690
	380	1200	83	1300	1300	1300
Chlorophenols (except pentachlorophenol)	0.87	94	0.13	3500	620	1100
	2.0	150	0.30	4000		
	4.5	210	0.70	4300		
Pentachlorophenol	0.22	27 ^{vap (16.4)}	0.03	400	60	110
	0.52	29	0.08			120
	1.2	31	0.19			120

Screening Levels – Human Health (soil)

LQM/CIEH S4UL (except allotments)	Residential		Allotment	Commercial	Public Open Space (residential)	Public Open Space (park)
	With homegrown produce	Without homegrown produce				
	Volatile Organic Compounds (based on sandy loam soil with SOM 1%, 2.5% or 6%)					
1,2-Dichloroethane	0.0071 0.011 0.019	0.0092 0.013 0.023	0.0046 0.0083 0.016	0.67 0.97 1.7	29	21 24 28
1,1,1-Trichloroethane	8.8 18 39	9.0 18 40	48 110 240	660 1300 3000	1.4e+5	5.7e+4 ^{vap (1425)} 7.6e+4 ^{vap (2915)} 1.0e+5 ^{vap (5392)}
1,1,2,2-Tetrachloroethane	1.6 3.4 7.5	3.9 8.0 17	0.41 0.89 2.0	270 550 1100	1400	1800 2100 2300
1,1,1,2-Tetrachloroethane	1.2 2.8 6.4	1.5 3.5 8.2	0.79 1.9 4.4	110 250 560	1400	1500 1800 2100
Tetrachloroethene (PCE)	0.18 0.39 0.90	0.18 0.40 0.92	0.65 1.5 3.6	19 42 95	1400	810 1100 1500
Tetrachloromethane	0.026 0.056 0.13	0.026 0.056 0.13	0.45 1.0 2.4	2.9 6.3 14	890 920 950	190 270 400
Trichloroethene (TCE)	0.016 0.034 0.075	0.017 0.036 0.080	0.041 0.091 0.21	1.2 2.6 5.7	120	70 91 120
Trichloromethane (chloroform)	0.91 1.7 3.4	1.2 2.1 4.2	0.42 0.83 1.7	99 170 350	2500	2600 2800 3100
Chloroethene (vinyl chloride)	0.00064 0.00087 0.0014	0.00077 0.0010 0.0015	0.00055 0.0010 0.0018	0.059 0.077 0.12	3.5	4.8 5.0 5.4
Chlorobenzene	0.46 1.0 2.4	0.46 1.0 2.4	5.9 14 32	56 130 290	1.1e+4 1.3e+4 1.4e+4	1300 2000 2900
1,2-Dichlorobenzene	23 55 130	24 57 130	94 230 540	2000 4800 1.1e+4	9.0e+4 9.5e+4 9.8e+4	2.4e+4 3.6e+4 5.1e+4
1,3-Dichlorobenzene	0.4 1.0 2.3	0.44 1.1 2.5	0.25 0.6 1.5	30 73 170	300	390 440 470
1,4-Dichlorobenzene	61 150 350	61 150 350	15 37 88	4400 ^{vap (224)} 1.0e+4 ^{vap (540)} 2.5e+4 ^{vap (1280)}	1.7e+4	3.6e+4 ^{vap (224)} 3.6e+4 ^{vap (540)} 3.6e+4 ^{vap (1280)}
1,2,3-Trichlorobenzene	1.5 3.6 8.6	1.5 3.7 8.8	4.7 12 28	102 250 590	1800	770 ^{vap (134)} 1100 ^{vap (330)} 1600 ^{vap (759)}
1,2,4-Trichlorobenzene	2.6 6.4 15	2.6 6.4 15	55 140 320	220 530 1300	1.5e+4 1.7e+4 1.9e+4	1700 ^{vap (318)} 2600 ^{vap (786)} 4000 ^{vap (1800)}
1,3,5-Trichlorobenzene	0.33 0.81 1.9	0.33 0.81 1.9	4.7 12 28	23 55 130	1700 1700 1800	380 ^{vap (37)} 580 ^{vap (231)} 860 ^{vap (217)}
1,2,3,4-Tetrachlorobenzene	15 36 78	24 56 120	4.4 11 26	1700 ^{vap (122)} 3080 ^{vap (304)} 4400 ^{vap (728)}	830	1500 ^{vap (122)} 1600 1600
1,2,3,5-Tetrachlorobenzene	0.66 1.6 3.7	0.75 1.9 4.3	0.38 0.90 2.2	49 ^{vap (39)} 120 ^{vap (98)} 240 ^{vap (235)}	78 79 79	110 ^{vap (30)} 120 130
1,2,4,5-Tetrachlorobenzene	0.33 0.77 1.6	0.73 1.7 3.5	0.06 0.16 0.37	42 72 96	13	25 26 26
Pentachlorobenzene	5.8 12 22	19 30 38	1.2 3.1 7.0	640 770 830	100	190
Hexachlorobenzene	1.8 ^{vap (0.2)} 3.3 ^{vap (0.5)} 4.9	4.1 ^{vap (0.2)} 5.7 ^{vap (0.5)} 6.7	0.47 1.1 2.5	110 ^{vap (0.2)} 120 ^{vap (0.5)} 120	16	30
Carbon disulphide	0.14 0.29 0.62	0.14 0.29 0.62	4.8 10 23	11 22 47	1.1e+4 1.1e+4 1.2e+4	1300 1900 2700
Hexachlorobutadiene	0.29 0.7 1.6	0.32 0.78 1.8	0.25 0.61 1.4	31 66 120	25	48 50 51

Screening Levels – Human Health (soil)

	Pesticides (based on sandy loam soil with SOM 1%, 2.5% or 6%)					
Aldrin	5.7 6.6 7.1	7.3 7.4 7.5	3.2 6.1 9.6	170	18	30 31 31
Dieldrin	0.97 2.0 3.5	7.0 7.3 7.4	0.17 0.41 0.96	170	18	30 30 31
Atrazine	3.3 7.6 17.4	610 620 620	0.50 1.2 2.7	9300 9400 9400	1200	2300 2400 2400
Dichlorvos	0.032 0.066 0.14	6.4 6.5 6.6	0.0049 0.010 0.022	140	16	26 26 27
Endosulfan	7.4 18 41	160 280 410	1.2 2.9 6.8	5600 7400 8400	1200	2400 2400 2500
HCH (including Lindane)	0.23 0.55 1.2	6.9 9.2 11	0.035 0.087 0.21	170 180 180	24	47 48 48
	Explosives (based on sandy loam soil with SOM 1%, 2.5% or 6%)					
2,4,6-Trinitrotoluene	1.6 3.7 8.1	65 66 66	0.24 0.58 1.40	1000	130	260 270 270
RDX	120 250 540	1.3e+4	17 38 85	2.1e+5	2.6e+4 2.6e+4 2.7e+4	4.9e+4 5.1e+4 5.3e+4
HMX	5.7 13 26	6700	0.86 1.9 3.9	1.1e+5	1.3e+4	2.3e+4 ^{exp (0.39)} 2.3e+4 ^{exp (0.39)} 2.4e+4 ^{exp (0.48)}

Assessment Criteria – Controlled Waters

Substance	EQS			DWS	Substance	EQS	DWS
List 1							
	Fresh	Estuary	Marine				
Mercury	1	0.5	0.3	1	Endrin	0.005	0.1
Cadmium	5	5	2.5	5	Total 'Drins	0.03	-
Hexachlorocyclohexane	0.1	0.02	0.02	-	Hexachlorobenzene	0.03	-
Carbon tetrachloride	12			-	Hexachlorobutadiene	0.1	-
Total DDT	0.025			0.5	Chloroform	12	-
pp DDT	0.01			-	1,2-dichloroethane	10	-
Pentachlorophenol	2			0.1	Trichlorethylene	10	-
Dieldrin	0.01			0.03	Perchloroethylene	10	-
Isodrin	0.005			0.1	Trichlorobenzene	0.4	-
Aldrin	0.01			0.03			
List 2							
1,1,1-Trichloroethane	100			-	Fenitrothion	0.01	0.1
1,1,2-Trichloroethane	400			-	Flucufuron	1	0.1
2,4-D (ester)	1			-	Iron	1000	200
2,4-D (non-ester)	40			-	Linuron	2	0.1
2,4-Dichlorophenol	20			-	Malathion	0.01	0.1
2-Chlorophenol	50			-	Mecoprop	20	0.1
4-Chloro-3-methyl-phenol	40			-	Mevinphos	0.02	0.1
Arsenic	50			10	Naphthalene	10	0.1
Atrazine &Simazine	2			0.1	Omethoate	0.01	0.1
Azinphos-methyl	0.01			0.1	PCSDs	0.05	0.1
Bentazone	500			0.1	Permethrin	0.01	0.1
Benzene	30			1	pH	6 - 9	6.5 - 10
Biphenyl	25			-	Sulcofuron	25	0.1
Boron	2000			1000	Toluene	50	0.1
Chloronitrotoluenes	10			-	Triazaphos	0.005	0.1
Cyfluthrin	0.001			0.1	Tributyltin	0.02	0.1
Demeton	0.5			0.1	Trifluralin	0.1	0.1
Dichlorvos	0.001			0.1	Triphenyltin	0.02	0.1
Dimethoate	1			0.1	Xylene (m and p, o)	30	-
Endosulphan	0.003			0.1	TPH	30	10

List 2 (hardness related)							
Hardness (mg/l CaCO ₃)	0-50	>50	>100	>150	>200	>250	
		-100	-150	-200	-250		
Suitable for all fish							
Copper	1	6	10	10	10	28	2000
Nickel	50	100	150	150	200	200	20
Vanadium	20	20	20	20	60	60	-
Suitable for salmonid (game) fish							
Chromium	5	10	20	20	50	50	50
Lead	4	10	10	20	20	20	25
Zinc	8	50	75	75	75	125	-
Suitable for Cyprinid (coarse) fish							
Chromium	150	175	200	200	250	250	50
Lead	20	125	125	250	250	250	25
Zinc	75	175	250	250	250	500	-

Other Compounds			
Acrylamide	0.1	Tetrachloroethene and Trichloroethene	10
Antimony	5	Trihalomethanes(ii)	100
Benzo(a)pyrene	0.01	Vinyl chloride	0.5
Bromate	10	Aluminium	200
Cyanide	50	Iron	200
1, 2-dichloroethane	3	Manganese	50
Epichlorohydrin	0.1	Sodium	200
Fluoride	1.5	Tetrachloromethane	3
Heptachlor	0.03	Ammonium	0.5 mg/l
Heptachlor epoxide (iii)	0.03	Nitrate	50 mg/l
Other pesticides	0.1	Nitrite	0.5 mg/l
Pesticides (total)	0.5	Chloride	250 mg/l
PAHs(i)	0.1	Sulphate	250 mg/l
Selenium	10	TPH (1989 Regs)	10

Notes:

- Specified compounds are benzo[b]fluoranthene, benzo[k]fluoranthene, benzo[g,h,i]-perylene, indeno[1,2,3-c,d]pyrene.
- Specified compounds are chloroform, bromoform, dibromochloromethane, bromodichloro-methane.

Unless stated otherwise all units µg l⁻¹

Assessment Criteria –Water Supply Pipes

Substance [1]	WRAS (withdrawn)	Anglian Water	UK WIR	
			PE	PVC
Organic compounds				
TPH	50	50 – 1000 [2]	-	
TPH >C5-C10	-	-	2	1.4
TPH >C11-C20	-	-	10	NL
TPH >C21-C40	-	-	500	NL
Extended VOC suite	-	-	0.5	0.125
Extended SVOC suite	-	-	2	1.4
BTEX + MTBE	-	-	0.1	0.03

Chlorinated hydrocarbons				
Dichloromethane	-	1	-	-
1,2-dichloroethane	-	0.2	-	-
1,1,1-trichloroethane	-	8	-	-
1,2-dichloropropane	-	0.1	-	-
Tetrachloromethane	-	0.15	-	-
Trichloroethene	-	1.5	-	-
Tetrachloroethene	-	0.5	-	-
Vinyl chloride	-	0.1	-	-
Methyl bromide	-	10	-	-
Total	-	7	-	-

Aromatic hydrocarbons				
Benzene	-	0.5	0.1	0.03
Ethylbenzene	-	0.5	0.1	0.03
Trimethyl benzene	-	0.1	-	-
Propylbenzene	-	2	-	-
Toluene	-	0.25	0.1	0.03
Xylenes	-	0.5	0.1	0.03
Phenol	5	1	2	0.4
Cresol	-	1	2	0.04
Total	-	7	-	-

Chlorinated phenols				
Chlorophenols	-	0.5	-	-
Dichlorophenols	-	0.5	-	-
Trichlorophenols	-	0.5	-	-
2,4,6-trichlorophenol	-	0.5	-	-
Pentachlorophenol	-	0.5	-	-
Total	-	1	2	0.04

Chlorinated aromatic hydrocarbons				
Chlorobenzene	-	0.5	-	-
Dichlorobenzene	-	0.5	-	-
Trichlorobenzene	-	0.5	-	-
Pentachlorobenzene	-	0.5	-	-
Total	-	1	-	-

Polyaromatic hydrocarbons				
Naphthalene	-	5	-	-
Anthracene	-	10	-	-
Phenanthrene	-	10	-	-
Fluoranthene	-	10	-	-
Pyrene	-	10	-	-
Benzo[a]pyrene	-	1	-	-
Total	50	20	2	1.4

Other organic compounds				
Tetrahydrofuran	-	4	-	-
Styrene	-	5	-	-
Pyridine	-	2	-	-
Ethers	-	-	0.5	1
Nitrobenzene	-	-	0.5	0.4
Ketones	-	-	0.5	0.02
Aldehydes	-	-	0.5	0.02
Amines	-	-	Detected	NL

Notes:

1. All units mg/kg in soil.
2. The threshold for TPH is 1000mg/kg provided no other organic compounds are present. If the TPH level exceeds 50mg/kg then the sum of TPH plus other organic compounds must not be greater than the upper threshold. If the other compounds are not tested for then the threshold for TPH must be set at the lower threshold.
3. All UKWIR TV's (except BTEX and MTBE) are based on taste and odour detection threshold.
4. PE – polyethylene; PVC – polyvinyl chloride

Appendix G

Defining Risk

Identification of Unacceptable Risk

The method for risk evaluation is qualitative and is developed from the model provided in CIRIA C552 *Contaminated Land Risk Assessment – a guide to good practice* (DETR 2001). It involves classifying risk in terms of (a) magnitude of the potential consequence (severity) of occurrence and (b) the probability (likelihood) of occurrence. The risk rating derived is used to determine what action, if any, is needed to further investigate that risk and/or remediate to reduce risk to an acceptable level.

Task 1: Classification of Consequence

Classification	Definition	Examples
Severe	- Short-term (acute) risk to human health likely to result in "significant harm" (as defined in EPA90 Part 2a). - Short-term (acute) risk of pollution of sensitive water resource. - Short-term (acute) risk to an ecosystem, or organism forming part of an ecosystem.	Unusually high concentration of toxic substance on the surface of a garden or recreation area. Major spillage of contamination from the site into controlled waters. EA Category 1 pollution incident. Closure of an abstraction point. Explosion, causing building collapse (and death if occupied).
Medium	- Chronic damage to human health likely to result in "significant harm". - Pollution of sensitive water resource. - Significant change in a particular ecosystem, or organism forming part of such ecosystem.	Concentration of contaminant from site exceeds generic or site-specific assessment criteria for human health or water supply pipes. Presence of asbestos. Leaching of contaminants from a site to a principal or secondary (A) aquifer. Concentration exceeds DWS or EQS in Inner Source Protection Zone (SPZ1). EA Category 2 pollution incident. Death of a species or loss of habitat within an area of national importance.
Mild	- Exposure is unlikely to result in "significant harm" to human health. - Pollution of non-sensitive water resource. - Damage to sensitive buildings, structures and services or the environment.	Concentration of contaminant from site below generic or site-specific assessment criteria. Pollution of secondary (B or undifferentiated) aquifer. EA Category 3 pollution incident. Damage to a building rendering it unsafe to occupy. Death of a species or loss of habitat within an area of local importance. Loss of plants in garden or landscape areas (BS3882 limits exceeded).
Minor	- Harm (but not significant harm) resulting in a financial loss or expenditure to resolve. - Non-permanent human health effects. - Easily repairable damage to buildings, structures and services.	Pollution of unproductive strata.

Task 2: Classification of Probability

Classification	Definition
High Likelihood	There is a pollution linkage and an event appears very likely in the short term and almost inevitable over the long term or there is actual evidence at the receptor of harm or pollution.
Likely	There is a pollution linkage and all the elements are present and in the right place, which means that it is probable that an event will occur. Circumstances are such that an event is not inevitable, but possible in the short term and likely over the long term.
Low Likelihood	There is a pollution linkage and circumstances are possible under which an event could occur. However, it is by no means certain that even over a longer period such event would take place, and is less likely in the shorter term.
Unlikely	There is a pollution linkage but circumstances are such that it is improbable that an event would occur in the very long term.

Task 3: Risk Estimation

		Consequence			
		Severe	Medium	Mild	Minor
Probability	High Likelihood	Very high risk	High risk	Moderate risk	Low risk
	Likely	High risk	Moderate risk	Low risk	Low risk
	Low Likelihood	Moderate risk	Low risk	Low risk	Very low risk
	Unlikely	Low risk	Low risk	Very low risk	Very low risk
	No linkage	No risk			

Task 4: Description of the Estimated Risks and Likely Action Required

Risk	Action
Very high risk	There is a high probability that severe harm could arise or there is evidence that severe harm is currently happening. This risk, if realised, is likely to result in substantial liability. Urgent investigation and remediation are required for the site in its existing state and for development.
High risk	Harm is likely to arise. Realisation of the risk is likely to present a significant liability. Urgent investigation is required and remedial works may be necessary in the short term and are likely over the long term. Remediation will be required for development.
Moderate risk	A potential linkage is identifiable. However, it is either relatively unlikely that harm would be severe or, if any harm were to occur, it is more likely that the harm would be relatively mild. Investigation is required to quantify the risk and determine potential liability. Remediation will be required for development.
Low risk	It is possible that harm could arise but it is likely that this harm, if realised, would at worst normally be mild. Investigation is not normally required but could be useful to confirm a preliminary assessment. Remedial works are unlikely to be required or will be limited.
Very low risk	There is a low possibility that harm could arise. In the event of such harm being realised it is not likely to be severe. Site is not capable of being determined under Part 2a. No further action recommended.