

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
				Average Width in Watercourse Section (m): Not Provided
22	499 N	-	Inland river not influenced by normal tidal action.	Catchment Area: Dee Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8
Not shown	499 N	-	Inland river not influenced by normal tidal action.	Catchment Area: Dee Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	499 N	-	Inland river not influenced by normal tidal action.	Catchment Area: Dee Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8

6.11 Surface Water Features


Surface water features within 250m of the study site

Identified

The following surface water records are not represented on mapping:

Distance (m)	Direction
65	S


7a. Environment Agency/Natural Resources Wales Flood Map for Planning (from rivers and the sea)

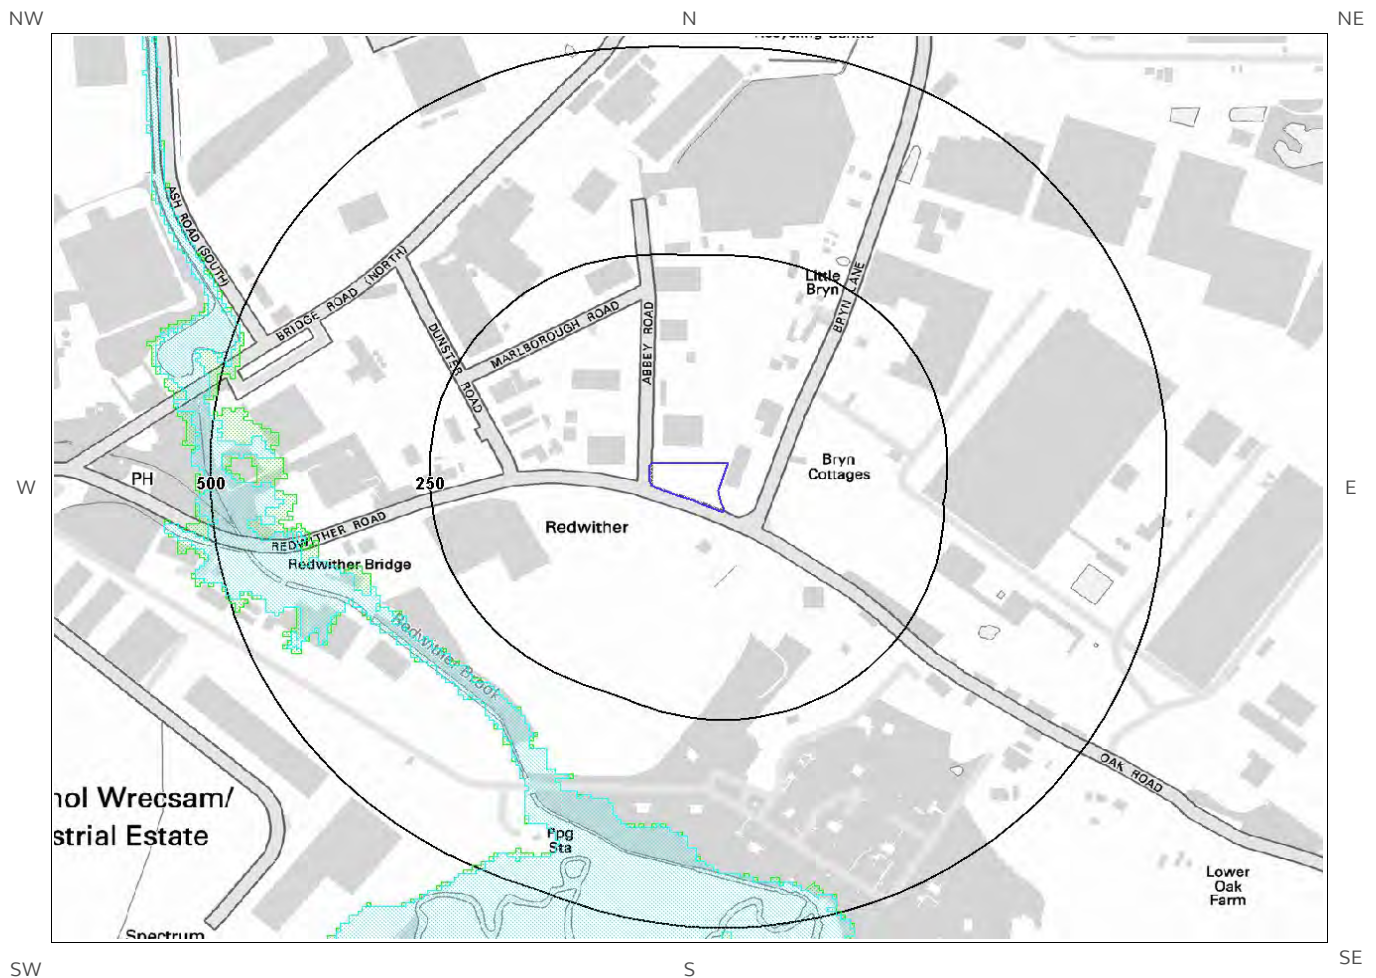


© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



7b. Environment Agency/Natural Resources Wales Risk of Flooding from Rivers and the Sea (RoFRaS) Map

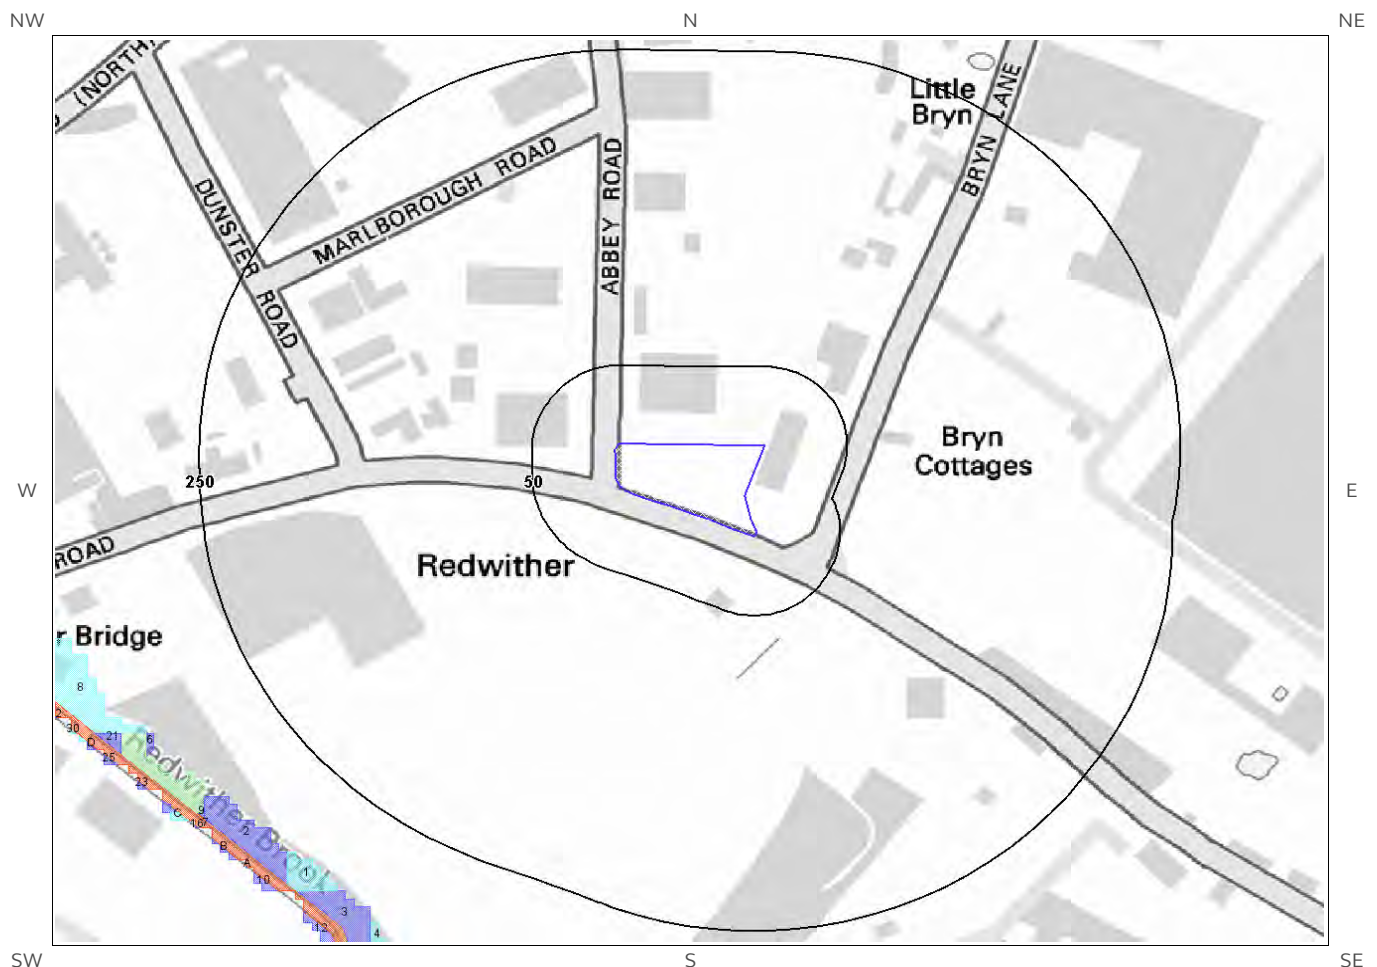

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

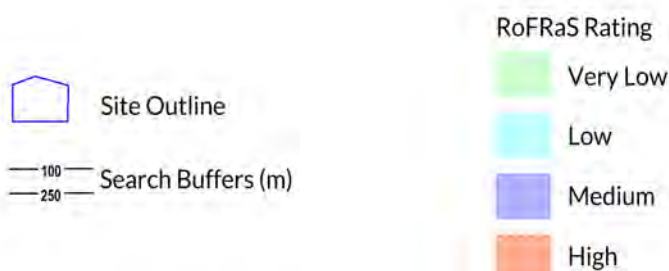

7 Flooding

7.1 River and Coastal Zone 2 Flooding

Environment Agency/Natural Resources Wales Zone 2 floodplain within 250m None identified

Environment Agency/Natural Resources Wales Zone 2 floodplains estimate the annual probability of flooding as between 1 in 1000 (0.1%) and 1 in 100 (1%) from rivers and between 1 in 1000 (0.1%) and 1 in 200 (0.5%) from the sea. Any relevant data is represented on Map 7a – Flood Map for Planning:

Database searched and no data found.

7.2 River and Coastal Zone 3 Flooding

Environment Agency/Natural Resources Wales Zone 3 floodplain within 250m None identified

Zone 3 shows the extent of a river flood with a 1 in 100 (1%) or greater chance of occurring in any year or a sea flood with a 1 in 200 (0.5%) or greater chance of occurring in any year. Any relevant data is represented on Map 7a – Flood Map for Planning.

Database searched and no data found.

7.3 Risk of Flooding from Rivers and the Sea (RoFRaS) Flood Rating

Highest risk of flooding onsite Very Low

The Environment Agency/Natural Resources Wales RoFRaS database provides an indication of river and coastal flood risk at a national level on a 50m grid with the flood rating at the centre of the grid calculated and given above. The data considers the probability that the flood defences will overtop or breach by considering their location, type, condition and standard of protection.

RoFRaS data for the study site indicates the property is in an area with a Very Low (less than 1 in 1000) chance of flooding in any given year.

7.4 Flood Defences

Flood Defences within 250m of the study site None identified
Database searched and no data found.

7.5 Areas benefiting from Flood Defences

Areas benefiting from Flood Defences within 250m of the study site None identified

7.6 Areas benefiting from Flood Storage

Areas used for Flood Storage within 250m of the study site

None identified

7.7 Groundwater Flooding Susceptibility Areas

7.7.1 British Geological Survey groundwater flooding susceptibility areas within 50m of the boundary of the study site

Identified

Clearwater Flooding or Superficial Deposits Flooding

Superficial Deposits Flooding

Notes: Groundwater flooding may either be associated with shallow unconsolidated sedimentary aquifers which overlie unproductive aquifers (Superficial Deposits Flooding), or with unconfined aquifers (Clearwater Flooding).

7.7.2 Highest susceptibility to groundwater flooding in the search area based on the underlying geological conditions

Potential below Surface

Where potential for groundwater flooding of property situated below ground level is indicated, this means that given the geological conditions there may be a groundwater flooding hazard to basements and other below surface infrastructure. Unless other relevant information, e.g. records of previous flooding, suggests groundwater flooding has occurred before in this area you need take no further action in relation to groundwater flooding hazard. If there are records of previous incidences of groundwater flooding, then is recommended that other information e.g. rainfall history, property type, and land drainage information in addition to previous records of flooding be investigated in order to establish relative, but not absolute, risk of groundwater flooding.

7.8 Groundwater Flooding Confidence Areas


British Geological Survey confidence rating in this result

High

Notes: Groundwater flooding is defined as the emergence of groundwater at the ground surface or the rising of groundwater into man-made ground under conditions where the normal range of groundwater levels is exceeded.

The confidence rating is on a threefold scale - Low, Moderate and High. This provides a relative indication of the BGS confidence in the accuracy of the susceptibility result for groundwater flooding. This is based on the amount and precision of the information used in the assessment. In areas with a relatively lower level of confidence the susceptibility result should be treated with more caution. In other areas with higher levels of confidence the susceptibility result can be used with more confidence.

8. Designated Environmentally Sensitive Sites Map

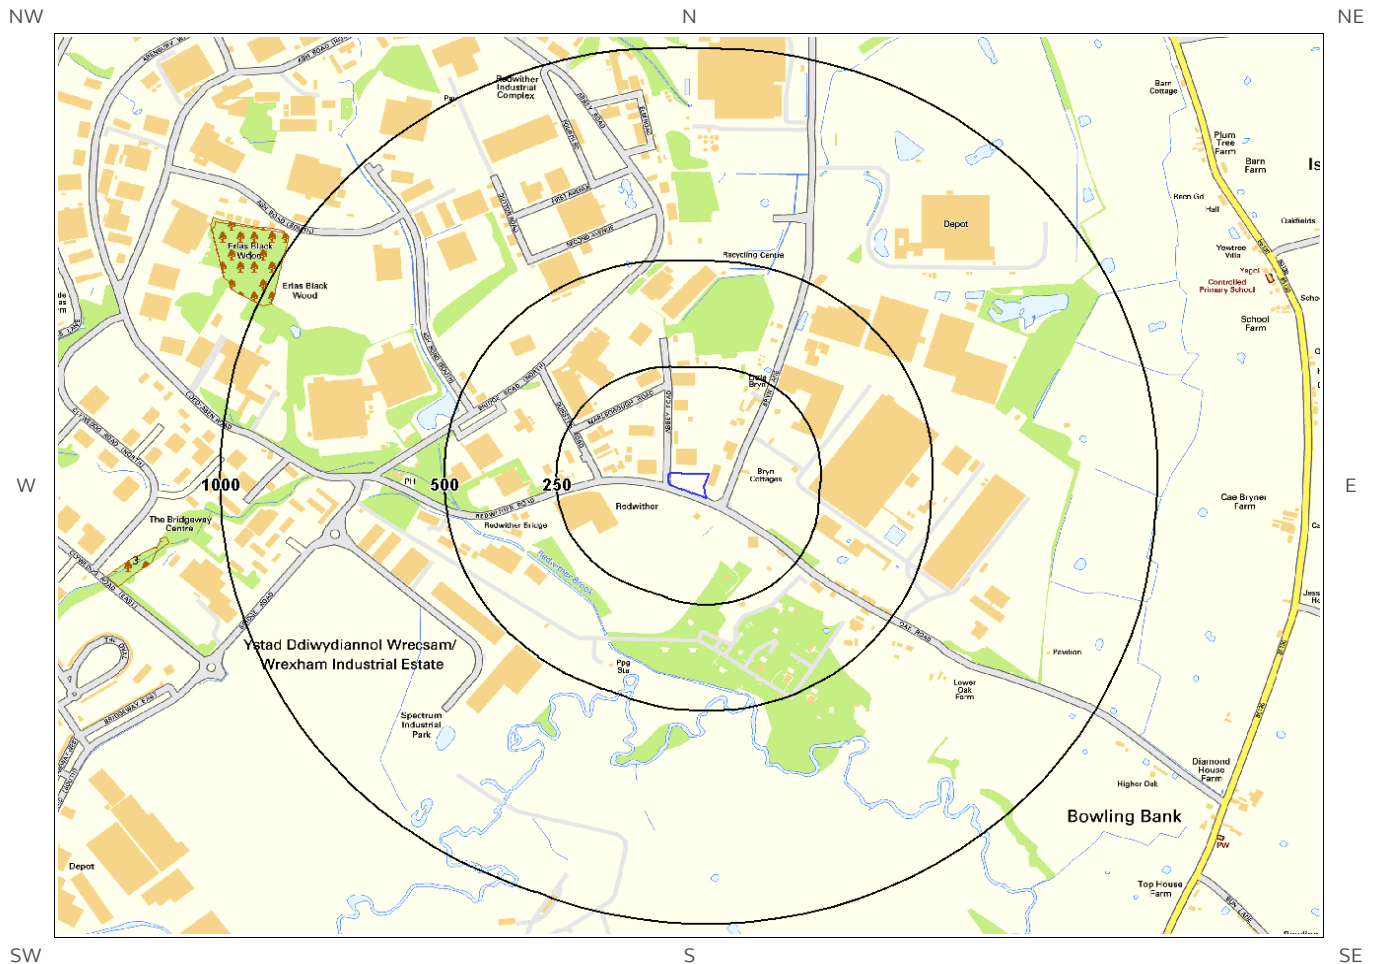

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



8. Designated Environmentally Sensitive Sites

Designated Environmentally Sensitive Sites within 2000m of the study site	Identified
---	------------

8.1 Records of Sites of Special Scientific Interest (SSSI) within 2000m of the study site:

0

Database searched and no data found.

8.2 Records of National Nature Reserves (NNR) within 2000m of the study site:

0

Database searched and no data found.

8.3 Records of Special Areas of Conservation (SAC) within 2000m of the study site:

0

Database searched and no data found.

8.4 Records of Special Protection Areas (SPA) within 2000m of the study site:

0

Database searched and no data found.

8.5 Records of Ramsar sites within 2000m of the study site:

0

Database searched and no data found.

8.6 Records of Ancient Woodland within 2000m of the study site:

10

The following records of Designated Ancient Woodland provided by Natural England/Natural Resources Wales are represented as polygons on the Designated Environmentally Sensitive Sites Map:

ID	Distance (m)	Direction	Ancient Woodland Name	Data Source
1	971	NW	UNKNOWN	Restored Ancient Woodland Site
2	1021	NW	UNKNOWN	Restored Ancient Woodland Site
3	1124	W	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1291	SE	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1297	S	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1478	S	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1667	S	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1694	W	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1831	S	UNKNOWN	Ancient and Semi-Natural Woodland
Not shown	1974	NW	UNKNOWN	Ancient and Semi-Natural Woodland

8.7 Records of Local Nature Reserves (LNR) within 2000m of the study site:

0

Database searched and no data found.

8.8 Records of World Heritage Sites within 2000m of the study site:

0

Database searched and no data found.

8.9 Records of Environmentally Sensitive Areas within 2000m of the study site:

0

Database searched and no data found.

8.10 Records of Areas of Outstanding Natural Beauty (AONB) within 2000m of the study site:

0

Database searched and no data found.

8.11 Records of National Parks (NP) within 2000m of the study site:

0

Database searched and no data found.

8.12 Records of Nitrate Sensitive Areas within 2000m of the study site:

0

Database searched and no data found.

8.13 Records of Nitrate Vulnerable Zones within 2000m of the study site:

0

Database searched and no data found.

8.14 Records of Green Belt land within 2000m of the study site:

0

Database searched and no data found.

9. Natural Hazards Findings

9.1 Detailed BGS GeoSure Data

BGS GeoSure Data has been searched to 50m. The data is included in tabular format. If you require further information on geology and ground stability, please obtain a **Groundsure Geo Insight**, available from our **website**. The following information has been found:

9.1.1 Shrink Swell

Maximum Shrink-Swell** hazard rating identified on the study site Very Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Ground conditions predominantly low plasticity. No special actions required to avoid problems due to shrink-swell clays. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with shrink-swell clays.

9.1.2 Landslides

Maximum Landslide* hazard rating identified on the study site Very Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

9.1.3 Soluble Rocks

Maximum Soluble Rocks* hazard rating identified on the study site Negligible

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

* This indicates an automatically generated 50m buffer and site.

9.1.4 Compressible Ground

Maximum Compressible Ground* hazard rating identified on the study site

Negligible

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
No indicators for compressible deposits identified. No special actions required to avoid problems due to compressible deposits. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with compressible deposits.

9.1.5 Collapsible Rocks

Maximum Collapsible Rocks* hazard rating identified on the study site

Very Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Deposits with potential to collapse when loaded and saturated are unlikely to be present. No special ground investigation required or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

9.1.6 Running Sand

Maximum Running Sand** hazard rating identified on the study site

Very Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Very low potential for running sand problems if water table rises or if sandy strata are exposed to water. No special actions required, to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.

* This indicates an automatically generated 50m buffer and site.

9.2 Radon

9.2.1 Radon Affected Areas

Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The site is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

9.2.2 Radon Protection

Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

10. Mining

10.1 Coal Mining

Coal mining areas within 75m of the study site

None identified

Database searched and no data found.

10.2 Non-Coal Mining

Non-Coal Mining areas within 50m of the study site boundary

None identified

Database searched and no data found.

10.3 Brine Affected Areas

Brine affected areas within 75m of the study site

None identified

Guidance: No Guidance Required.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com

British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email:

Web: www.bgs.ac.uk

BGS Geological Hazards Reports and general geological enquiries:
enquiries@bgs.ac.uk

Natural Resources Wales

Ty Cambria
29 Newport Road
Cardiff
CF24 0TP
Tel: 0300 065 3000
Email: enquiries@naturalresourceswales.gov.uk

Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
www.gov.uk/phe
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000

The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk

Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505

Local Authority

Authority: Wrexham - Wrexham County Borough Council
Phone: 01978 292 000
Web: <http://www.wrexham.gov.uk/>
Address: 16 Lord Street, Wrexham, Wrexham, LL11 1LG



Gemapping PLC
Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444



Acknowledgements: Site of Special Scientific Interest, National Nature Reserve, Ramsar Site, Special Protection Area, Special Area of Conservation data is provided by, and used with the permission of, Natural England/Natural Resources Wales who retain the Copyright and Intellectual Property Rights for the data.

PointX © Database Right/Copyright, Thomson Directories Limited © Copyright Link Interchange Network Limited © Database Right/Copyright and Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028].

This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:

<https://www.groundsure.com/terms-and-conditions-feb11-2019>

APPENDIX D

GROUNDSURE GEOINSIGHT

GroundSure GeoInsight

GS-6237862

Address: WREXHAM INDUSTRIAL ESTATE, WREXHAM, LL13 9RG
Date: 12 Aug 2019
Reference: GS-6237862
Client: SOCOTEC UK Limited



Aerial Photograph Capture date: 07-May-2017
Grid Reference: 338696,349515
Site Size: 0.3474ha

Contents Page

Contents Page.....	3
Overview of Findings.....	5
1:10,000 Scale Availability.....	8
Availability of 1:10,000 Scale Geology Mapping.....	9
1 Geology (1:10,000 scale).....	10
1.1 Artificial Ground map (1:10,000 scale).....	10
1. Geology 1:10,000 scale.....	11
1.1 Artificial Ground.....	11
1.2 Superficial Deposits and Landslips map (1:10,000 scale).....	12
1.2 Superficial Deposits and Landslips.....	13
1.2.1 Superficial Deposits/ Drift Geology.....	13
1.2.2 Landslip.....	13
1.3 Bedrock and linear features map (1:10,000 scale).....	14
1.3 Bedrock and linear features.....	15
1.3.1 Bedrock/ Solid Geology.....	15
1.3.2 Linear features.....	15
2 Geology 1:50,000 Scale.....	16
2.1 Artificial Ground map.....	16
2. Geology 1:50,000 scale.....	17
2.1 Artificial Ground.....	17
2.1.1 Artificial/ Made Ground	17
2.1.2 Permeability of Artificial Ground.....	17
2.2 Superficial Deposits and Landslips map (1:50,000 scale).....	18
2.2 Superficial Deposits and Landslips.....	19
2.2.1 Superficial Deposits/ Drift Geology.....	19
2.2.2 Permeability of Superficial Ground	19
2.2.3 Landslip.....	19
2.2.4 Landslip Permeability.....	20
2.3 Bedrock and linear features map (1:50,000 scale).....	21
2.3 Bedrock, Solid Geology & linear features.....	22
2.3.1 Bedrock/Solid Geology.....	22
2.3.2 Permeability of Bedrock Ground.....	22
2.3.3 Linear features.....	22
3 Radon Data.....	23
3.1 Radon Affected Areas.....	23
3.2 Radon Protection.....	23
4 Ground Workings map.....	24
4 Ground Workings.....	25
4.1 Historical Surface Ground Working Features derived from Historical Mapping.....	25
4.2 Historical Underground Working Features derived from Historical Mapping.....	25
4.3 Current Ground Workings.....	26
5 Mining, Extraction & Natural Cavities.....	28
5.1 Historical Mining.....	28
5.2 Coal Mining.....	28
5.3 Johnson Poole and Bloomer.....	28
5.4 Non-Coal Mining.....	28
5.5 Non-Coal Mining Cavities.....	29
5.6 Natural Cavities.....	29
5.7 Brine Extraction.....	29
5.8 Gypsum Extraction.....	29
5.9 Cornwall and Devon Metalliferous Mining.....	29
5.10 Clay Mining.....	30
6 Natural Ground Subsidence.....	31
6.1 Shrink-Swell Clay map.....	31
6.2 Landslides map.....	32
6.3 Ground Dissolution of Soluble Rocks map.....	33
6.4 Compressible Deposits map.....	34
6.5 Collapsible Deposits map.....	35
6.6 Running Sand map.....	36

6 Natural Ground Subsidence.....	37
6.1 Shrink-Swell Clays.....	37
6.2 Landslides.....	37
6.3 Ground Dissolution of Soluble Rocks.....	37
6.4 Compressible Deposits.....	38
6.5 Collapsible Deposits.....	38
6.6 Running Sands.....	38
7 Borehole Records.....	40
8 Estimated Background Soil Chemistry.....	42
9 Railways and Tunnels map.....	43
9 Railways and Tunnels.....	44
9.1 Tunnels	44
9.2 Historical Railway and Tunnel Features	44
9.3 Historical Railways.....	45
9.4 Active Railways.....	45
9.5 Railway Projects.....	45

Overview of Findings

The Groundsure Geo Insight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 and 1:10,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Non-coal mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Geology 1:10,000 Scale

1.1 Artificial Ground	1.1 Is there any Artificial Ground/ Made Ground present beneath the study site at 1:10,000 scale?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site at 1:10,000 scale?*	Yes
	1.2.2 Are there any records of landslide within 500m of the study site boundary at 1:10,000 scale?	No
1.3 Bedrock, Solid Geology and linear features	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale?	No

Section 2: Geology 1:50,000 Scale

2.1 Artificial Ground	2.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	2.1.2 Are there any records relating to permeability of artificial ground within the study site*boundary?	No
2.2 Superficial Geology and Landslips	2.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?*	Yes
	2.2.2 Are there any records of permeability of superficial ground within 500m of the study site?	Yes
	2.2.3 Are there any records of landslide within 500m of the study site boundary?	No
	2.2.4 Are there any records relating to permeability of landslips within the study site* boundary?	No

Section 2: Geology 1:50,000 Scale

2.3 Bedrock, Solid Geology and linear features

2.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.

2.3.2 Are there any records relating to permeability of bedrock ground within the study site boundary?

Yes

2.3.3 Are there any records of linear features within 500m of the study site boundary?

No

Section 3: Radon

3. Radon

3.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?

The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection

No radon protective measures are necessary.

Section 4: Ground Workings


	On-site	0-50m	51-250	251-500	501-1000
4.1 Historical Surface Ground Working Features from Small Scale Mapping	0	0	10	Not Searched	Not Searched
4.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
4.3 Current Ground Workings	0	0	0	0	0

Section 5: Mining, Extraction & Natural Cavities

	On-site	0-50m	51-250	251-500	501-1000
5.1 Historical Mining	0	0	0	0	0
5.2 Coal Mining	0	0	0	1	0
5.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
5.4 Non-Coal Mining*	0	0	0	0	0
5.5 Non-Coal Mining Cavities	0	0	0	0	0
5.5 Natural Cavities	0	0	0	0	0


Section 5: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
5.6 Brine Extraction	0	0	0	0	0
5.7 Gypsum Extraction	0	0	0	0	0
5.8 Cornwall and Devon Metalliferous Mining	0	0	0	0	0
5.9 Clay Mining	0	0	0	0	0
Section 6: Natural Ground Subsidence	On-site				
6.1 Shrink-Swell Clay	Very Low				
6.2 Landslides	Very Low				
6.3 Ground Dissolution of Soluble Rocks	Negligible				
6.4 Compressible Deposits	Negligible				
6.5 Collapsible Deposits	Very Low				
6.5 Running Sand	Very Low				
Section 7: Borehole Records	On-site	0-50m	51-250		
7 BGS Recorded Boreholes	0	1	12		
Section 8: Estimated Background Soil Chemistry	On-site	0-50m	51-250		
8 Records of Background Soil Chemistry	4	0	0		
Section 9: Railways and Tunnels	On-site	0-50m	51-250	250-500	
9.1 Tunnels	0	0	0	Not Searched	
9.2 Historical Railway and Tunnel Features	1	0	3	Not Searched	
9.3 Historical Railways	0	0	0	Not Searched	
9.4 Active Railways	0	0	0	Not Searched	
9.5 Railway Projects	0	0	0	0	

1:10,000 Scale Availability

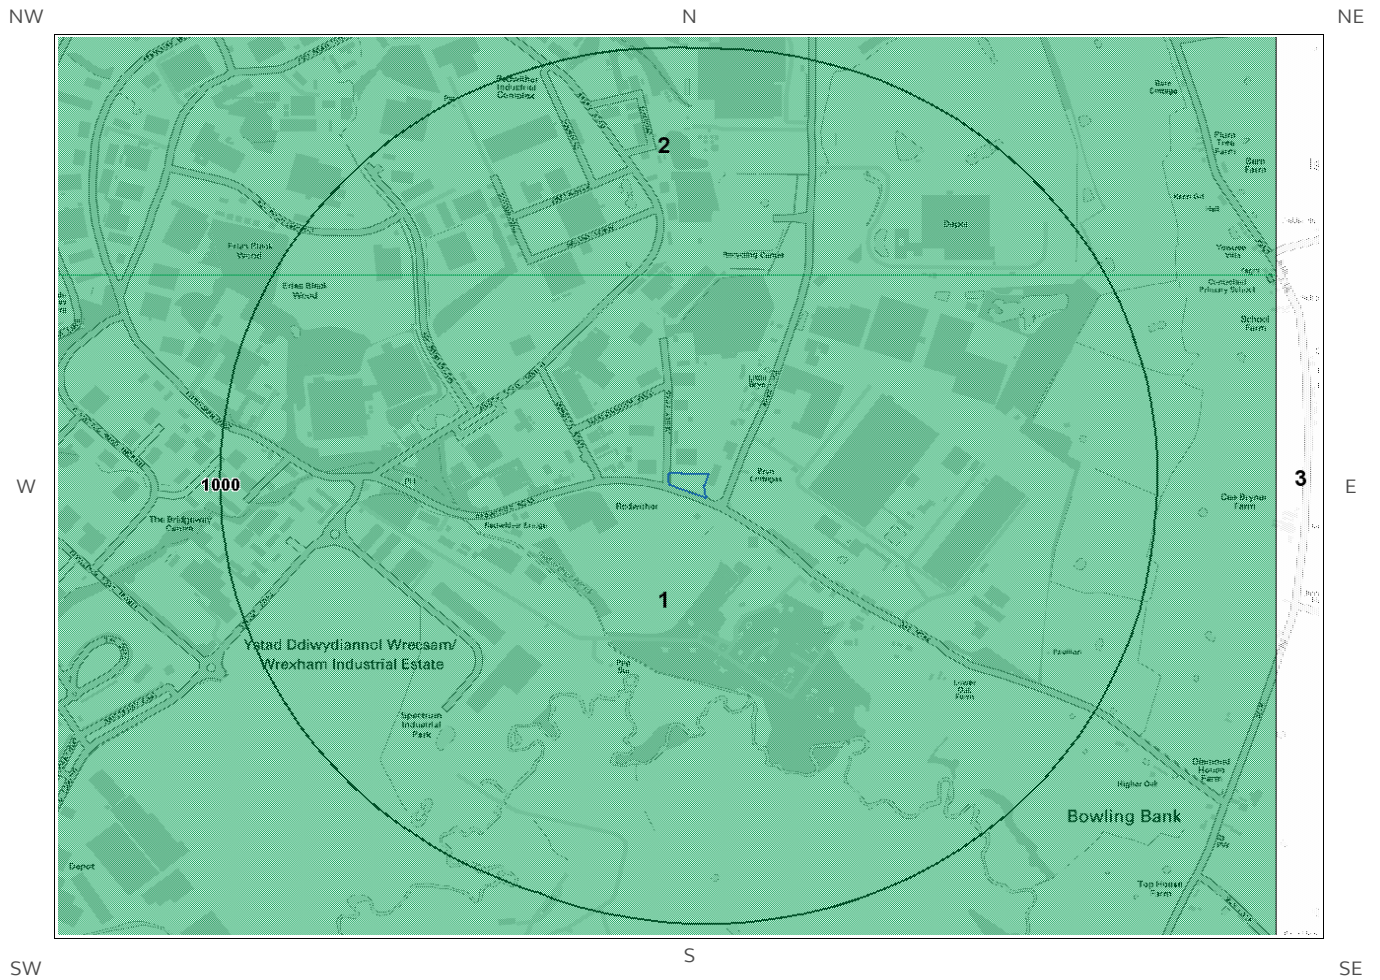

1_10,000 Availability Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

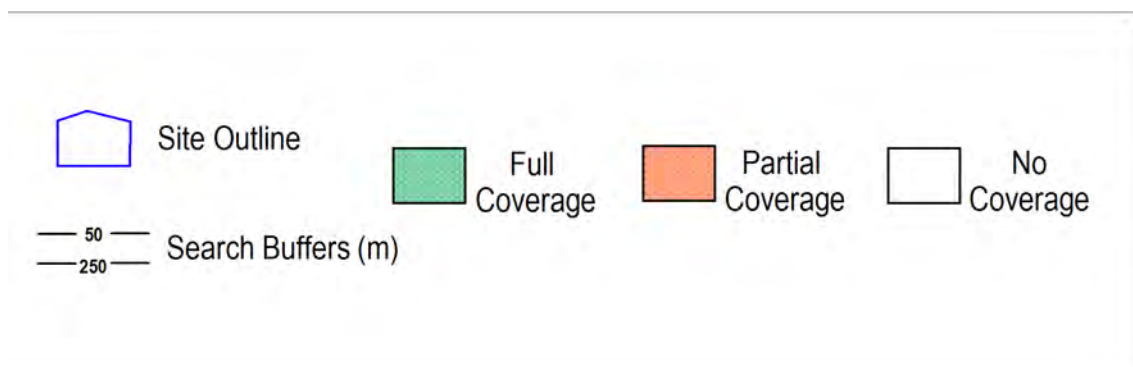

Availability of 1:10,000 Scale Geology Mapping

The following information represents the availability of the key components of the 1:10,000 scale geological data.

ID	Distance	Artificial Coverage	Superficial Coverage	Bedrock Coverage	Mass Movement Coverage
1	0.0	Some deposits are mapped	Full	Full	No coverage
2	467.0	Some deposits are mapped	Full	Full	No coverage
3	1263.0	No deposits are mapped	No coverage	No coverage	No coverage


Guidance: The 1:10,000 scale geological interpretation is the most detailed generally available from BGS and is the scale at which most geological surveying is carried out in the field. The database is presented as four types of geology (artificial, mass movement, superficial and bedrock), although not all themes are mapped or available on every map sheet. Therefore a coverage layer showing the availability of the four themes is presented above.

The definitions of coverage are as follows:

Geology	Full Coverage	Partial Coverage	No Coverage
Bedrock	The whole tile has been mapped	Some but not all the tile has been mapped	No coverage
Superficial	The whole tile has been mapped	Some but not all of the tile has been mapped	No coverage
Artificial	Some deposits are mapped on this tile	-	No deposits are mapped
Mass Movement	Some deposits are mapped on this tile	-	No coverage

1 Geology (1:10,000 scale).

1.1 Artificial Ground map (1:10,000 scale)

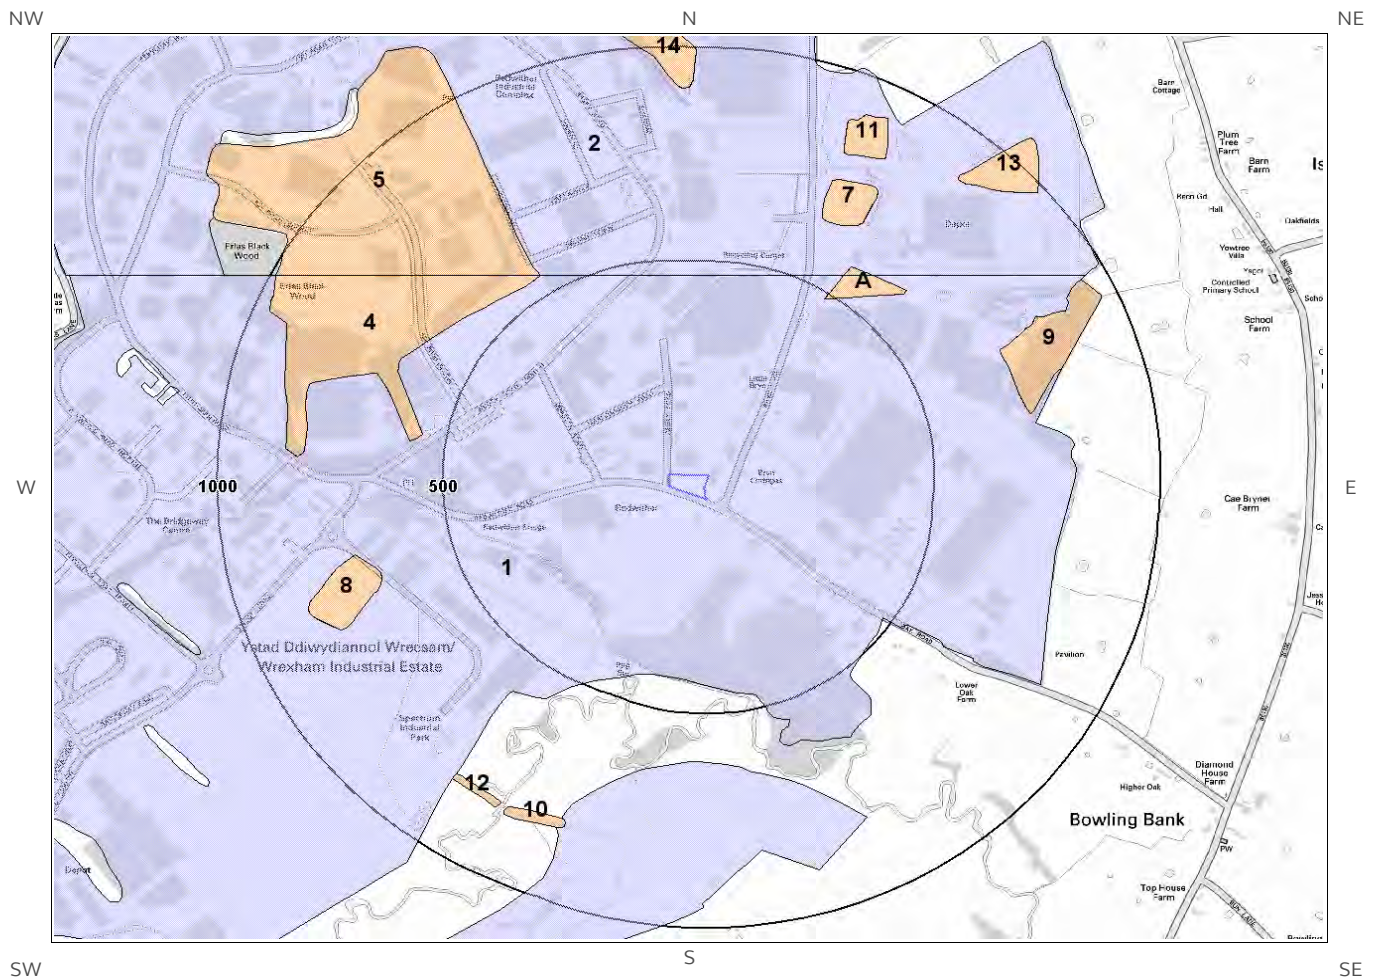

Artificial Ground Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



1. Geology 1:10,000 scale


1.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

Are there any records of Artificial/ Made Ground within 500m of the study site boundary at 1:10,000 scale? Yes


ID	Distance	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	LSGR-UNKNOWN	Landscaped Ground (Undivided)	Unknown/unclassified Entry
2	467.0	N	LSGR-UNKNOWN	Landscaped Ground (Undivided)	Unknown/unclassified Entry
3A	485.0	NE	MGR-ARTDP	Made Ground (Undivided)	Artificial Deposit

1.2 Superficial Deposits and Landslips map (1:10,000 scale)

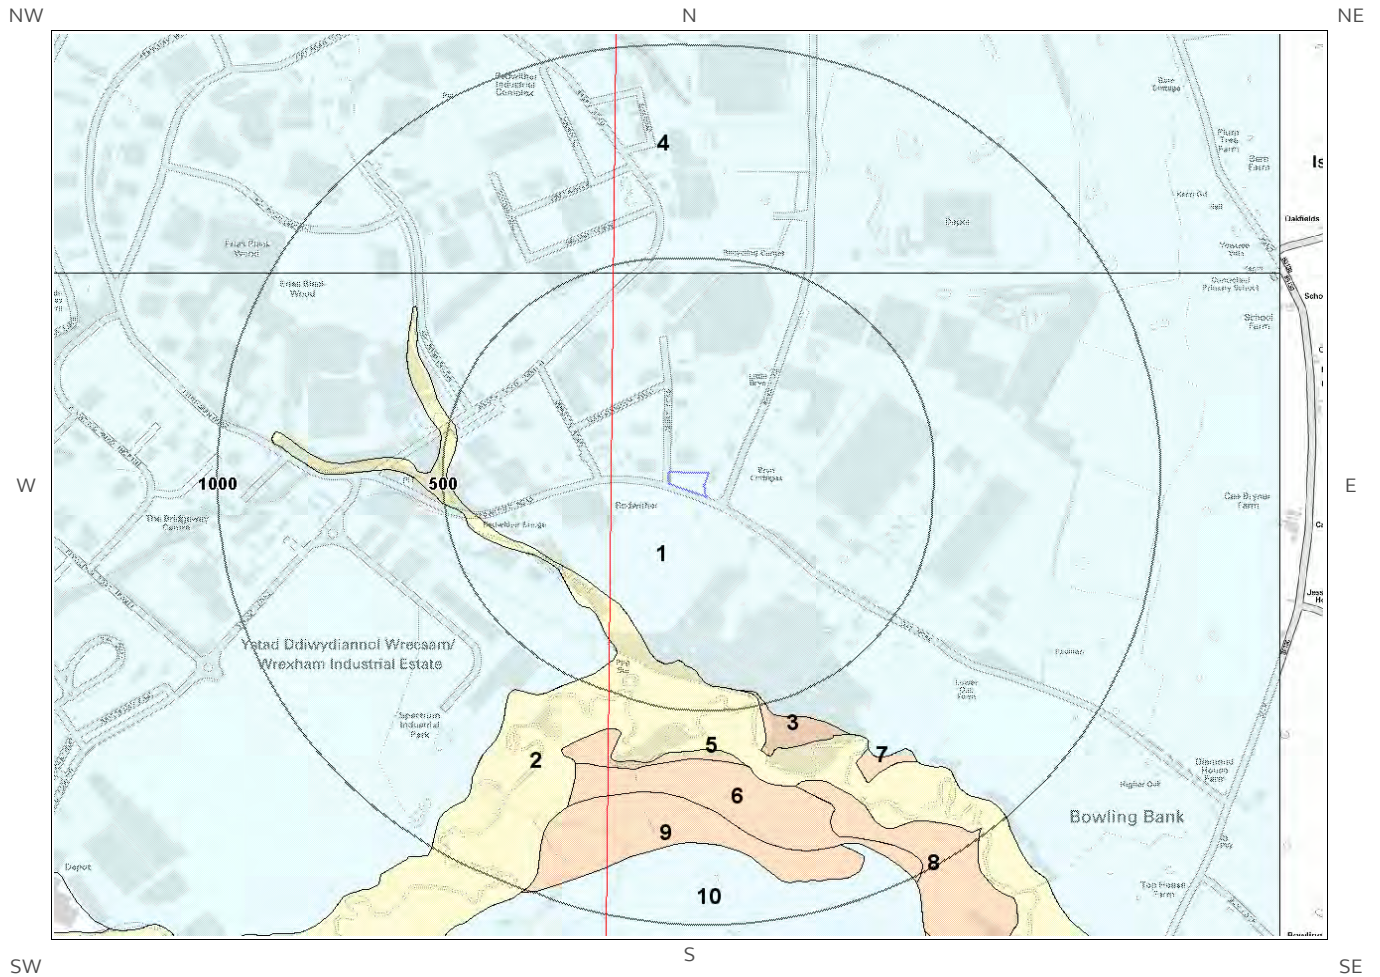

Artificial Ground Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

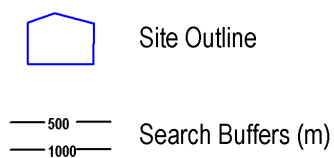

1.2 Superficial Deposits and Landslips

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary at 1:10,000 scale? Yes

ID	Distance (m)	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	TILL-DMTN	Till - Diamicton	Diamicton
2	291.0	SW	ALV-C	Alluvium - Clay (unlithified Deposits Coding Scheme)	Clay
3	456.0	S	RTD1-XSV	River Terrace Deposits, 1 - Sand And Gravel	Sand And Gravel
4	467.0	N	TILL-DMTN	Till - Diamicton	Diamicton

1.2.2 Landslip


Are there any records of Landslip within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:10,000 scale


This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

1.3 Bedrock and linear features map (1:10,000 scale)

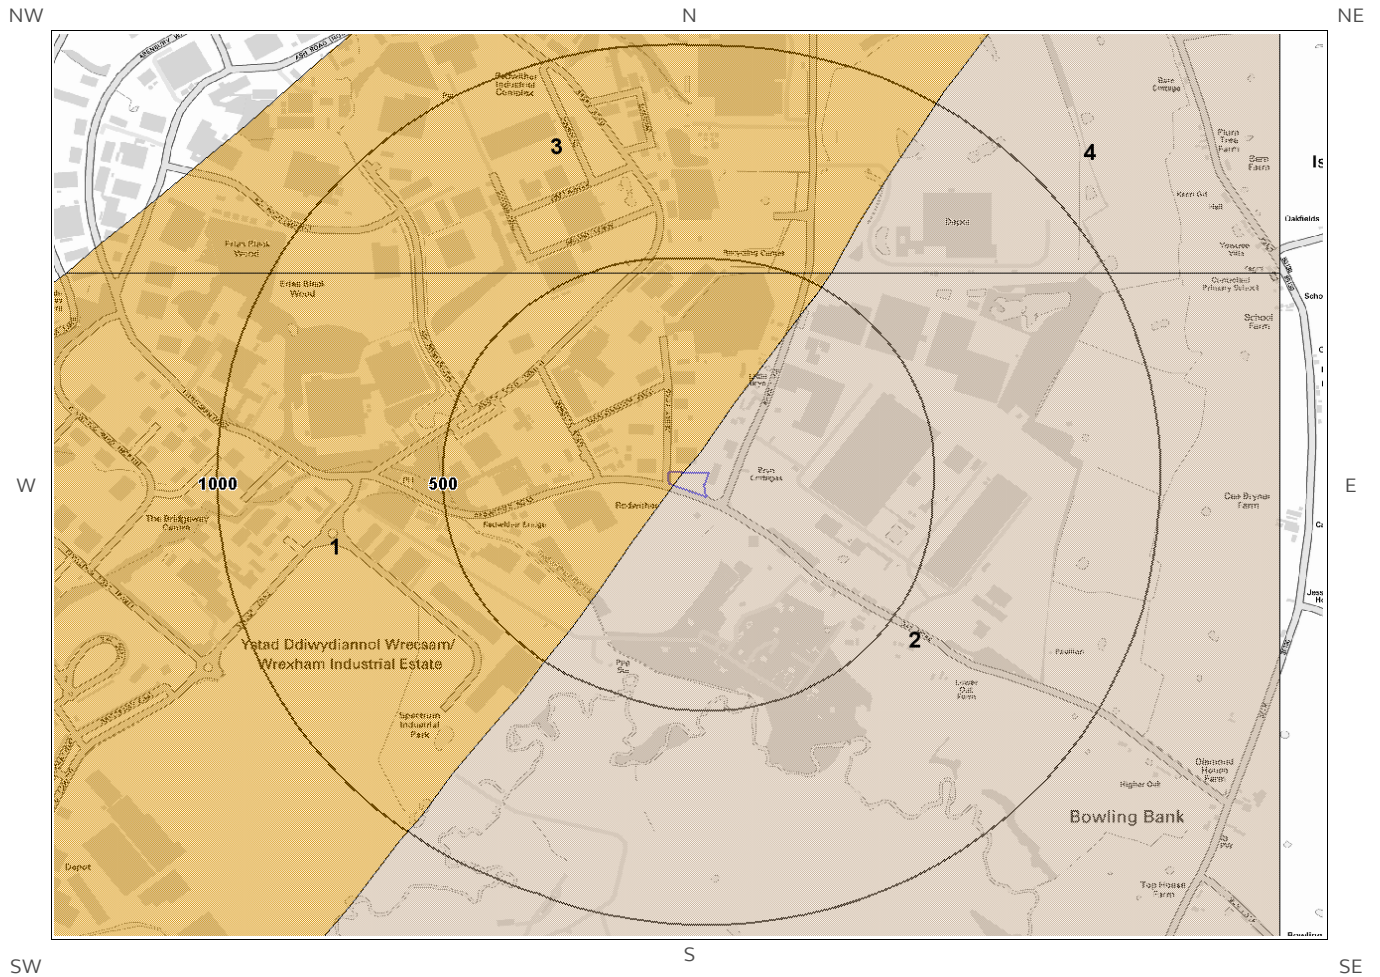

Bedrock and linear features Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

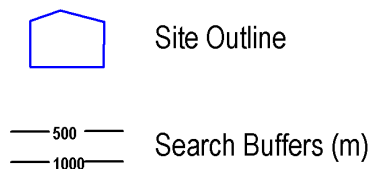

1.3 Bedrock and linear features

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary at 1:10,000 scale.

ID	Distance (m)	Direction	LEX Code	Description	Rock Age
1	0.0	On Site	SAL-CYCCM	Salop Formation - Sedimentary Rock Cycles, Coal Measure Type	Cisuralian Epoch - Westphalian D Sub-age
2	0.0	On Site	KNSF-SDST	Kinnerton Sandstone Formation - Sandstone	Early Triassic Epoch
3	467.0	N	SAL-MDST	Salop Formation - Mudstone	Cisuralian Epoch - Westphalian D Sub-age

1.3.2 Linear features

Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale? No


Database searched and no data found at this scale.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of great Britain at 1:10,000 scale.


This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2 Geology 1:50,000 Scale

2.1 Artificial Ground map

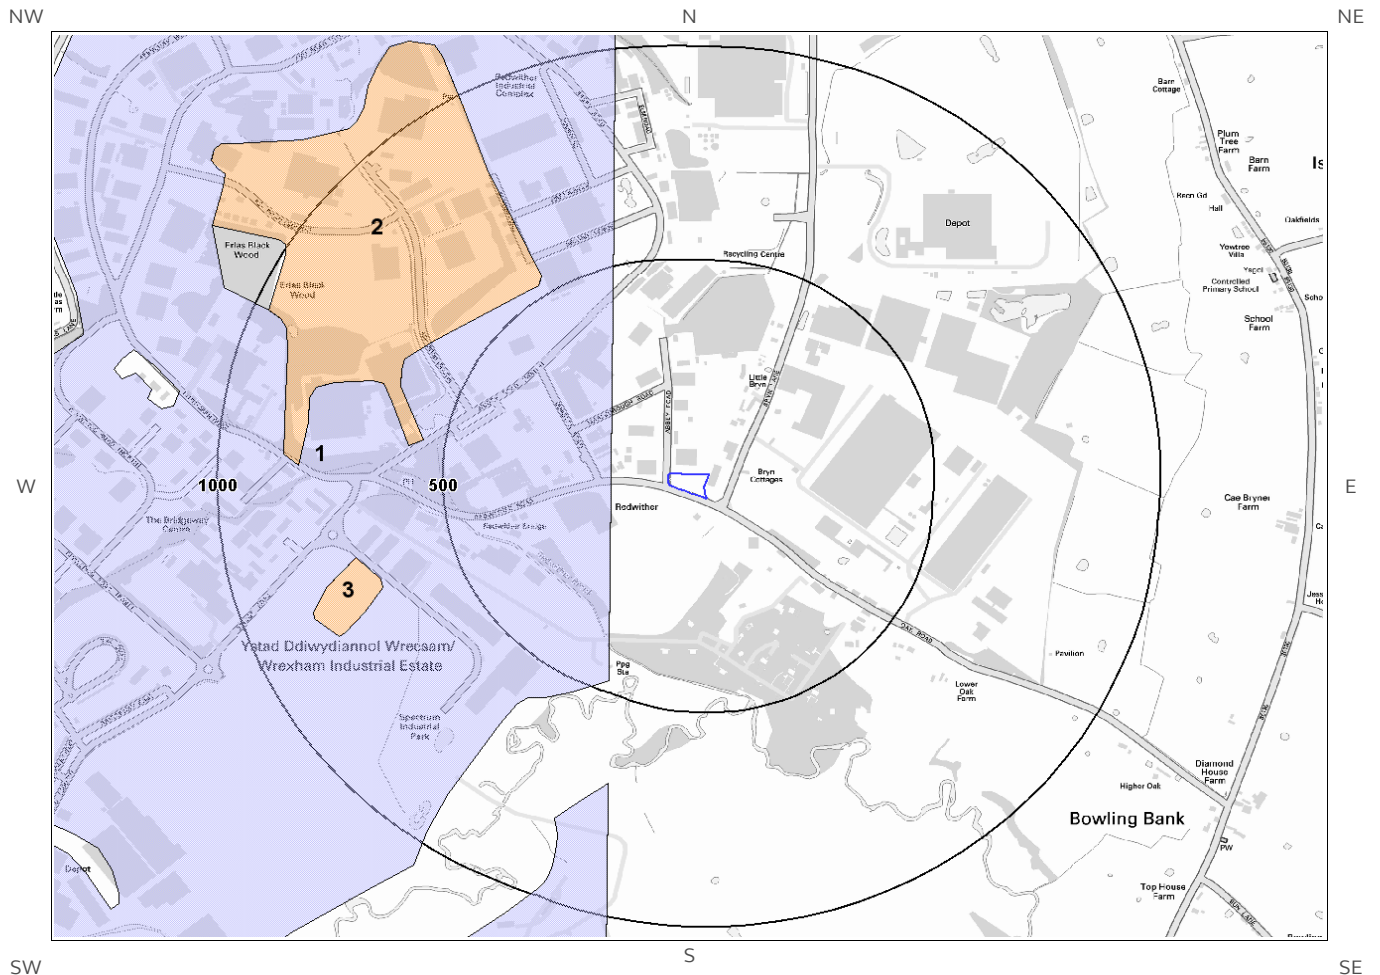

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

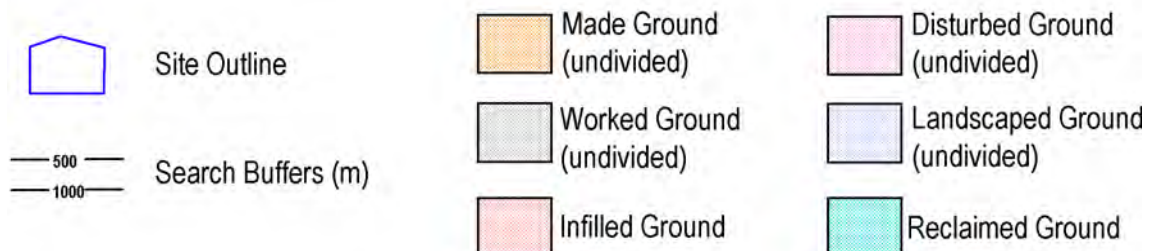

2. Geology 1:50,000 scale

2.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 122

2.1.1 Artificial/ Made Ground

Are there any records of Artificial/ Made Ground within 500m of the study site boundary? Yes


ID	Distance (m)	Direction	LEX Code	Description	Rock Description
1	127.0	W	LSGR-ARTGR	LANDSCAPED GROUND (UNDIVIDED)	ARTIFICIALLY MODIFIED GROUND

2.1.2 Permeability of Artificial Ground

Are there any records relating to permeability of artificial ground within the study site boundary? No

Database searched and no data found.


2.2 Superficial Deposits and Landslips map (1:50,000 scale)

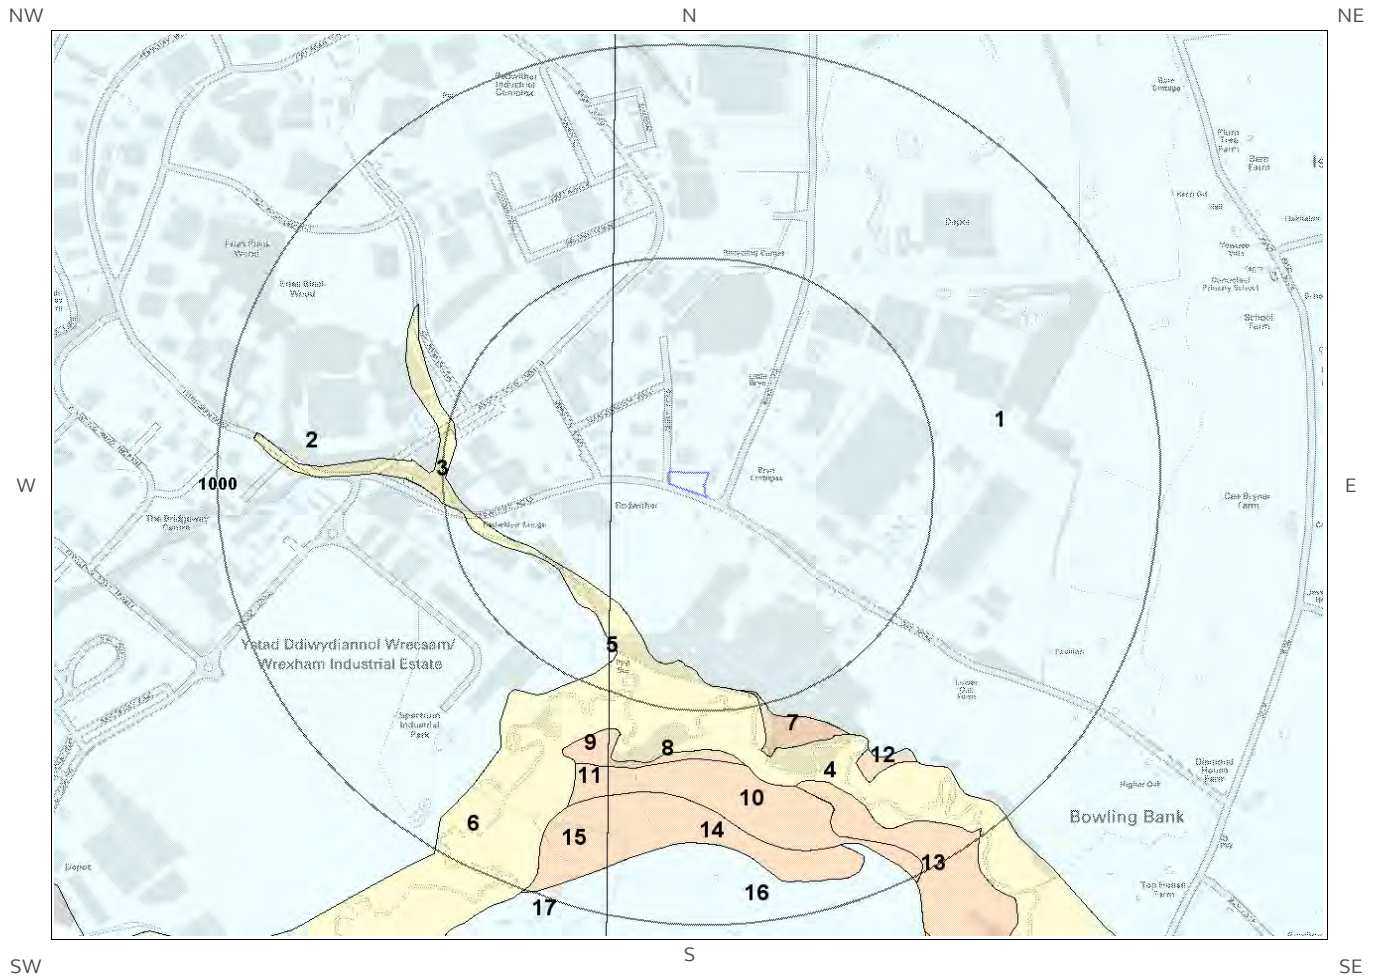

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



Site Outline



Search Buffers (m)

2.2 Superficial Deposits and Landslips

2.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? Yes

ID	Distance	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	TILLD-DMTN	TILL, DEVENSIAN	DIAMICTON
2	127.0	W	TILLD-DMTN	TILL, DEVENSIAN	DIAMICTON
3	292.0	SW	ALV-XCZSV	ALLUVIUM	CLAY, SILT, SAND AND GRAVEL
4	296.0	SW	ALV-XCZSV	ALLUVIUM	CLAY, SILT, SAND AND GRAVEL
5	387.0	S	TILLD-DMTN	TILL, DEVENSIAN	DIAMICTON
6	438.0	S	ALV-XCZSV	ALLUVIUM	CLAY, SILT, SAND AND GRAVEL
7	456.0	S	RTD1-XSV	RIVER TERRACE DEPOSITS, 1	SAND AND GRAVEL

2.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? Yes

Distance (m)	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Mixed	High	Low

2.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, there are: Artificial/ Made Ground, Superficial/ Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.


2.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site boundary?


No

Database searched and no data found.

2.3 Bedrock and linear features map (1:50,000 scale)

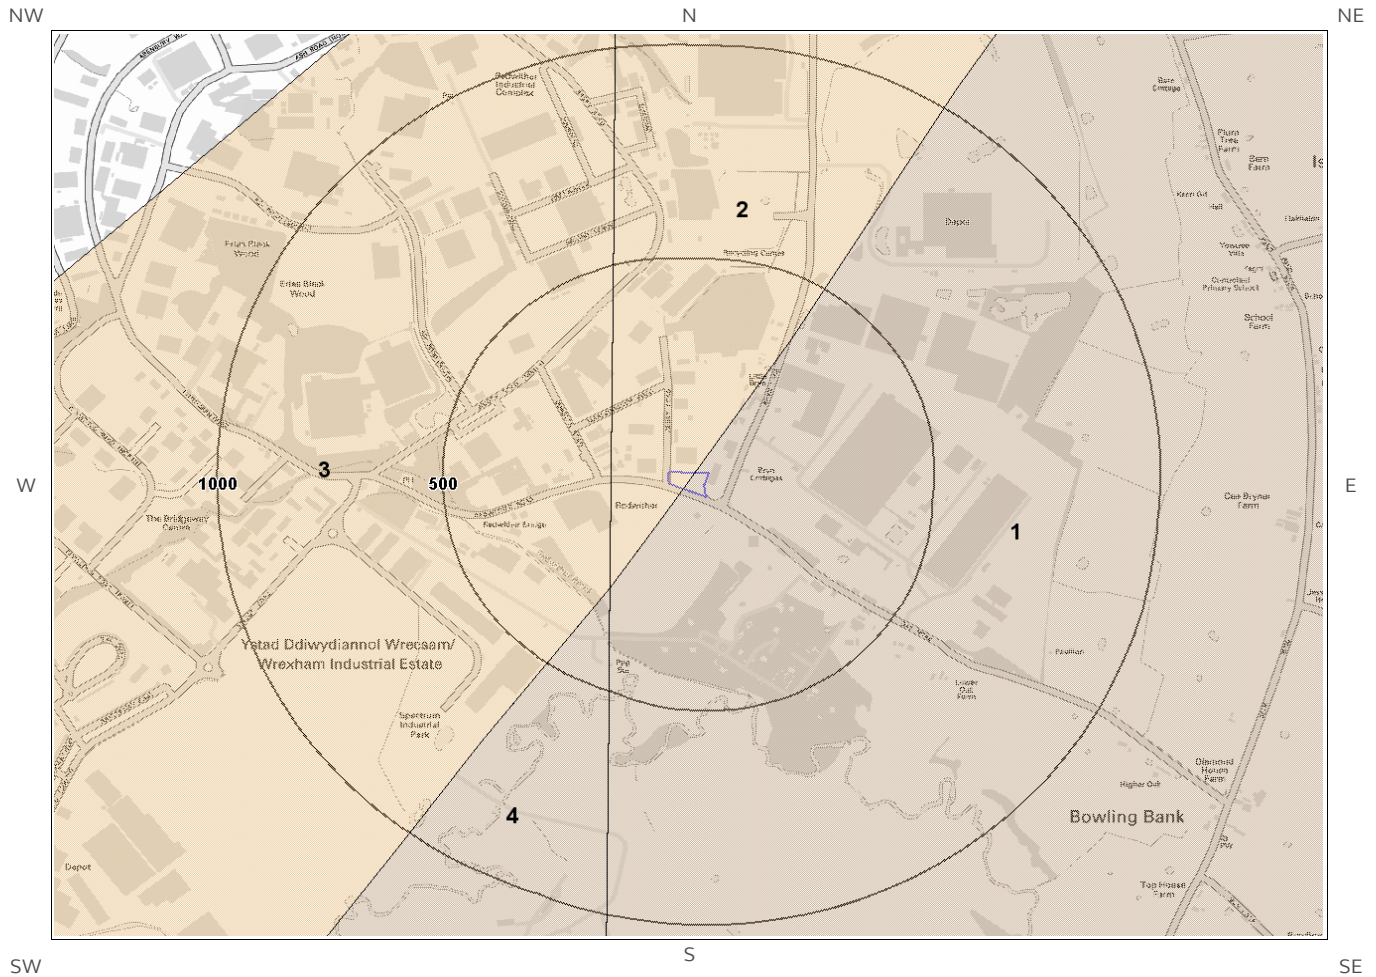

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

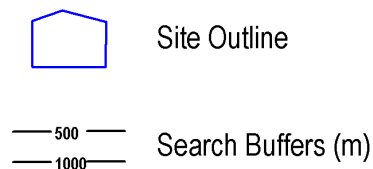

2.3 Bedrock, Solid Geology & linear features

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 122

2.3.1 Bedrock/Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary:

ID	Distance	Direction	LEX Code	Rock Description	Rock Age
1	0.0	On Site	KNSF-SDST	KINNERTON SANDSTONE FORMATION - SANDSTONE	-
2	0.0	On Site	SAL-MDSC	SALOP FORMATION - MUDSTONE, SANDSTONE AND CONGLOMERATE	WESTPHALIAN
3	127.0	W	SAL-MDSC	SALOP FORMATION - MUDSTONE, SANDSTONE AND CONGLOMERATE	WESTPHALIAN
4	276.0	SW	KNSF-SDST	KINNERTON SANDSTONE FORMATION - SANDSTONE	-

2.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site boundary? Yes

Distance	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Intergranular	High	High
0.0	On Site	Fracture	Moderate	Low

2.3.3 Linear features

Are there any records of linear features within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nation wide coverage.

3 Radon Data

3.1 Radon Affected Areas


Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

3.2 Radon Protection


Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

4 Ground Workings map

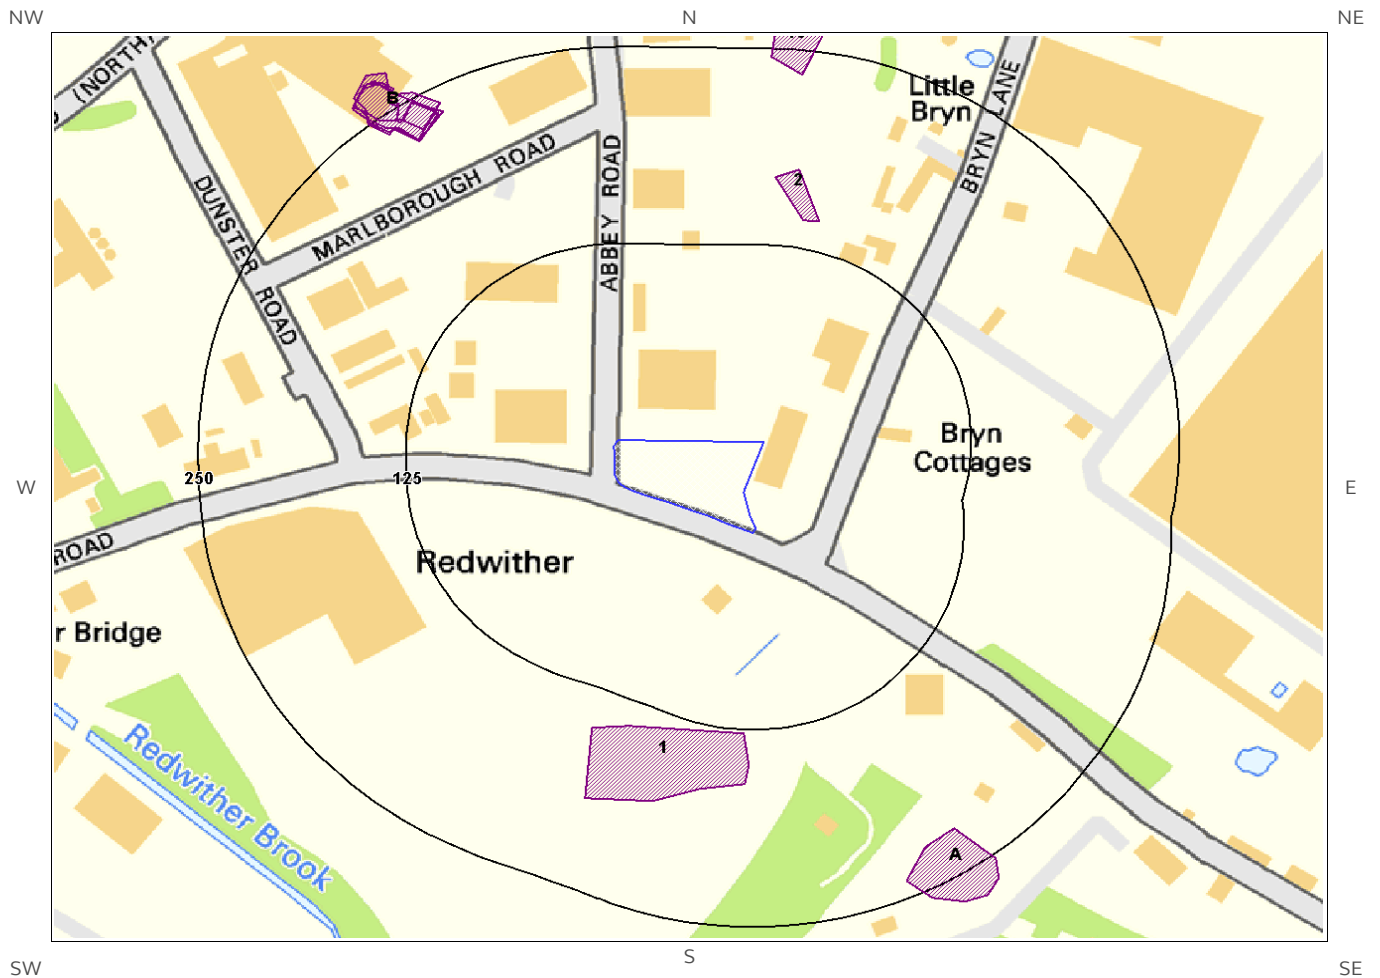

Ground Workings Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

- | | | | |
|---|--------------------|---|----------------------------------|
|  | Site Outline |  | Historic Surface Ground Workings |
|  | Search Buffers (m) |  | Historic Underground Workings |
| | |  | Current Ground Workings |

4 Ground Workings

4.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Use	Date
1	127.0	S	338679 349328	Unspecified Pit	1964
2	143.0	N	338757 349689	Unspecified Pit	1964
3A	223.0	SE	338851 349264	Unspecified Heap	1964
4A	223.0	SE	338851 349264	Unspecified Heap	1977
5A	223.0	SE	338851 349264	Unspecified Heap	1992
6B	224.0	NW	338516 349741	Pond	1909
7B	225.0	NW	338507 349742	Pond	1938
8B	225.0	NW	338515 349743	Ponds	1872
9B	230.0	NW	338517 349749	Ponds	1898
10	234.0	N	338764 349841	Unspecified Heap	1964

4.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? No

Database searched and no data found.

4.3 Current Ground Workings

This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? No

Database searched and no data found.

5 Mining, Extraction & Natural Cavities map



5 Mining, Extraction & Natural Cavities

5.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? Yes

The following Coal Mining information provided by the Coal Authority is not represented on Mapping:

Distance (m)	Direction	Details
467.0	N	The site lies in or in proximity to the coal mining reporting area as defined by the Coal Authority

5.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

5.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.6 Natural Cavities

This dataset provides information based on the Peter Brett Associates natural cavities database. The dataset is made up of points and polygons. Where polygons are used these represent an area in which it is expected the cavities could be found. It does not indicate that cavities are present everywhere within the polygon, and caution should be used in the interpretation of this data.

Are there any Natural Cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.7 Brine Extraction

This data provides information from the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.9 Cornwall and Devon Metalliferous Mining

This dataset provides information on metalliferous mining areas in Cornwall/Devon and is derived from records held by Mining Searches UK.

Are there any Cornwall and Devon Metalliferous Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.10 Clay Mining

This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.


Are there any Clay Mining areas within 1000m of the study site boundary?

No


Database searched and no data found.

6 Natural Ground Subsidence


6.1 Shrink-Swell Clay map

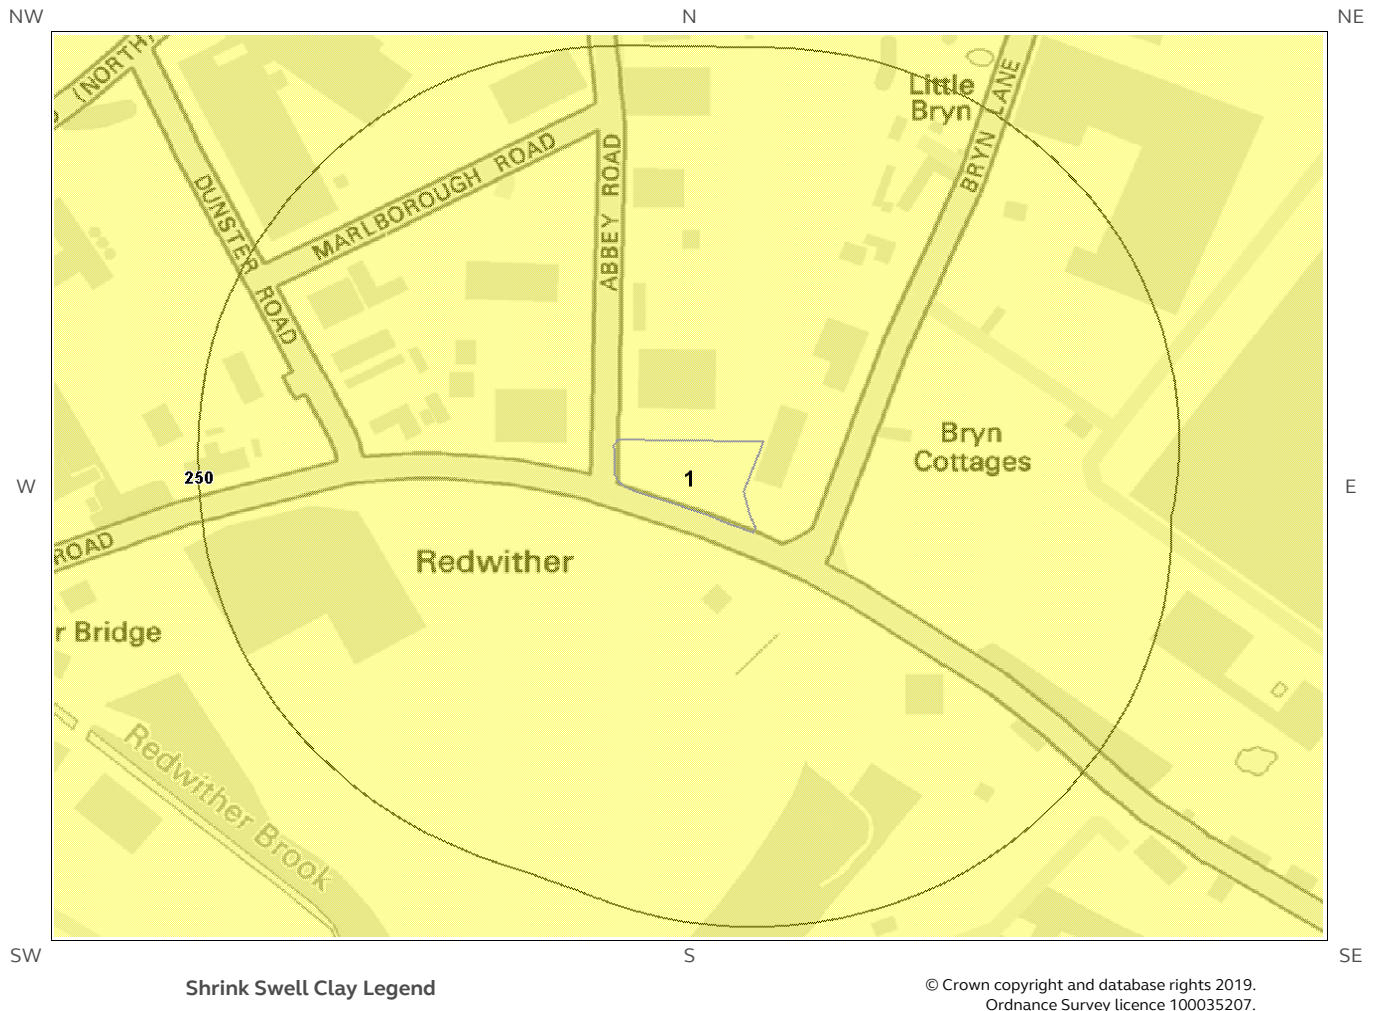


6.2 Landslides map

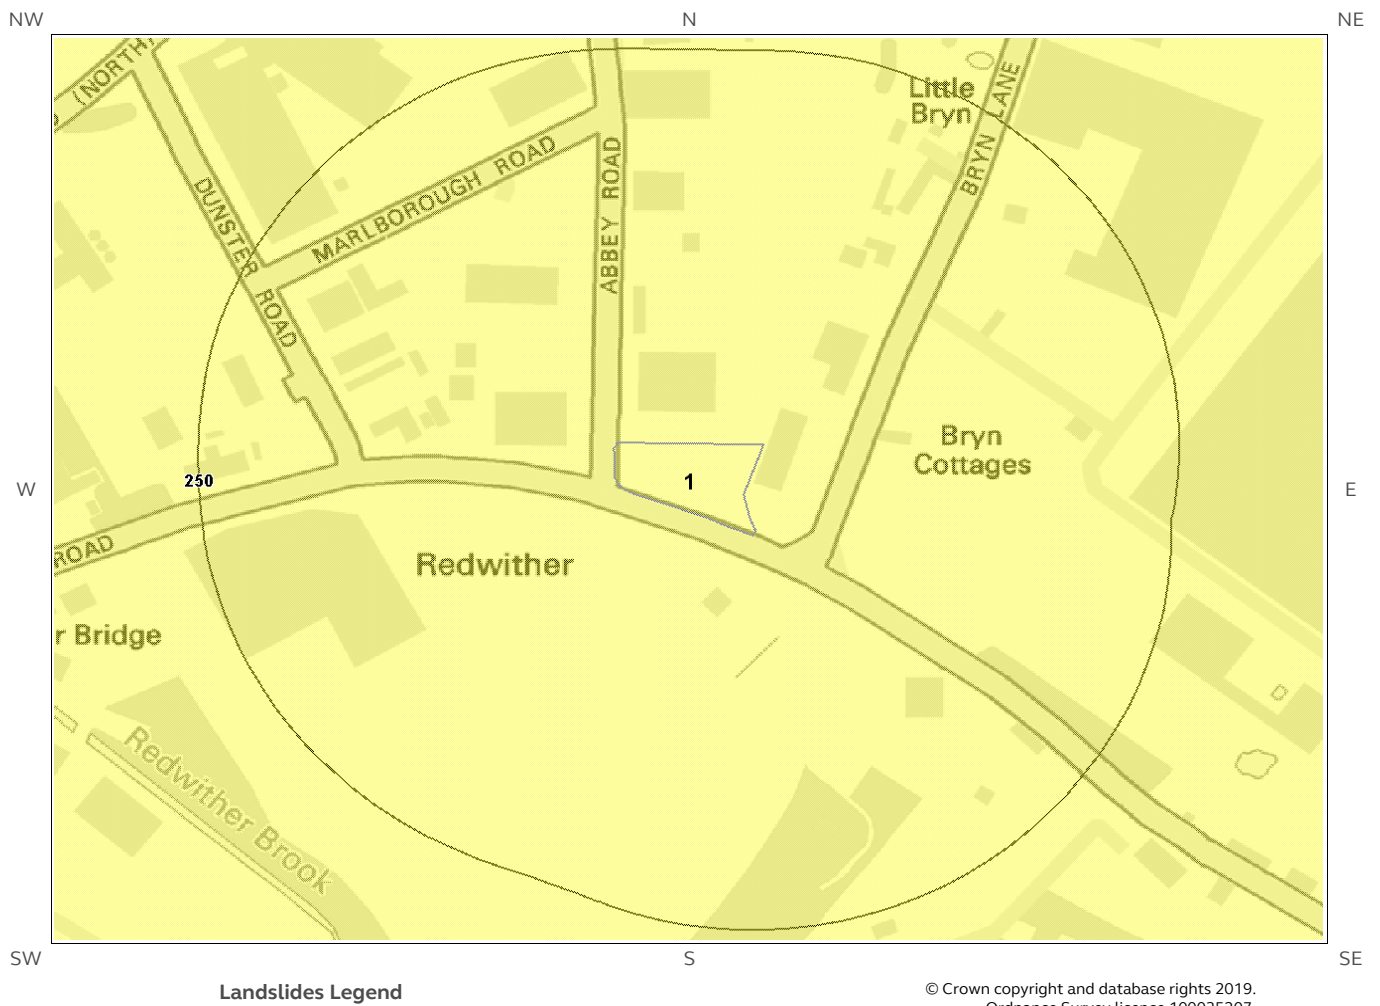


6.3 Ground Dissolution of Soluble Rocks map

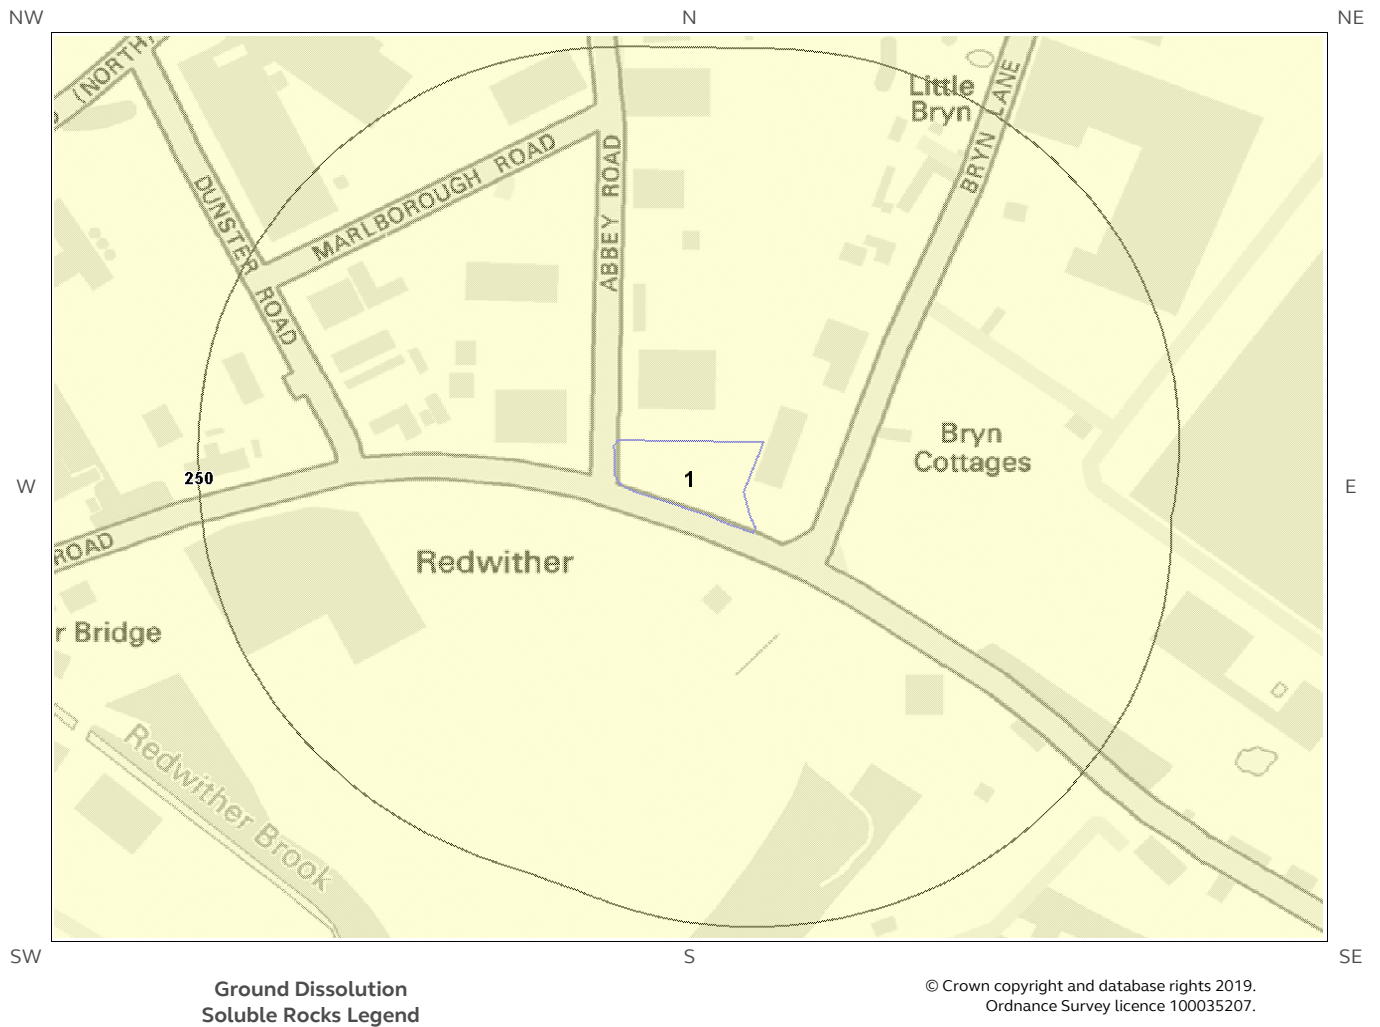


6.4 Compressible Deposits map

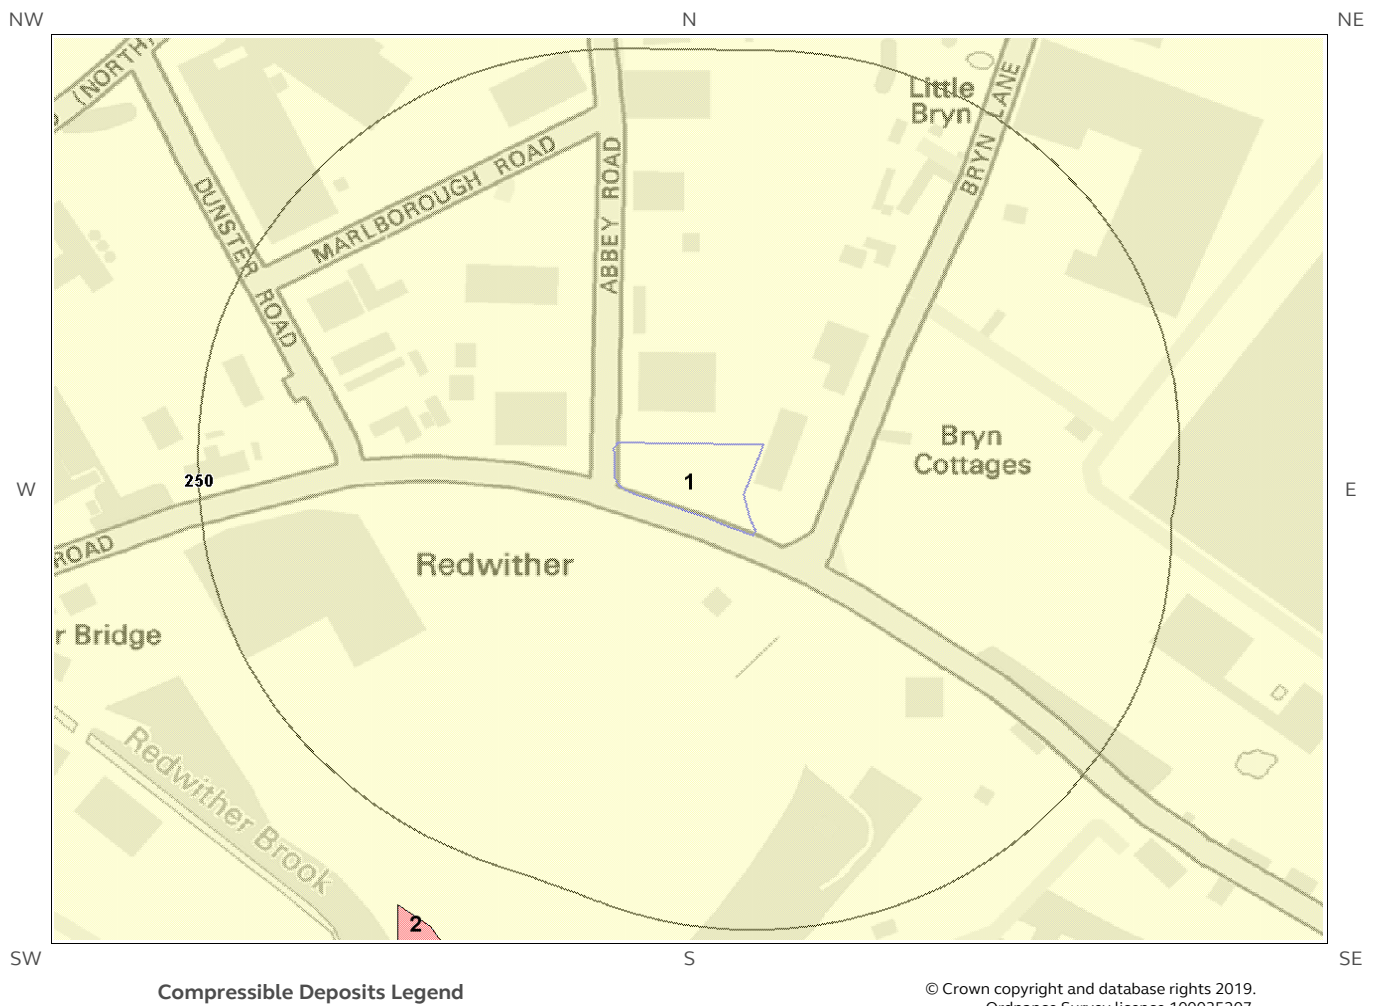

6.5 Collapsible Deposits map

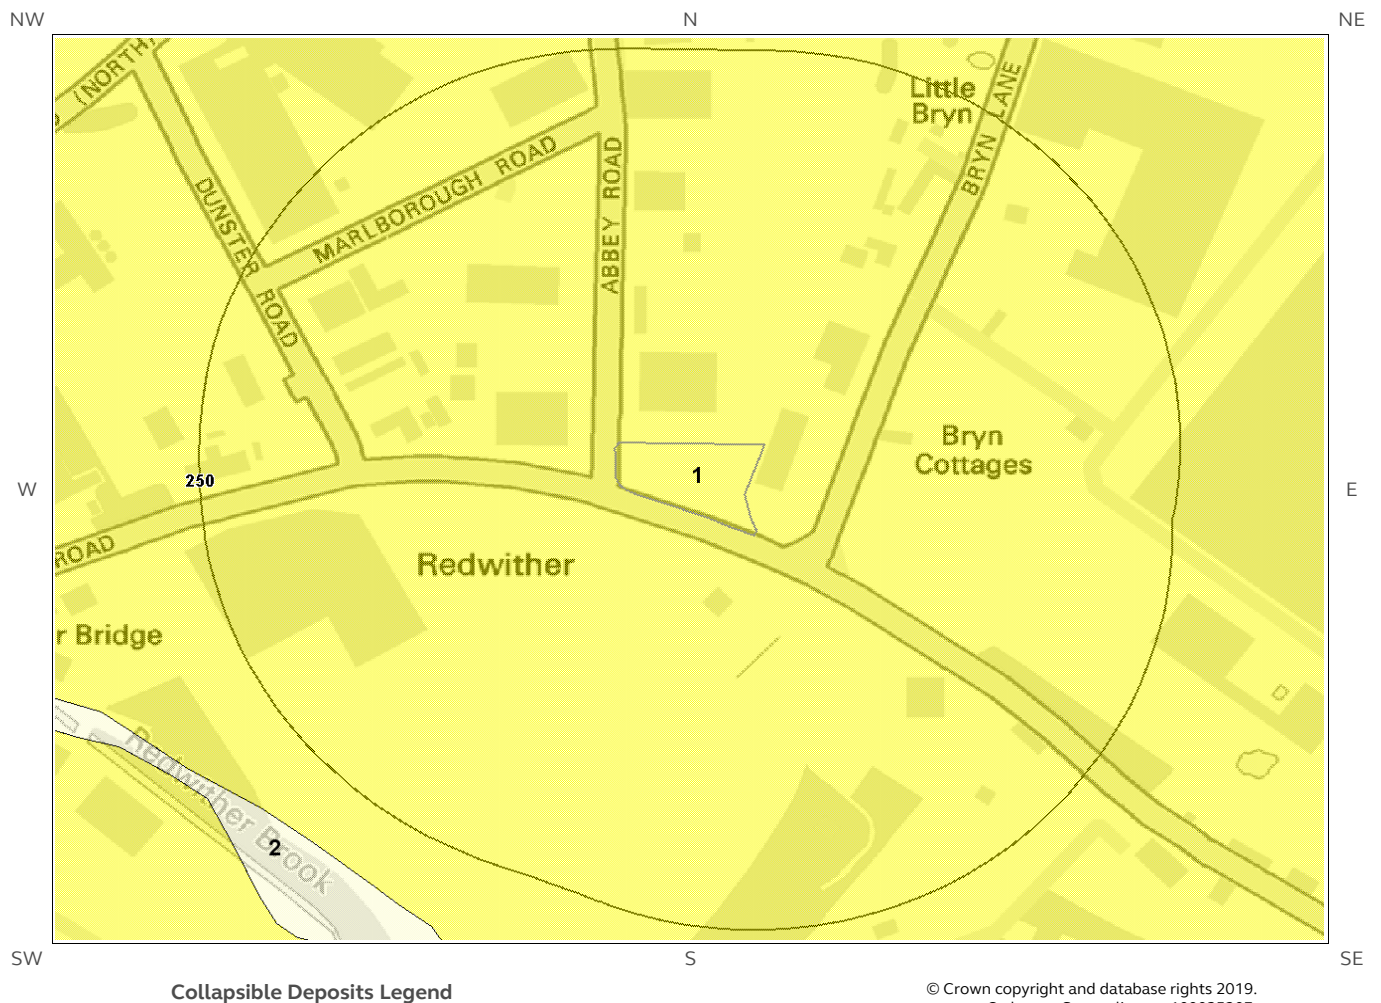

6.6 Running Sand map

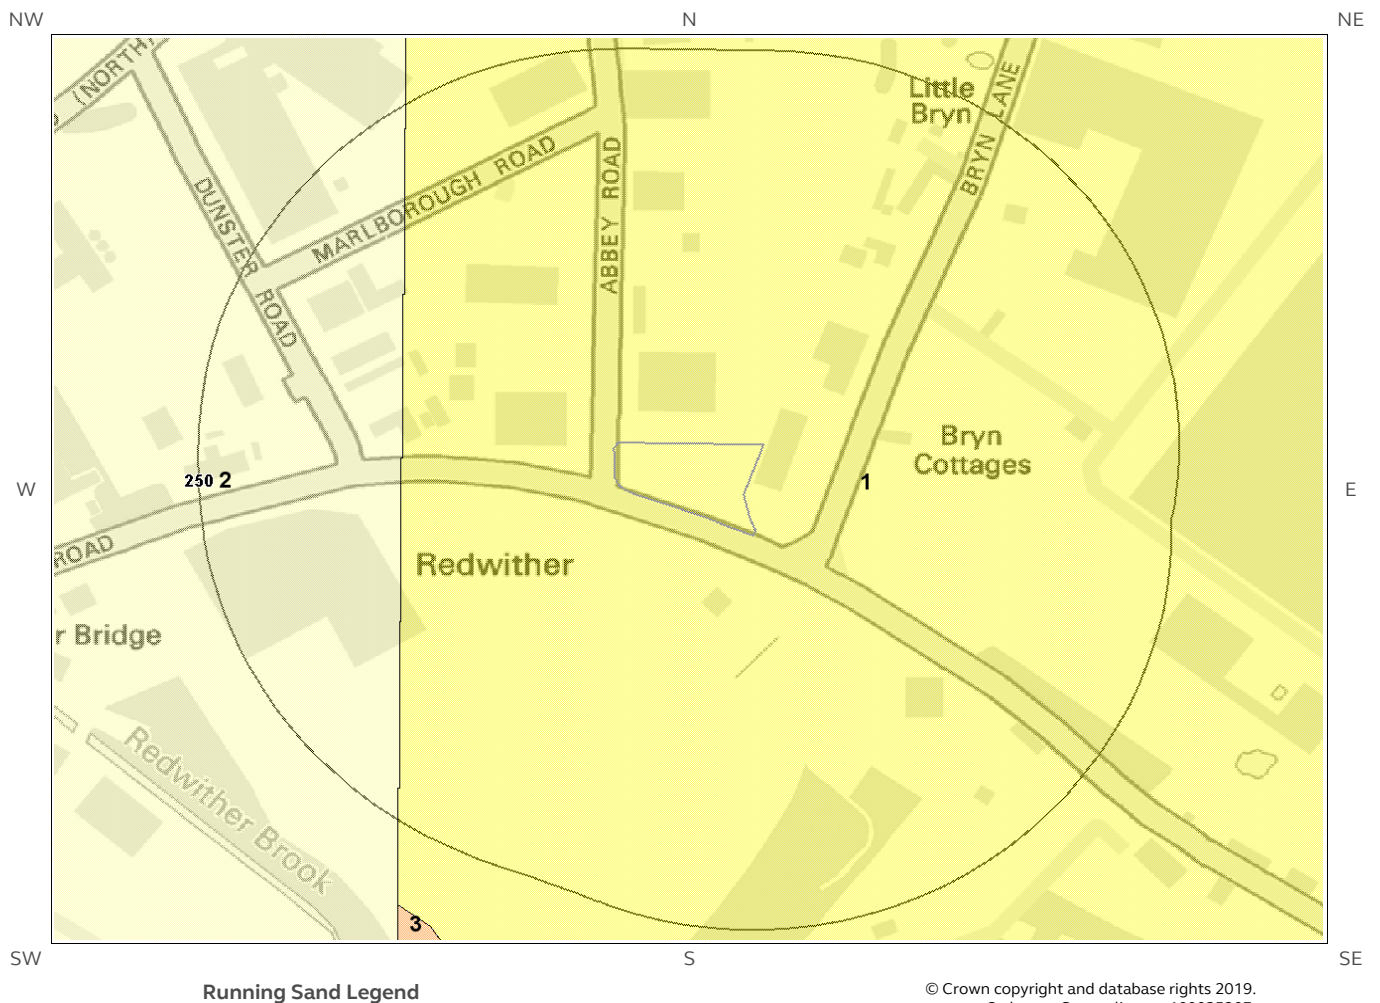

6 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site** boundary? Very Low

6.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Ground conditions predominantly low plasticity. No special actions required to avoid problems due to shrink-swell clays. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with shrink-swell clays.

6.2 Landslides

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

6.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

* This includes an automatically generated 50m buffer zone around the site

6.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for compressible deposits identified. No special actions required to avoid problems due to compressible deposits. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with compressible deposits.

6.5 Collapsible Deposits

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Deposits with potential to collapse when loaded and saturated are unlikely to be present. No special ground investigation required or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

6.6 Running Sands

The following Running Sands information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Very low potential for running sand problems if water table rises or if sandy strata are exposed to water. No special actions required, to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.

7 Borehole Records map

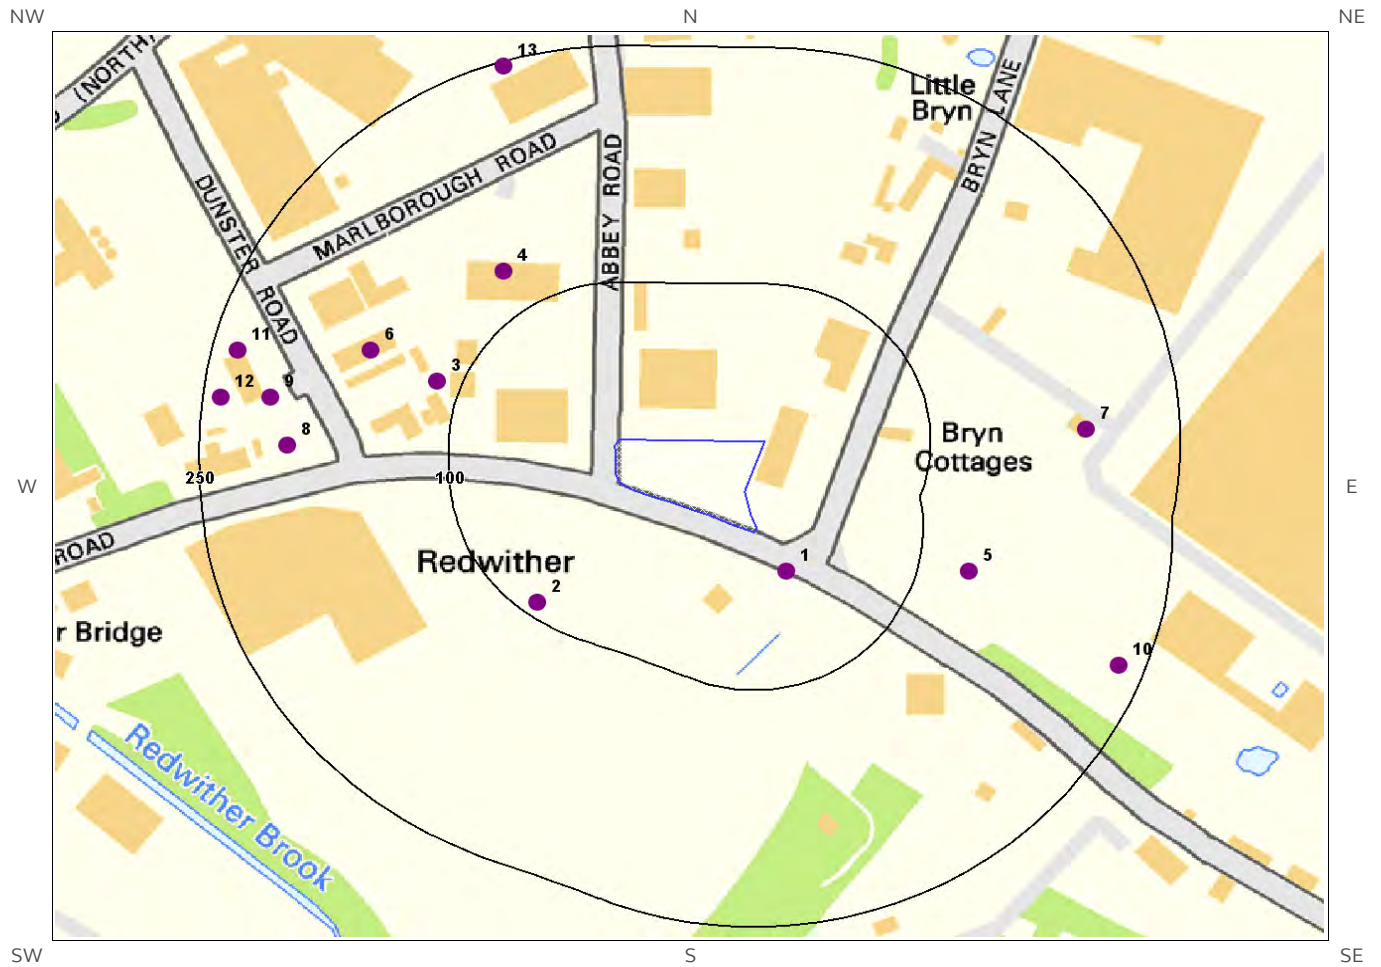

Borehole Records Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.

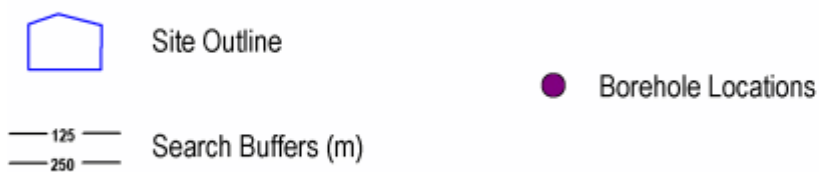

7 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary:

13

ID	Distance (m)	Direction	NGR	BGS Reference	Drilled Length	Borehole Name
1	31.0	SE	338750 349450	SJ34NE161	Not Available	BICC PLC WREXHAM IND EST BH1
2	91.0	SW	338600 349430	SJ34NE25	18	REDWITHER ABENBURY
3	115.0	W	338540 349570	SJ34NE120	45.01	WREXHAM IND ESTATE, CHEM. DISPOSAL. 1A
4	127.0	NW	338580 349640	SJ34NE117	10	WREXHAM IND ESTATE, CHEM. DISPOSAL. 2
5	130.0	E	338860 349450	SJ34NE34/1	34.44	WREXHAM IND EST. BICC SITE. 1
6	159.0	W	338500 349590	SJ34NE145	6.5	IND EST. BRITISH TISSUES. 4A
7	193.0	E	338930 349540	SJ34NE34/7	30.48	WREXHAM IND EST. BICC SITE. 7
8	197.0	W	338450 349530	SJ34NE232	Not Available	REDWITHER INDUSTRIAL COMPLEX DUNSTER ROAD 1
9	210.0	W	338440 349560	SJ34NE233	Not Available	REDWITHER INDUSTRIAL COMPLEX DUNSTER ROAD 2
10	234.0	E	338950 349390	SJ34NE34/2	9.14	WREXHAM IND EST. BICC SITE. 2
11	235.0	W	338420 349590	SJ34NE234	Not Available	REDWITHER INDUSTRIAL COMPLEX DUNSTER ROAD 3
12	239.0	W	338410 349560	SJ34NE235	Not Available	REDWITHER INDUSTRIAL COMPLEX DUNSTER ROAD 4
13	247.0	N	338580 349770	SJ34NE122	37	WREXHAM IND ESTATE, CHEM. DISPOSAL. 3A

The borehole records are available using the hyperlinks below: Please note that if the donor of the borehole record has requested the information be held as commercial-in-confidence, the additional data will be held separately by the BGS and a formal request must be made for its release.

#2: scans.bgs.ac.uk/sobi_scans/boreholes/153131
#3: scans.bgs.ac.uk/sobi_scans/boreholes/153290
#4: scans.bgs.ac.uk/sobi_scans/boreholes/153287
#5: scans.bgs.ac.uk/sobi_scans/boreholes/153140
#6: scans.bgs.ac.uk/sobi_scans/boreholes/153315
#7: scans.bgs.ac.uk/sobi_scans/boreholes/153146
#10: scans.bgs.ac.uk/sobi_scans/boreholes/153141
#13: scans.bgs.ac.uk/sobi_scans/boreholes/153292

8 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


4

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geo Insight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	100 - 200 mg/kg
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	100 - 200 mg/kg


*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.

9 Railways and Tunnels map

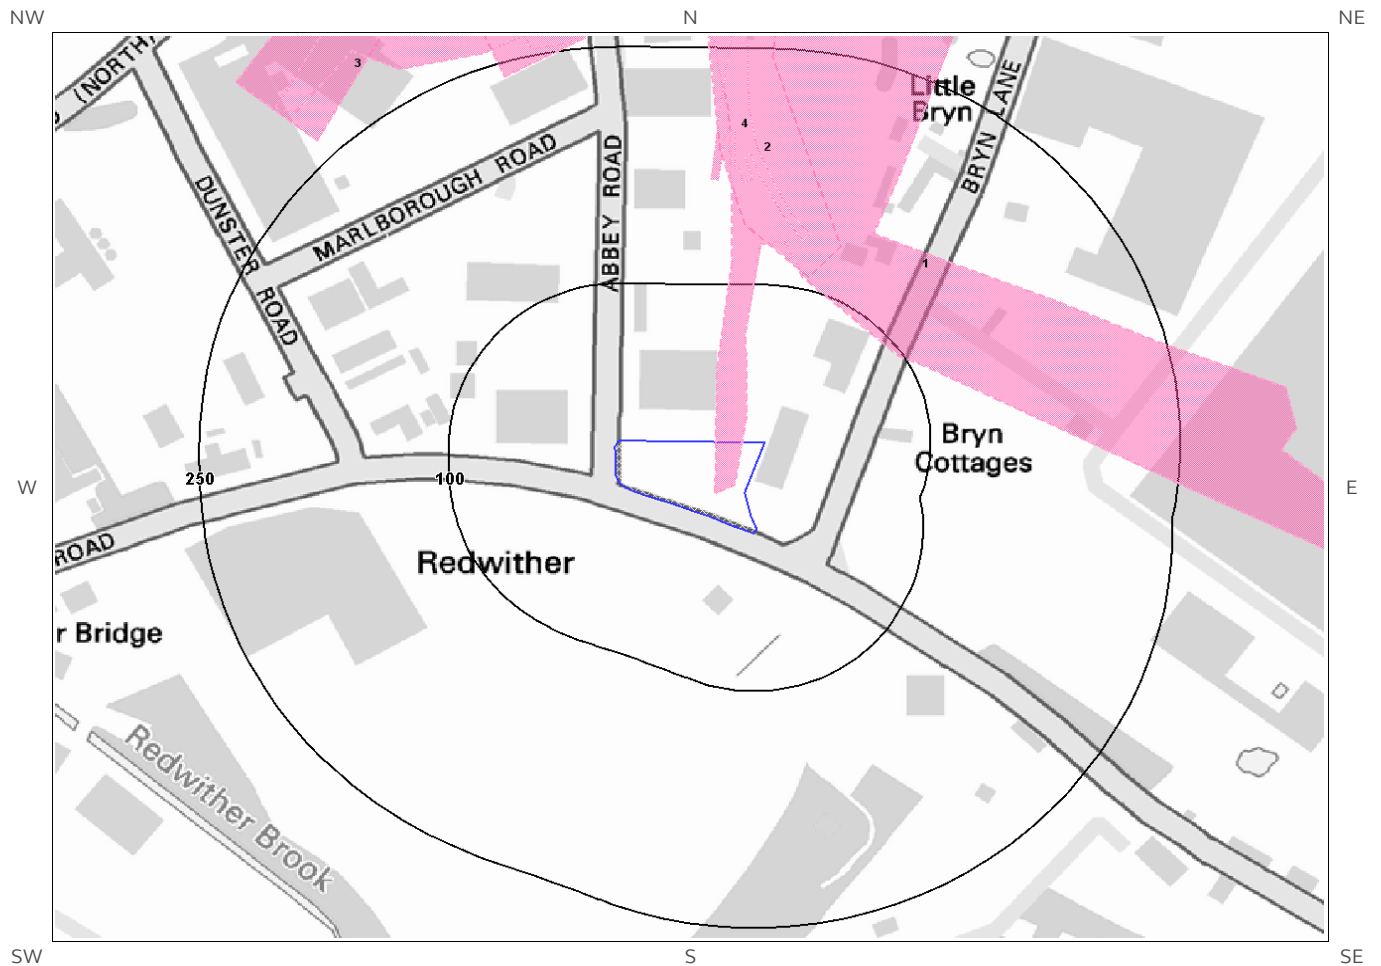

Railways and Tunnels Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.
© OpenStreetMapContributors

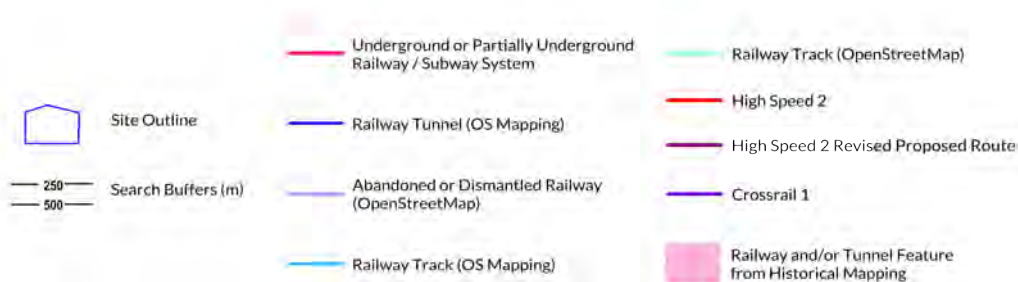

9 Railways and Tunnels

9.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? Yes

Have any historical railway or tunnel features been identified within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Details	Date
1	0	On Site	338558 349907	Railway Sidings	1949
2	108	N	338725 349820	Railway Sidings	1964
4	130	N	338718 349831	Railway Sidings	1959
3	241	N	338526 349864	Railway Sidings	1964

Any records that have been identified are represented on the Railways and Tunnels map.

9.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary? No

Have any historical railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.4 Active Railways

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary? No

Have any active railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.5 Railway Projects

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project? No

Is the study site within 500m of the route of the Crossrail 1 rail project? No

Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a Groundsure HS2 and Crossrail 1 Report.

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Please note that this assessment takes account of both the original Phase 2b proposed route and the amended route proposed in 2016. As the Phase 2b route is still under consultation, Groundsure are providing information on both options until the final route is formally confirmed. Practitioners should take account of this uncertainty when advising clients.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com



British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email: enquiries@bgs.ac.uk
Web: www.bgs.ac.uk



BGS Geological Hazards Reports and general geological enquiries

British Gypsum

British Gypsum Ltd
East Leake
Loughborough
Leicestershire
LE12 6HX



The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk



Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
<https://www.gov.uk/government/organisations/public-health-england>
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000



Johnson Poole & Bloomer Limited

Harris and Pearson Building, Brettell Lane
Brierley Hill, West Midlands
DY5 3LH
Tel: +44 (0) 1384 262 000
Email: enquiries.gs@jpb.co.uk
Website: www.jpb.co.uk



Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505
Website: <http://www.ordnancesurvey.co.uk/>



Getmapping PLC

Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444
Website: <http://www.1.getmapping.com/>



Peter Brett Associates
Caversham Bridge House
Waterman Place
Reading
Berkshire RG1 8DN
Tel: +44 (0)118 950 0761 E-mail: reading@pba.co.uk
Website: <http://www.peterbrett.com/home>



Acknowledgements: Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028].
This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:
<https://www.groundsure.com/terms-and-conditions-feb11-2019>

APPENDIX E

WALKOVER SURVEY PHOTOGRAPHS

Checklist
Photographs

Plate 1 to 7

Site Walkover Checklist

REFERENCES	
Project No.	F9042-19
Site Address	Oak Road Wrexham Industrial Estate
Date of visit	21 August 2019
Prepared by	Melody Wareing
SITE – GENERAL	
Plan of site	See photos
Site size (area) : % building, % hardstanding, % open space / other	0.3 Ha Open space with overhead line tower [photo 1]
Current use (occupants and operations)	Unused. [photo 2]
SITE – BUILDINGS	
Age of building(s)	N/A
Building appearance: no. of storeys, basement, roofing type, chimneys / stacks?, car park, service areas	N/A
Tanks: location (internal / external : above or below ground), age / condition, size / capacity, type, bunding (condition), refuelling point, evidence of stains / spills	N/A
Heating : electric/gas/oil	N/A
Chemical storage : drums, other chemical stores	Rusted drum of unknown origin [photo 4]
Gas control measures (e.g. vents, cowls, monitoring / alarms)	N/A
Other evidence of industrial activity	N/A
Asbestos / deleterious materials – any asbestos surveys?, removal programmes?	Unknown.
Electrical equipment / Transformers – check for PCBs? Backup power supplies (generators)	N/A
SITE – EXTERNAL	
Site surfacing : type (asphalt/concrete etc.), staining, weathering, subsidence, repairs. Landscaped areas.	Predominantly soil and minor vegetation. Mature trees on eastern site boundary [photo 8]
Drainage : interceptors, disposal of storm water / waste water, mains water supply?	Broken drainage pipe in centre of site, one end into concrete service [photo 5 and 6]
Site topography – flat / sloping?, level compared to surroundings, evidence of filling or raising, earthworks?	Generally level. Gully central to site. Approx. 1.5m deep. Running NW-SE towards SE of site

Site Walkover Checklist

Vehicle maintenance : washdown areas, workshops, refuelling points	N/A
Waste : skips / compounds, any hazardous waste? Burning grounds or incinerators	N/A
Sub-stations : age, condition, transformers, operator, servicing?	N/A
Trees – effects on buildings, condition, species and height	Mature trees on east boundary including conifer.
Sloping ground – any indication of instability (cracks in ground, bulges, leaning trees, walls or poles), rotational slip scars.	Gully central to site. Approx. 1.5m deep. Running NW-SE towards SE of site. Steep sides though no obvious cracks
Ecological features of note – Burrows, bats, nest sites, designated preservation areas	None noted
Other features of note within site	N/A
SURROUNDING LAND USES	
General site context – industrial, commercial, urban, agricultural etc.	Industrial
Land use – north (give distances)	Industrial units on boundary
Land use – south (give distances)	Oak Road then overgrown unused land beyond. Believed to be used by local paintball/airsoft group.
Land use – east (give distances)	Industrial units on boundary
Land use – west (give distances)	Abbey Road South then industrial units
Nearby (<500m) sources of pollution – landfills, filling stations, industrial activity.	See desk study report
Nearby river / surface water features – culverted, banks, flood plain. If visible, condition of watercourse	None bar gully, no water within gully during site visit
Adjacent geotechnical features of note – cuttings, quarries, embankments, slopes (particularly if failed), major excavations, deep basements, sources of vibrations (railway or heavy machinery)	N/A
Other features of note adjacent to site	N/A



View East from Abbey Road South towards site. Excavator on site – not operating at time of walkover.



View East along northern boundary towards OHL tower

Notes:	<table><tr><td>Project</td><td>Wrexham SI</td></tr><tr><td>Project No.</td><td>F9042-19</td></tr><tr><td>Carried out for</td><td>Conrad Energy</td></tr></table>	Project	Wrexham SI	Project No.	F9042-19	Carried out for	Conrad Energy	Plate 1
Project	Wrexham SI							
Project No.	F9042-19							
Carried out for	Conrad Energy							



View East along centre of site showing concrete service cover and gully feature



Unknown drum adjacent to north of concrete service cover

Notes:	<table><tr><td>Project</td><td>Wrexham SI</td></tr><tr><td>Project No.</td><td>F9042-19</td></tr><tr><td>Carried out for</td><td>Conrad Energy</td></tr></table>	Project	Wrexham SI	Project No.	F9042-19	Carried out for	Conrad Energy	<table><tr><td>Plate</td><td>2</td></tr></table>	Plate	2
Project	Wrexham SI									
Project No.	F9042-19									
Carried out for	Conrad Energy									
Plate	2									